



TECH TIPS

Dixie Part Numbers: TBA

Applications: 2010 Chevrolet Colorado
2010 GMC Canyon

Condition: The operator of the vehicle may complain that the engine intermittently will not crank.

Cause: A potential cause for the above condition is an improperly crimped connection in the moulded fuse holder on the positive battery cable.

Correction: A voltage drop test should verify if the fuse holder is the cause of the problem, see *TSB-001 Voltage Drop Testing* for a general guide to perform this test. The manufacturer recommends replacing the fuse holder (manufacturer's number 19116350) if found to be the problem.

