



TECH TIPS

Dixie Part Numbers:	S-1422	S-1466	S-1495	S-1497
	S-1502	S-1523	S-80280	TBA

- Applications:**
- 2004 – 2011 Chevrolet Malibu
 - 2005 – 2010 Chevrolet Cobalt
 - 2005 – 2010 Pontiac G6
 - 2006 – 2007 Pontiac Pursuit
 - 2006 – 2009 Pontiac Solstice with OnStar®
 - 2006 – 2011 Chevrolet HHR
 - 2007 – 2009 Saturn Aura
 - 2007 – 2009 Saturn Sky
 - 2008 – 2010 Pontiac G5

Condition: The operator of the vehicle may complain that the engine fails to crank or start and that the service engine soon light and instrument panel lights intermittently come on while driving. The technician may observe one or more of the following diagnostic trouble codes:

U0023	U0101	U0121	U1040	U2100
U2106	U2107	U2108	P0700	P2544

Cause: A potential cause for the above condition is an improper connection to the vehicle communications interface module at connector C3 (black).

Correction: Follow the manufacturer’s recommended diagnostic and repair procedures when applicable ensuring that the connection is fully seated and that the harness is not too tight as this could cause the connector to partially separate.