



TECH TIPS

Dixie Part Numbers: TBA

Applications: 2007 – 2012 Navistar IC – BE Series School Buses*
2007 – 2012 Navistar IC – CE Series School Buses*

*Note Manufactured from June 27, 2006 through March 23, 2011
equipped with MaxxForce 7 engines.

Condition: Various electrical concerns up to and including a vehicle fire.

Cause: The positive alternator battery cable may have been routed resting against the engine control module mounting bracket. Over time the battery cable may chafe and deteriorate resulting in the positive battery cable shorting to ground.

Correction: Follow the manufacturer's recommended procedures to inspect, replace when needed, reroute and install tie straps to prevent the cable from chaffing the engine module mounting bracket.

