



TECH TIPS

Dixie Part Numbers: S-1409, S-1463 and S-6214

Applications: 2000 Saturn L series vehicles
2000 – 2001 Saturn SC, SL and SW series vehicles

Condition: Vehicle operators may complain that the engine will not start after towing the vehicle behind a recreational vehicle.

Cause: When towing the vehicle the key should be in the ACC position. This causes the body control module to be active and drains the battery.

Correction: The manufacturer recommends that the 1 or 2 30A Maxifuses be removed to prevent parasitic drain while towing the vehicle:

On the L series: the 2 30A Maxifuses are located in the under-hood fuse box and are marked as IGN 0/3/CR and IGN 1 / 2.

On the S series: the 30A Maxifuse is located in the under-hood fuse box and is marked IGN 1 / 4.

Follow the manufacturers' procedures and warnings for towing the vehicle.

Revision 20090624: Added 2000 – 2001 Saturn SC, SL and SW series vehicles

REV: 20090624

Courtesy of APRA

TSB_115.doc

Dixie *Tech Tips* are intended for use by professional technicians, and are not for the general public. They are written to inform technicians of conditions that may exist or as a guide to aid in diagnosing and servicing a vehicle. All references to original equipment manufactures, vehicle manufactures and any other Trade Mark names are for the sole purpose of identifying the vehicle and or part that the *Tech Tip* applies to. This document is property of Dixie Electric Ltd. and is not to be copied or distributed with out written permission.