



TECH TIPS

Dixie Part Numbers: A-1705 and A-1758

Applications: 2007 Cadillac Escalade (including ESV and EXT models)
2007 Chevrolet Avalanche
2007 Chevrolet Suburban
2007 Chevrolet Tahoe
2007 GMC Yukon (including Denali, XL, and Denali XL models)

Condition: Some vehicle operators may complain that the charging system warning light is on and/or the message "Service Battery Charging System" message appears on the Driver Information Centre. The technician may find either code B1405 and/or code B1416 retained in the memory.

Cause: A possible cause for the above condition could be the body control module resetting itself when cranking occurs under low voltage conditions.

Correction: The vehicle manufacturer has released an update to the calibration file for the body control module to address this issue. Ensure that the latest calibration file is loaded in the body control module.