



TECH TIPS

Dixie Part Numbers: A-1548 A-1705 A-1706 A-6548
 S-1468 S-1490 S-1511 S-80060
 S-80302

Applications: 2007 – 2008 Cadillac Escalade
 2007 – 2008 Chevrolet Avalanche
 2007 – 2008 Chevrolet Silverado
 2007 – 2008 Chevrolet Suburban
 2007 – 2008 Chevrolet Tahoe
 2007 – 2008 GMC Sierra
 2007 – 2008 GMC Yukon

Condition: The technician may observe that the battery post terminal is cracked.

Cause: When removing and reinstalling the battery post cable terminals do not over-torque them. They are designed with a special T-shaped bolt that tightens the terminal around the post. Over tightening the bolt will cause the terminal to crack.

Correction: The terminal post bolt requires 44 lb in or 5 Nm of torque. If the terminal has cracked it is sold separately from the lead as part number 19116852.