



TECH TIPS

Dixie Part Numbers: Not Assigned

Applications: **2008 – 2009 Chevrolet Tahoe Hybrid**
(VIN #'s 8R117658 to 8R279199 and 9R100025 to 9R249064)
2008 – 2009 GMC Yukon Hybrid
(VIN #'s 8R117663 to 8R279162 and 9R100022 to 9R249955)
2009 Cadillac Escalade Hybrid
(VIN #'s 9R100056 to 9R2490338)
2009 Chevrolet Silverado Hybrid
(VIN #'s 91103737 to 91133871 and 9G194966 to 9G234917)
2009 GMC Sierra Hybrid
(VIN #'s 91103750 to 91133918 and 9G171821 to 9G235011)

Condition: The operator of the vehicle may complain of one or more of the following conditions:

- The service engine light is illuminated.
- The engine stalls/shuts down at slow speeds.
- The above reoccur for about an hour unless the vehicle is driven at higher speeds.

Cause: A potential cause for the above problem is the body control module software.

Correction: If the correction has been performed there should be a label indicating so located under the hood. The calibration file is not available from GMSPO and must be accessed via the *Multiple Diagnostic Interface* (similar to the one shown on the right) and *TIS2WEB* and can be installed with a *Tech 2* scan tool.

