



# TECH TIPS

**Dixie Part Numbers:** A-1705 S-1508

**Applications:** 2005 Suzuki Forenza (Sedan and Wagon)  
2005 Suzuki Reno

**Condition:** The operator of the vehicle may complain of one or more of the following conditions:

- Slow hard cranking.
- A failure to crank.
- Low/dead batteries

**Cause:** A potential cause for the above is excessive parasitic or quiescent draw caused by the dome light **in the off position**.

**Correction:** The manufacturer has identified a fault in the factory supplied dome light that results in excessive current drain, even in the off mode. To correct this, the manufacturer has released a new dome light (36230-85Z10). Follow the manufacturer's recommended procedures when diagnosing or replacing the dome light.