



TECH TIPS

Dixie Part Numbers:	A-1759	A-9503	A-80212	A-80214
	A-80221	S-6263	S-6276	S-6281
	S-6282	S-6558		

Applications: 2007 Audi A6 (VIN 000001-073265)
2007 Audi A8 (VIN 000001-010103)
2007 Audi Q7 (VIN 000001-063347)

Condition: The operator of the vehicle may complain of one or more of the following conditions:

- A low or dead battery.
- Intermittent slow or hard cranking.

Cause: A potential cause for the above condition is a software flaw, which does not permit the radio to enter the sleep mode if the ignition is turned off while the radio is turned on. The radio will drain approximately 0.7A (70mA) if this condition exists.

Correction: Do not replace the radio! The manufacturer has released a software update to correct the problem. Follow the manufacturer’s recommended procedures to diagnose and update the software when applicable.