



TECH TIPS

Dixie Part Numbers:	A-1636	A-1645	A-1705	A-1757
	A-1761	A-1762	S-1449	S-1468
	S-1506	S-1511	S-1524	TBA

Applications: 2002 – 2009 Chevrolet Trailblazer
2002 – 2009 GMC Envoy
2002 – 2004 Oldsmobile Bravada

Condition: The operator of the vehicle may complain of a low or dead battery, long or hard starting or a failure to crank. The technician may observe a high quiescent draw (parasitic drain) of 4 to 5A (4000 – 5000 mA).

Cause: The above condition may be caused by a bent or damaged rear wiper arm or blade. The rear wiper motor may be attempting to park the rear wiper.

Correction: Follow the manufacturer’s recommended diagnostic and repair procedures when applicable.