



TECH TIPS

Dixie Part Numbers:	S-1408	S-1425	S-1441	S-1460
	S-1467	S-1468	S-1490	S-1511
	S-1522	S-8213	S-8997	S-80060
	TBA			

Applications: 2001 – 2007 Chevrolet Silverado Classic¹
2001 – 2007 GMC Sierra Classic¹
2003 – 2009 Chevrolet Kodiak C4500¹
2003 – 2009 Chevrolet Kodiak C5500¹
2003 – 2009 GMC Topkick C4500¹
2003 – 2009 GMC Topkick C5500¹
2007 – 2011 Chevrolet Silverado¹
2007 – 2011 GMC Sierra¹

1. With Allison LCT1000 Transmission

Condition: The operator of the vehicle may complain of one or more of the following intermittent conditions:

- There is a “clunk” sound when starting the engine with the transmission in park.
- There is a “clunk” sound when shifting into park from reverse or from park into any of the forward gears.
- If the brake pedal is held down, and the transmission shifted into park or into reverse, the sound becomes more frequent and repeatable.

Cause: The cause is the internal transmission clutch drag, which is sufficient enough to load the output gearing resulting in the park gearing impacting on the park pawl and causing the clunk noise.

Correction: This is considered a “normal” operating characteristic of the Allison LCT1000 transmission.