



TECH TIPS

Dixie Part Numbers: A-2062, A-80056

Applications: 2003 – 2006 Ford Crown Victoria (Police Interceptor)

Condition: Battery drains, dead battery, dimming headlights, flickering or charge warning light staying on.

Cause:

The original vehicle was supplied with a 135A alternator (Dixie number A-2062) this has been found to produce insufficient output, which resulted in drained or dead batteries. There was an original retrofit offered to address this (Dixie number A-80056) which needs to be performed with care or the alternator will not charge properly.

Correction:

Replacing the A-2062 with an A-80056 will increase the alternator output so that the battery can be maintained. The regulator harness adapter (reference number 50-09092) must be installed as the regulator connection pins are inverted from the A-2062 to the A-80056. The battery cable from the alternator to the battery must be changed to accommodate the higher amperage. As the higher output alternator performance is typically at a higher RPM the PCM will require updating with the latest calibration files, which will raise the idle speed.

Revision 20090520: Added the years of the vehicle, this bulletin does not apply to 2002 and prior year police option vehicles.