



TECH TIPS

Dixie Part Numbers: A-80265 A-80267 A-80268

Applications: 2008 Ford Escape
 2008 Mazda Tribute
 2008 Mercury Mariner

Condition: The operator of the vehicle may complain of bearing noise or a whining noise coming from the right side of the engine near the idler pulley.

Cause: A possible cause for the above condition is a faulty idler pulley arm assembly.

Correction: Use a stethoscope to determine if the noise is being created by the idler pulley by holding the probe to one of the idler pulley bolts. If the noise is from the idler pulley it needs to be replaced and torqued following the manufacturer's recommended procedures. The Ford/Mercury dealer number for the pulley is 8L8Z-3F671-A. The Mazda dealer number for the pulley is ZZCA-32-700. **Warning:** Follow the manufacturers recommended torque sequence when installing the idler pulley or bearing failure will occur.

Rev: 20101109 Added Mazda Tribute, A-80267 SKU and Warning regarding torque

REV: 20101109

Courtesy of Dixie Technical Department

TSB_242.doc

Dixie *Tech Tips* are intended for use by professional technicians, and are not for the general public. They are written to inform technicians of conditions that may exist or as a guide to aid in diagnosing and servicing a vehicle. All references to original equipment manufactures, vehicle manufactures and any other Trade Mark names are for the sole purpose of identifying the vehicle and or part that the *Tech Tip* applies to. This document is property of Dixie Electric Ltd. and is not to be copied or distributed with out written permission.