



TECH TIPS

Dixie Part Numbers:	A-244	A-246	A-258	A-264
	A-265	A-266	A-8225	A-8295
	S-2060	S-2066		

Applications: 1992 – 1994 Ford Taurus 3.0L, 3.2L and 3.8L V6 Applications
1992 – 1994 Mercury Sable 3.0L V6 Applications

Condition: The operator of the vehicle may complain of a slow crank/no start condition. This condition may exist even if the battery, starter and alternator have been replaced.

Cause: A potential cause for this is a short or open circuit in the wiring harness as the factory configuration had the wiring harness run across the front of the engine and transmission cases. The transmission case has a sharp edge which may over time scrape and/or sever the wiring harness.

Correction: The wiring should be inspected and repaired as necessary. When completed the wiring should be protected using loom and plastic ties to route the wiring in a manner that prevents reoccurrence.