



TECH TIPS

Dixie Part Numbers: S-6263, S-6558

Applications: 2005-2006 Audi A6 Quattro V6 3.2L
2005-2006 Audi A6 Quattro V8 4.2L
NOTE: Up to VIN number 4F_6N079104

Condition: The operator of the vehicle may complain that the engine does not start intermittently when the *advanced key engine start button* is pressed. The engine will start using the ignition key with the ignition switch (not the start button).

Cause: The cause could be either a mechanical issue with the engine start button or an electrical issue with the engine stop button.

Correction: To check the start button for mechanical issues perform the following test.

- Press the start button in slowly.
- There should be 2 distinct "clicks" the first is to activate power and the second to start the vehicle.
- If the second click is not present the switch needs to be replaced following the manufacturers recommended procedures.

If diagnostic code 02764 is observed then the engine stop button will require further diagnostics. The engine stop button has two micro switches that are both required within 3 seconds of each other to disable the engine (as long as the vehicle is stationary). If the button is touched lightly, for example if something like a cellular phone or other item is resting against the button it will trigger the system to register an error making it inoperable. To correct this there are software updates for the system, verify that the system is level 180 or higher following the manufacturer's recommended procedures.

Rev 20090820 clarified wording

REV: 20090820

Courtesy of APRA

TSB_613.doc

Dixie *Tech Tips* are intended for use by professional technicians, and are not for the general public. They are written to inform technicians of conditions that may exist or as a guide to aid in diagnosing and servicing a vehicle. All references to original equipment manufactures, vehicle manufactures and any other Trade Mark names are for the sole purpose of identifying the vehicle and or part that the *Tech Tip* applies to. This document is property of Dixie Electric Ltd. and is not to be copied or distributed without written permission.