



TECH TIPS

Dixie Part Numbers:	A-6505	A-80192	A-80302	A-80358
	A-80359	A-80363	S-1497	S-1499
	S-80280	S-80334	TBA	

Applications: 2006 – 2010 Chevrolet Impala with heated seats
2007 – 2009 Chevrolet Equinox with heated seats
2007 – 2009 Pontiac Torrent with heated seats

Condition: The operator of the vehicle may complain of an intermittent no crank, no start condition or of a low or dead battery.

Cause: A potential cause for the above condition may be the heated seat module. A programming flaw may cause the serial bus to remain active and prevent the modules from going into the sleep mode when the vehicle is shut off.

Correction: Follow the manufacturer’s recommended procedures, which include reprogramming the heated seat module with the latest calibration files.