



TECH TIPS

Dixie Part Numbers:	S-7030	S-7031	S-7046	S-80135
	S-80136	S-80220	S-80248	TS-1500
	TS-1501	TS-1512	TS-1611	TS-1652
	TS-1668	TS-1677	TS-1678	TS-1780
	TS-1794	TS-1796	TS-1810	TS-1811
	TS-1812	TS-1814	201-39108	201-41101
	201-42101	201-42102	201-42114	201-42120

Applications: 2002 – 2007 International 9000 Series – Equipped with a Caterpillar C10, C11, C12, C13, C15 or C16 Engine

Condition: The operator of the vehicle may comment on one of the following conditions:

- the engine fails to start
- the vehicle wiring has burnt
- the vehicle caught on fire

The technician may observe that the positive battery cable has chaffed against the ground cable between the starter and the engine and/or is the origin of the fire.

Cause: When assembled the above applications were manufactured with the above flaw in the design. The dealer network was to recall and correct this situation.

Correction: When servicing on the above applications ensure that the vehicle has the wires routed separately. International had revised the wiring and routing to prevent chaffing and shorting against each other. On applications that have been updated there will be brackets supporting the cables.

Revision 20111019: Corrected engine C15 was mistyped as C5

REV: 20111019

Courtesy of Dixie Technical Department

TSB_701.doc

Dixie *Tech Tips* are intended for use by professional technicians, and are not for the general public. They are written to inform technicians of conditions that may exist or as a guide to aid in diagnosing and servicing a vehicle. All references to original equipment manufactures, vehicle manufactures and any other Trade Mark names are for the sole purpose of identifying the vehicle and or part that the *Tech Tip* applies to. This document is property of Dixie Electric Ltd. and is not to be copied or distributed with out written permission.