



TECH TIPS

Dixie Part Numbers: S-80280 TBA

Applications: 2007 – 2010 GMC Acadia
2007 – 2010 Saturn Outlook
2008 – 2010 Buick Enclave
2009 – 2010 Chevrolet Traverse

Condition: The operator of the vehicle may complain of one or more of the following conditions:

- The engine fails to crank.
- The security system warning light stays on.
- The StabiliTrak® indicator light stays/message is displayed on the digital information center

The technician may find diagnostic trouble codes C0186, C0196, C0710, U0121 or U2141 stored in the system.

Cause: A potential cause for the above conditions is the body control module wiring harness. It is routed along the bottom of the steering column and the wiring harness may chaff against the steering column and over time result in wires shorting to each other or to ground.

Correction: Follow the manufacturer's recommended repair procedures to diagnose and reroute the harness if applicable.

REV: 20110503 Added diagnostic trouble codes

REV: 20110503

Courtesy of APRA

TSB_8051.docx

Dixie *Tech Tips* are intended for use by professional technicians, and are not for the general public. They are written to inform technicians of conditions that may exist or as a guide to aid in diagnosing and servicing a vehicle. All references to original equipment manufactures, vehicle manufactures and any other Trade Mark names are for the sole purpose of identifying the vehicle and or part that the *Tech Tip* applies to. This document is property of Dixie Electric Ltd. and is not to be copied or distributed with out written permission.