



# TECH TIPS

---

**Dixie Part Numbers:** S-8686 S-80019

**Applications:** 2005 Acura TL (see VIN numbers affected)  
VIN numbers 19UUA65..5A012670 through 19UUA65..5A013543  
and 19UUA65..5A012008 through 19UUA65..5A015591

**Conditions:** The operator of the vehicle may complain of a no start or stalling condition.

**Cause:** A potential cause for the above condition is a loose terminal in the under dash fuse panel. The loose connection may limit or prevent power from reaching the fuel pump.

**Correction:** The manufacture has issued instruction to replace the fuse panel (manufacturer's number 38200-SEP-A03). When required, follow the manufacturer's recommended diagnostic and repair procedures. If the procedure was performed by an authorized warranty service facility the VIN number in the engine compartment will have a center-punch "dot" stamped above the first digit of the VIN number.