



TECH TIPS

Dixie Part Numbers: A-8937

Applications: 2001 – 2003 Hyundai Elantra 2.0L
2001 – 2003 Hyundai Tiburon 2.0L

Condition:

One or more of the following conditions may be observed after replacing the alternator in the vehicle:

- the alternator may not charge,
- may quite charging,
- the light remains on and/or
- the main battery fuse is blown.

Cause:

The factory-equipped vehicle was manufactured with an 80A alternator and a 100A main battery fuse. This was found to be insufficient and the alternator was upgraded to an A-8937, which is a 90A alternator and the battery fuse was replaced with a 120A capacity one.

Correction:

When changing the alternator verify that the fuse has the correct amperage rating. The part number for the correct 120A fuse is 18980-00060. The **inadequate** fuse is part number 91823-22600.