



TECH TIPS

Dixie Part Numbers: A-80036

Applications: 2003 – 2005 Toyota 4Runner (V6) with VIN information earlier then identified below.

Originating Plant	Drive Train	VIN Where corrected
Tahara	2-wheel drive	JTEZU1#R_50055199
	4-wheel drive	JTEBU1#R_50066323
Hino	2-wheel drive	JTEZU1#R_58031852
	4-wheel drive	JTEBU1#R_58041908

Condition: Customers may complain that the charge warning light on the dash may come on during winter months.

Cause: A potential cause for the charge warning indicator light coming on is salt water residue getting inside the alternator in climates where salt is used on the road to melt the snow.

Correction: Toyota recommends using A-80305 in place of A-80036 with the installation of a foam strip in the engine cover and an engine oil baffle plate. Refer to the manufactures recommended installation procedures when installing these parts.

Rev: 20100304 Superseded A-80305 to A-80036

REV: 20100304

Courtesy of APRA

TSB_824.doc

Dixie *Tech Tips* are intended for use by professional technicians, and are not for the general public. They are written to inform technicians of conditions that may exist or as a guide to aid in diagnosing and servicing a vehicle. All references to original equipment manufactures, vehicle manufactures and any other Trade Mark names are for the sole purpose of identifying the vehicle and or part that the *Tech Tip* applies to. This document is property of Dixie Electric Ltd. and is not to be copied or distributed with out written permission.