



TECH TIPS

Dixie Part Numbers: A-8176 A-8177 A-8183 A-8197
 A-8214 A-8215 A-8217 A-8249
 A-8251 A-8360

Applications: 1986 – 1989 Acura Integra
 1986 – 1989 Honda (all applications)

Condition: The operator of the vehicle may complain of a no start condition.

Cause: A possible cause is a rear window defogger switch that was left on after short trips. The factory-installed switch did not have a timer to limit how long the defogger would remain on.

Correction: The manufacturer has released a replacement switch that will limit the time that the defogger will remain on. There is a kit, which contains the corrected switch and a heat shield for the battery to address the situation. The part numbers are as follows:

 1986 – 1987 Acuras will require kit number 06377-SD2-A011
 1988 – 1989 Acuras will require kit number 06377-SD2-A11
 1986 – 1989 Hondas will require kit number 35500-SEO-A11

REV: 20100311 Corrected Acura listing and added Honda applications and part numbers.