



TECH TIPS

Dixie Part Numbers: S-80321 S-80322 S-80323 S-80410

Applications: 2008 – 2009 Honda Accord

Condition: The operator of the vehicle may complain of one or more of the following conditions:

- Hard cranking
- Failure to start
- Extended cranking time
- Service engine soon light illuminated

The technician may find diagnostic code P2442 indicating an evaporation canister vent shut valve close malfunction.

Cause: The manufacturer has traced one possible cause of the problem to spider webs plugging the vent hose or the drain box on the evaporation canister.

Correction: Follow the manufacturer's recommended procedures and warnings when servicing the evaporation canister. The manufacturer recommends wearing gloves to avoid potentially poisonous spider bites and replacing the fuel drain spring (part number 17745-TA0-A01, C/C 9175183).

