



TECH TIPS

Dixie Part Numbers: S-8738 S-8772

Applications: 2006 – 2010 Toyota RAV4
2008 – 2009 Toyota Highlander
2009 – 2010 Toyota Matrix

Condition: The operator of the vehicle may complain that the vehicle does not start intermittently or fails to start. Moving the shift lever in and out of the “Park” position may temporarily alleviate the problem.

Cause: A potential cause for the above condition is the neutral position switch assembly.

Correction: The manufacturer recommends replacing the neutral position switch assembly with a revised one. The part number for the revised neutral position switch is 84540-42010 for the above applications. Follow the manufacturer’s recommended procedures when performing the repairs.