



TECH TIPS

Dixie Part Numbers: A-8336 A-8337
 S-8231 S-8232 S-8233

Applications: 1989 – 1990 Mazda RX7 1.3L (both Turbo and normally aspirated)

Condition: The operator of the vehicle may complain of one or more of the following conditions:

- Intermittent no start
- Intermittent hard starting
- Intermittent lights flickering or dimming
- Other electrical component issues

Cause: A potential cause for the above conditions is the electrical wiring harness routing, which runs very close to the front right suspension tower.

Correction: Inspect the clearance between the tower and the harness. There must be a minimum of 5mm between the wiring and the suspension tower. If there is a lack of clearance re-route the wiring harness by bending the wire support bracket in a manner that increases the clearance.