



TECH TIPS

Dixie Part Numbers:	A-9461	A-9462	A-9463	A-9464
	A-9471	A-9472	A-9479	A-9480
	A-9534	A-80384	S-1466	S-1495
	S-1497	S-1502	S-1523	S-80280
	TBA			

Applications: 2006 – 2010 Chevrolet Malibu
2006 – 2009 Pontiac G6
2006 – 2009 Saturn Aura

Condition: The operator of the vehicle may complain of one or more of the following conditions:

- The battery is low or discharged
- The engine fails to start or crank
- The vehicle alarm system goes off intermittently
- The door ajar message comes on intermittently (or stays on)
- The interior lights stay on intermittently (or stay on).

The above conditions may be more noticeable in wet/damp weather.

Cause: A potential cause for the above conditions is water seeping into the door-ajar switch, which is integrated in to the door lock assembly. The moisture may result in the switch sending a false signal to the body control module. The body control module would read the false signal and activate the system as if the door was open.

Correction: Follow the manufacturers' recommended diagnostic procedures (which include thoroughly washing the car) to monitor the body control module and door-ajar switches to determine if (and which) switch is the cause of the problem.

