



TECH TIPS

Applications: Various Coach Applications

Summary: The attached article is pertinent to any coach operator or service provider and was graciously provided by the *Commercial Vehicle Safety Alliance* and the author Christopher W. Ferrone.

The article covers basic principles of how fires are generated and then provides specific causes and recommended actions to prevent occurrence.

Dixie Part Numbers: This information in the attached article may apply to the part numbers listed below.

101-50213	201-37116	201-38105	201-41104	201-42202	A-1921	TS-1177
160-60221	201-37117	201-38201	201-41108	201-42203	A-1922	TS-1179
160-60221A	201-37118	201-38202	201-41109	201-42204	S-1083	TS-1188
160-60222	201-37120	201-39102	201-41111	201-42205	S-1104	TS-1190
160-60222A	201-37122	201-39104	201-41114	201-42206	S-1105	TS-1191
160-60223	201-37124	201-39105	201-41115	201-42207	S-1107	TS-1207
160-60223A	201-37127	201-39106	201-41201	201-42208	S-1108	TS-1252
160-60224	201-37128	201-39107	201-41202	201-42211	S-1132	TS-1295
160-60225	201-37130	201-39108	201-41203	201-42212	S-1138	TS-1388
160-60226	201-37132	201-39109	201-41204	201-42213	S-1139	TS-1416
160-60241	201-37134	201-39110	201-41205	201-50101	S-1293	TS-1452
160-60241A	201-37135	201-39111	201-41207	201-50201	S-1295	TS-1500
160-60242	201-37136	201-39201	201-42101	201-50202	S-80130	TS-1501
160-60242A	201-37137	201-39202	201-42102	201-50203	S-80131	TS-1502
160-60243	201-37138	201-39203	201-42103	201-50204	S-80153	TS-1503
160-60243A	201-37139	201-39204	201-42104	201-50205	S-80195	TS-1504
160-60245	201-37201	201-39205	201-42112	201-50206	S-80199	TS-1505
160-60246	201-37202	201-39206	201-42113	201-50207	S-80210	TS-1506
160-60281	201-37203	201-40101	201-42114	201-50208	S-80211	TS-1509
160-60282	201-37204	201-40102	201-42115	201-50209	S-80214	TS-1510
201-37101	201-37205	201-40104	201-42117	201-50212	S-80216	TS-1512
201-37102	201-37206	201-40106	201-42118	243-39101	S-80240	TS-1534
201-37104	201-37207	201-40108	201-42119	243-39201	S-80241	TS-1535
201-37107	201-37208	201-40110	201-42120	243-39202	S-80242	TS-1536
201-37108	201-37209	201-40201	201-42121	243-39204	S-80245	TS-1539
201-37109	201-37210	201-40202	201-42123	243-39205	S-80246	TS-1540
201-37110	201-37212	201-40203	201-42124	243-39206	S-8962	TS-1541
201-37112	201-38101	201-40206	201-42127	A-1914	S-8963	TS-1542
201-37113	201-38102	201-41101	201-42129	A-1918	TS-1061	TS-1544
201-37114	201-38103	201-41102	201-42131	A-1919	TS-1086	TS-1545
201-37115	201-38104	201-41103	201-42201	A-1920	TS-1160	TS-1547

REV: 201000920

Courtesy of Christopher W. Ferrone
and the Commercial Vehicle Safety Alliance

TSB_007.doc

Dixie *Tech Tips* are intended for use by professional technicians, and are not for the general public. They are written to inform technicians of conditions that may exist or as a guide to aid in diagnosing and servicing a vehicle. All references to original equipment manufactures, vehicle manufactures and any other Trade Mark names are for the sole purpose of identifying the vehicle and or part that the *Tech Tip* applies to. This document is property of Dixie Electric Ltd. and is not to be copied or distributed with out written permission.



TECH TIPS

TS-1548	TS-1606	TS-1663	TS-1691	TS-1720	TS-1756	TS-1795
TS-1550	TS-1607	TS-1664	TS-1692	TS-1722	TS-1757	TS-1796
TS-1551	TS-1608	TS-1665	TS-1693	TS-1723	TS-1758	TS-1797
TS-1556	TS-1610	TS-1666	TS-1694	TS-1724	TS-1759	TS-1798
TS-1558	TS-1611	TS-1667	TS-1696	TS-1730	TS-1762	TS-1799
TS-1560	TS-1612	TS-1668	TS-1697	TS-1733	TS-1763	TS-1800
TS-1561	TS-1628	TS-1669	TS-1698	TS-1734	TS-1764	TS-1801
TS-1562	TS-1630	TS-1670	TS-1699	TS-1735	TS-1772	TS-1802
TS-1563	TS-1634	TS-1671	TS-1701	TS-1736	TS-1773	TS-1803
TS-1564	TS-1635	TS-1674	TS-1703	TS-1737	TS-1774	TS-1804
TS-1565	TS-1636	TS-1675	TS-1704	TS-1739	TS-1775	TS-1805
TS-1566	TS-1637	TS-1676	TS-1705	TS-1740	TS-1776	TS-1806
TS-1567	TS-1638	TS-1677	TS-1706	TS-1741	TS-1778	TS-1807
TS-1568	TS-1650	TS-1678	TS-1707	TS-1742	TS-1779	TS-1808
TS-1569	TS-1651	TS-1679	TS-1708	TS-1743	TS-1780	TS-1809
TS-1570	TS-1652	TS-1681	TS-1709	TS-1744	TS-1782	
TS-1571	TS-1653	TS-1682	TS-1710	TS-1745	TS-1783	
TS-1586	TS-1654	TS-1683	TS-1711	TS-1746	TS-1784	
TS-1595	TS-1655	TS-1684	TS-1712	TS-1747	TS-1785	
TS-1596	TS-1656	TS-1685	TS-1713	TS-1748	TS-1788	
TS-1597	TS-1657	TS-1686	TS-1714	TS-1749	TS-1789	
TS-1599	TS-1658	TS-1687	TS-1715	TS-1750	TS-1791	
TS-1603	TS-1659	TS-1688	TS-1716	TS-1751	TS-1792	
TS-1604	TS-1661	TS-1689	TS-1718	TS-1754	TS-1793	
TS-1605	TS-1662	TS-1690	TS-1719	TS-1755	TS-1794	

special report • special report • special report • special report • special report • special report


FIRE INVESTIGATIONS

WHY MOTORCOACHES MAY BURN



(A MECHANICAL ANALYSIS)



A CVSA SPECIAL REPORT

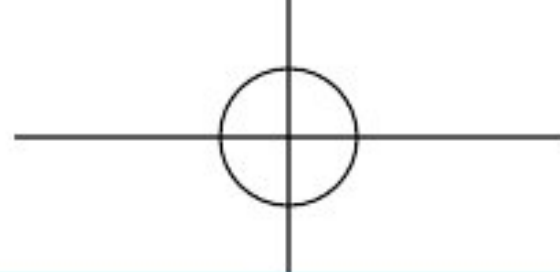

special report • special report • special report • special report • special report • special report

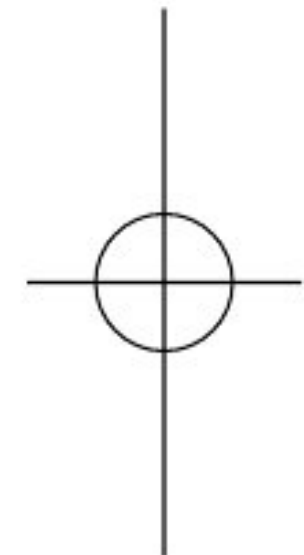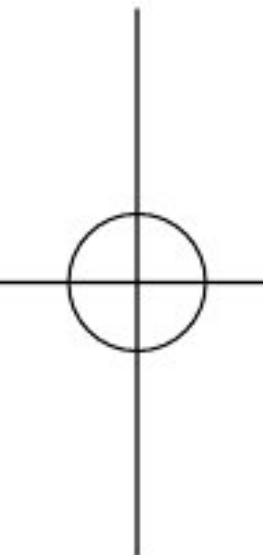

FIRE INVESTIGATIONS

WHY MOTORCOACHES MAY BURN

(A MECHANICAL ANALYSIS)

Christopher W. Ferrone
President, Americoach Systems, Inc.
Chicago, IL
Cell: 773.858.4941 • Tel: 800.621.4153 • Email: cwferrone@yahoo.com

ABSTRACT

In the wake of the Wilmer, Texas fire, which occurred during the Hurricane Rita evacuation, motorcoach fires have come to the forefront of the media. Are motorcoaches catching on fire now more than before? What could possibly explain such a phenomenon?

The purpose of this paper, through mechanical analysis and accident reconstruction, is to inform operators of the fire hazards which may be present on a typical motorcoach, transit or school bus.

Once the potential hazards are identified, the individual components' care and maintenance can be monitored to prevent or limit the occurrence of a fire. The express purpose of this effort is to minimize fires on such passenger vehicles.

INTRODUCTION

Motorcoaches are expensive and carry valuable cargo – people. Motorcoaches must be understood and maintained with fire prevention in mind.

A fire can occur on a motorcoach, transit or school bus for a variety of reasons. Unlike an automobile or even a large truck, a motorcoach is a more sophisticated vehicle with more systems and even greater complexity.¹ The author has investigated motorcoach fires for more than 20 years. However, as a result of the fire in Wilmer Texas, it was decided that this analytical process should be written to assist operators in the prevention of future fires.

During the past two decades the author has investigated numerous motorcoach fires. While analyzing the cause and origin of these fires a collection of data has shown a consistent pattern.

As simple as it appears, if the vehicle is in motion certain items are valid as possible causes. Likewise, if the vehicle is stationary with the engine on or off other items become potential causes. In either case, the situation is dangerous and costly in both human life and property (Photo 1).

The more common causes discussed here are **not** ranked in order of likelihood. The operational profile and vehicle history can help determine which of these trouble spots need



Photo 1: Motorcoach involved in fire during Hurricane Rita evacuation (September 24th 2005)

attention first. Items to be discussed in this paper are:

- alternator(s)
- starter
- fuel/combustible materials/lubricants
- hubs/bearings
- brakes (drum & disc)
- tires
- turbochargers
- sensors
- auxiliary heaters (diesel furnace)
- 2007 emission schemes

WHAT IS REQUIRED FOR A FIRE

Three elements are needed to create a fire: air, a combustible material and an ignition source. These three items form what is known as the Fire Triangle (Fig. 1); if any one of the three elements of the triangle is not present a fire cannot occur despite the presence of the other two.

Air is all around us; making for an abundant supply of the first element. A combustible material, the second element, is any thing that may be present on the motorcoach such as diesel fuel, power steering fluid, engine oil, transmission fluid, gear/hub oil and grease to name a few. The third element, the ignition source, can come in many forms. An open flame, a sustained duration spark and auto-ignition* are the most common ignition sources. Along with the completion of the fire triangle, atomization of the liquid must occur in order to satisfy the stoichiometric requirements (14:1) to burn. Absent this proper air-to-fuel ratio, the substance is deemed too rich to burn and will not ignite.

The atomization increases the surface area of the liquid by creating small spheres or droplets. By taking a cube of one cubic inch in volume and simply dividing it up into five equal spheres, each 1/5 of 1 cubic inch, the total surface area of the

five spheres is 37% more than the surface area of the original same volume of one cubic inch (Fig. 2).

This increase in surface area is what allows the air to properly mix with the liquid for the stoichiometric ratio to be satisfied. As an example, this atomization usually comes from a spraying of the liquid from a pressurized pinhole leak in a hose or component housing. Once this ratio has been met a fire can occur.

Temperature Mapping: Temperature mapping is a technique used to determine the surface temperature of various components on the motorcoach. By using a non-contact laser thermometer, a map of component surface temperatures can be established for any particular vehicle. For this study an MCI DL-3 was used (Photo 2).

The purpose of such a study is to verify individual component temperatures to assist in the cause and origin analysis, as well as fire prevention. A sample of surface temperatures has

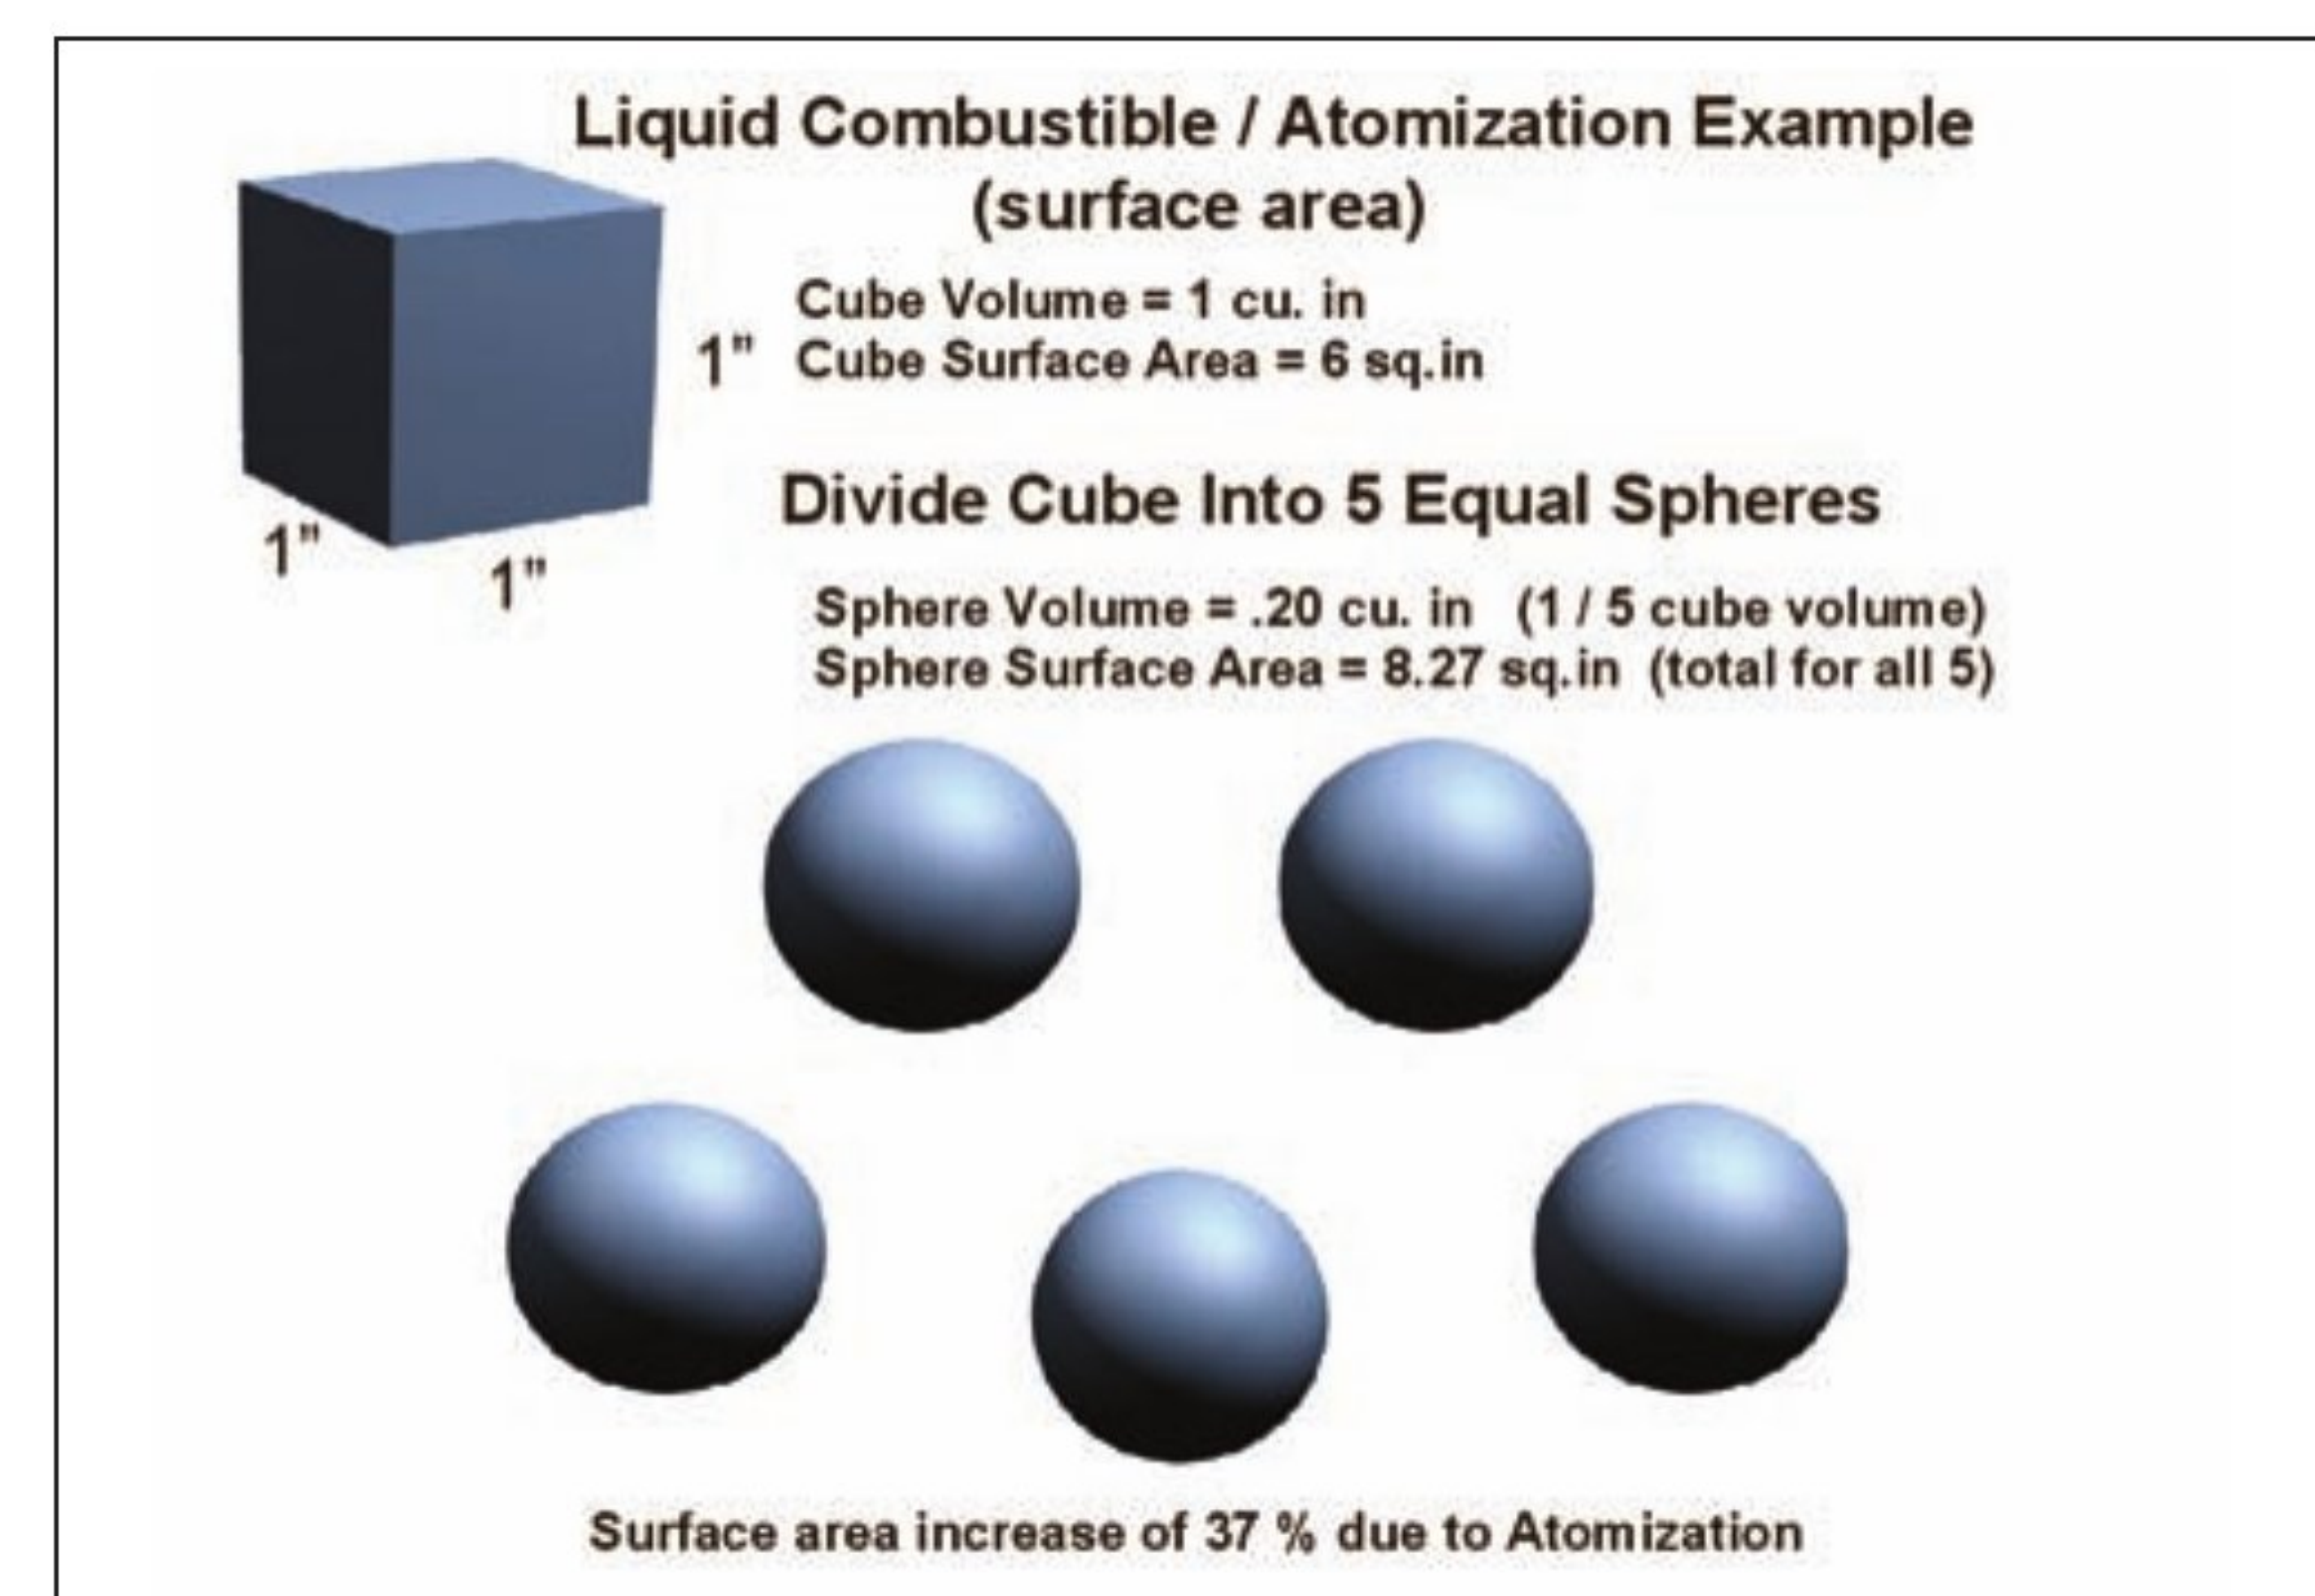


Figure 2



Photo 2: MCI DL-3

*Auto-ignition is defined as the ability to ignite a flammable substance in the absence of an open flame or sustained duration spark. This phenomenon is created solely by the surface temperature of an object.

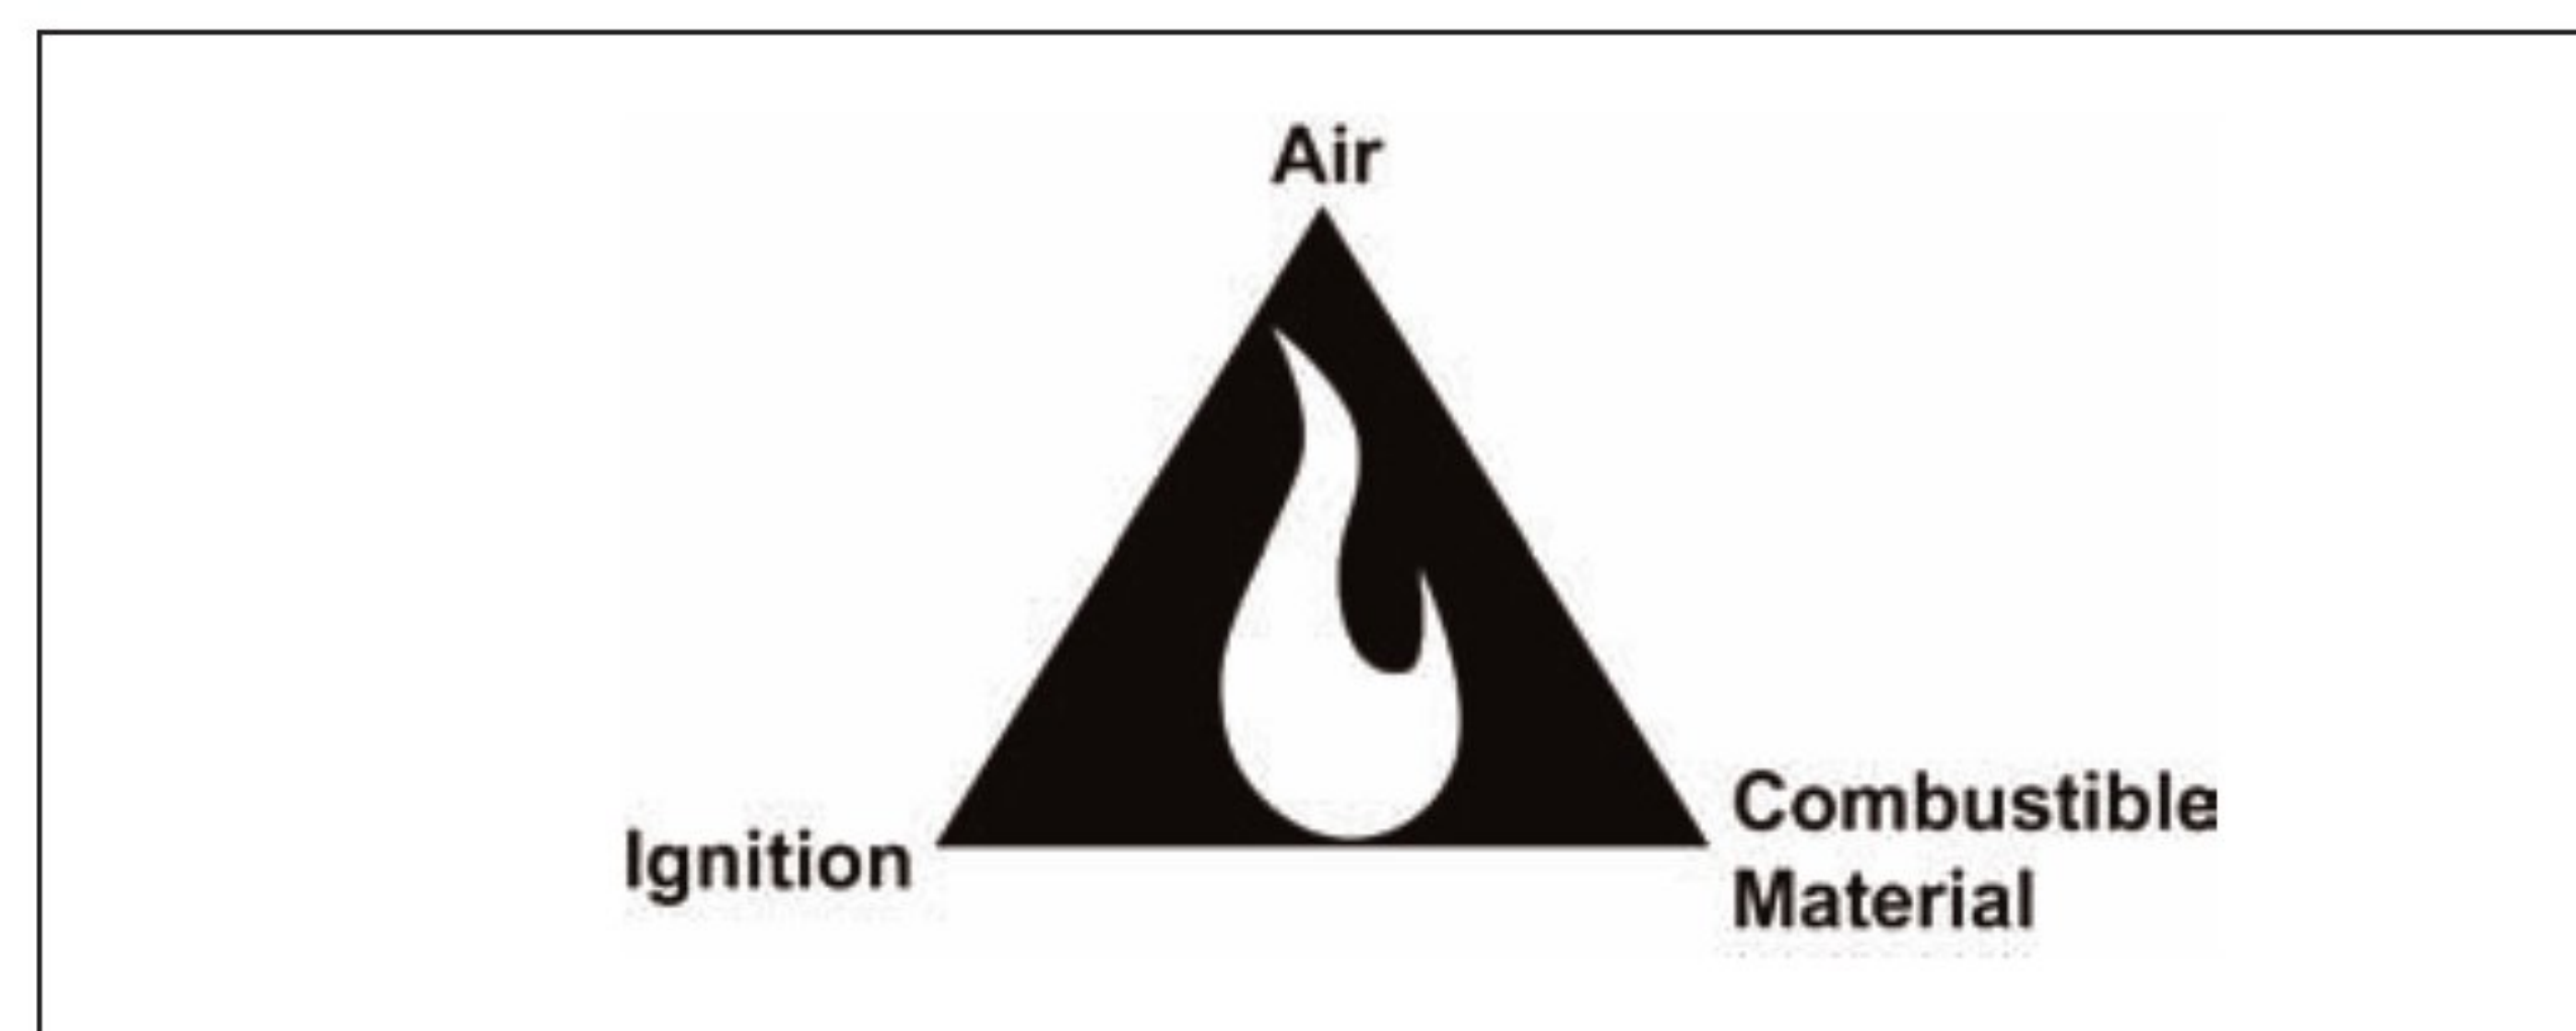


Figure 1: Fire Triangle

been provided in Appendix A. As you can see from this, certain components are normally at the auto-ignition temperature of the on-board fluids and some are not. What can be taken from this is that if the “cooler” components are functioning normally, they cannot be an auto-ignition source. If a fire was to be traced back to a “cooler” component, such as a drive axle hub, that would indicate that this component experienced some type of mechanical failure which preceded the fire and became the triggering element – the ignition source. In summary these “cool” components cannot become an ignition source without experiencing a localized failure due to the fact that their normal operating (surface temperature) is less than the average (on board fluid) auto-ignition temperature.

IGNITION SOURCE

Alternator: Most motorcoaches use either a large oil cooled gear/belt driven alternator or a more conventional style alter-

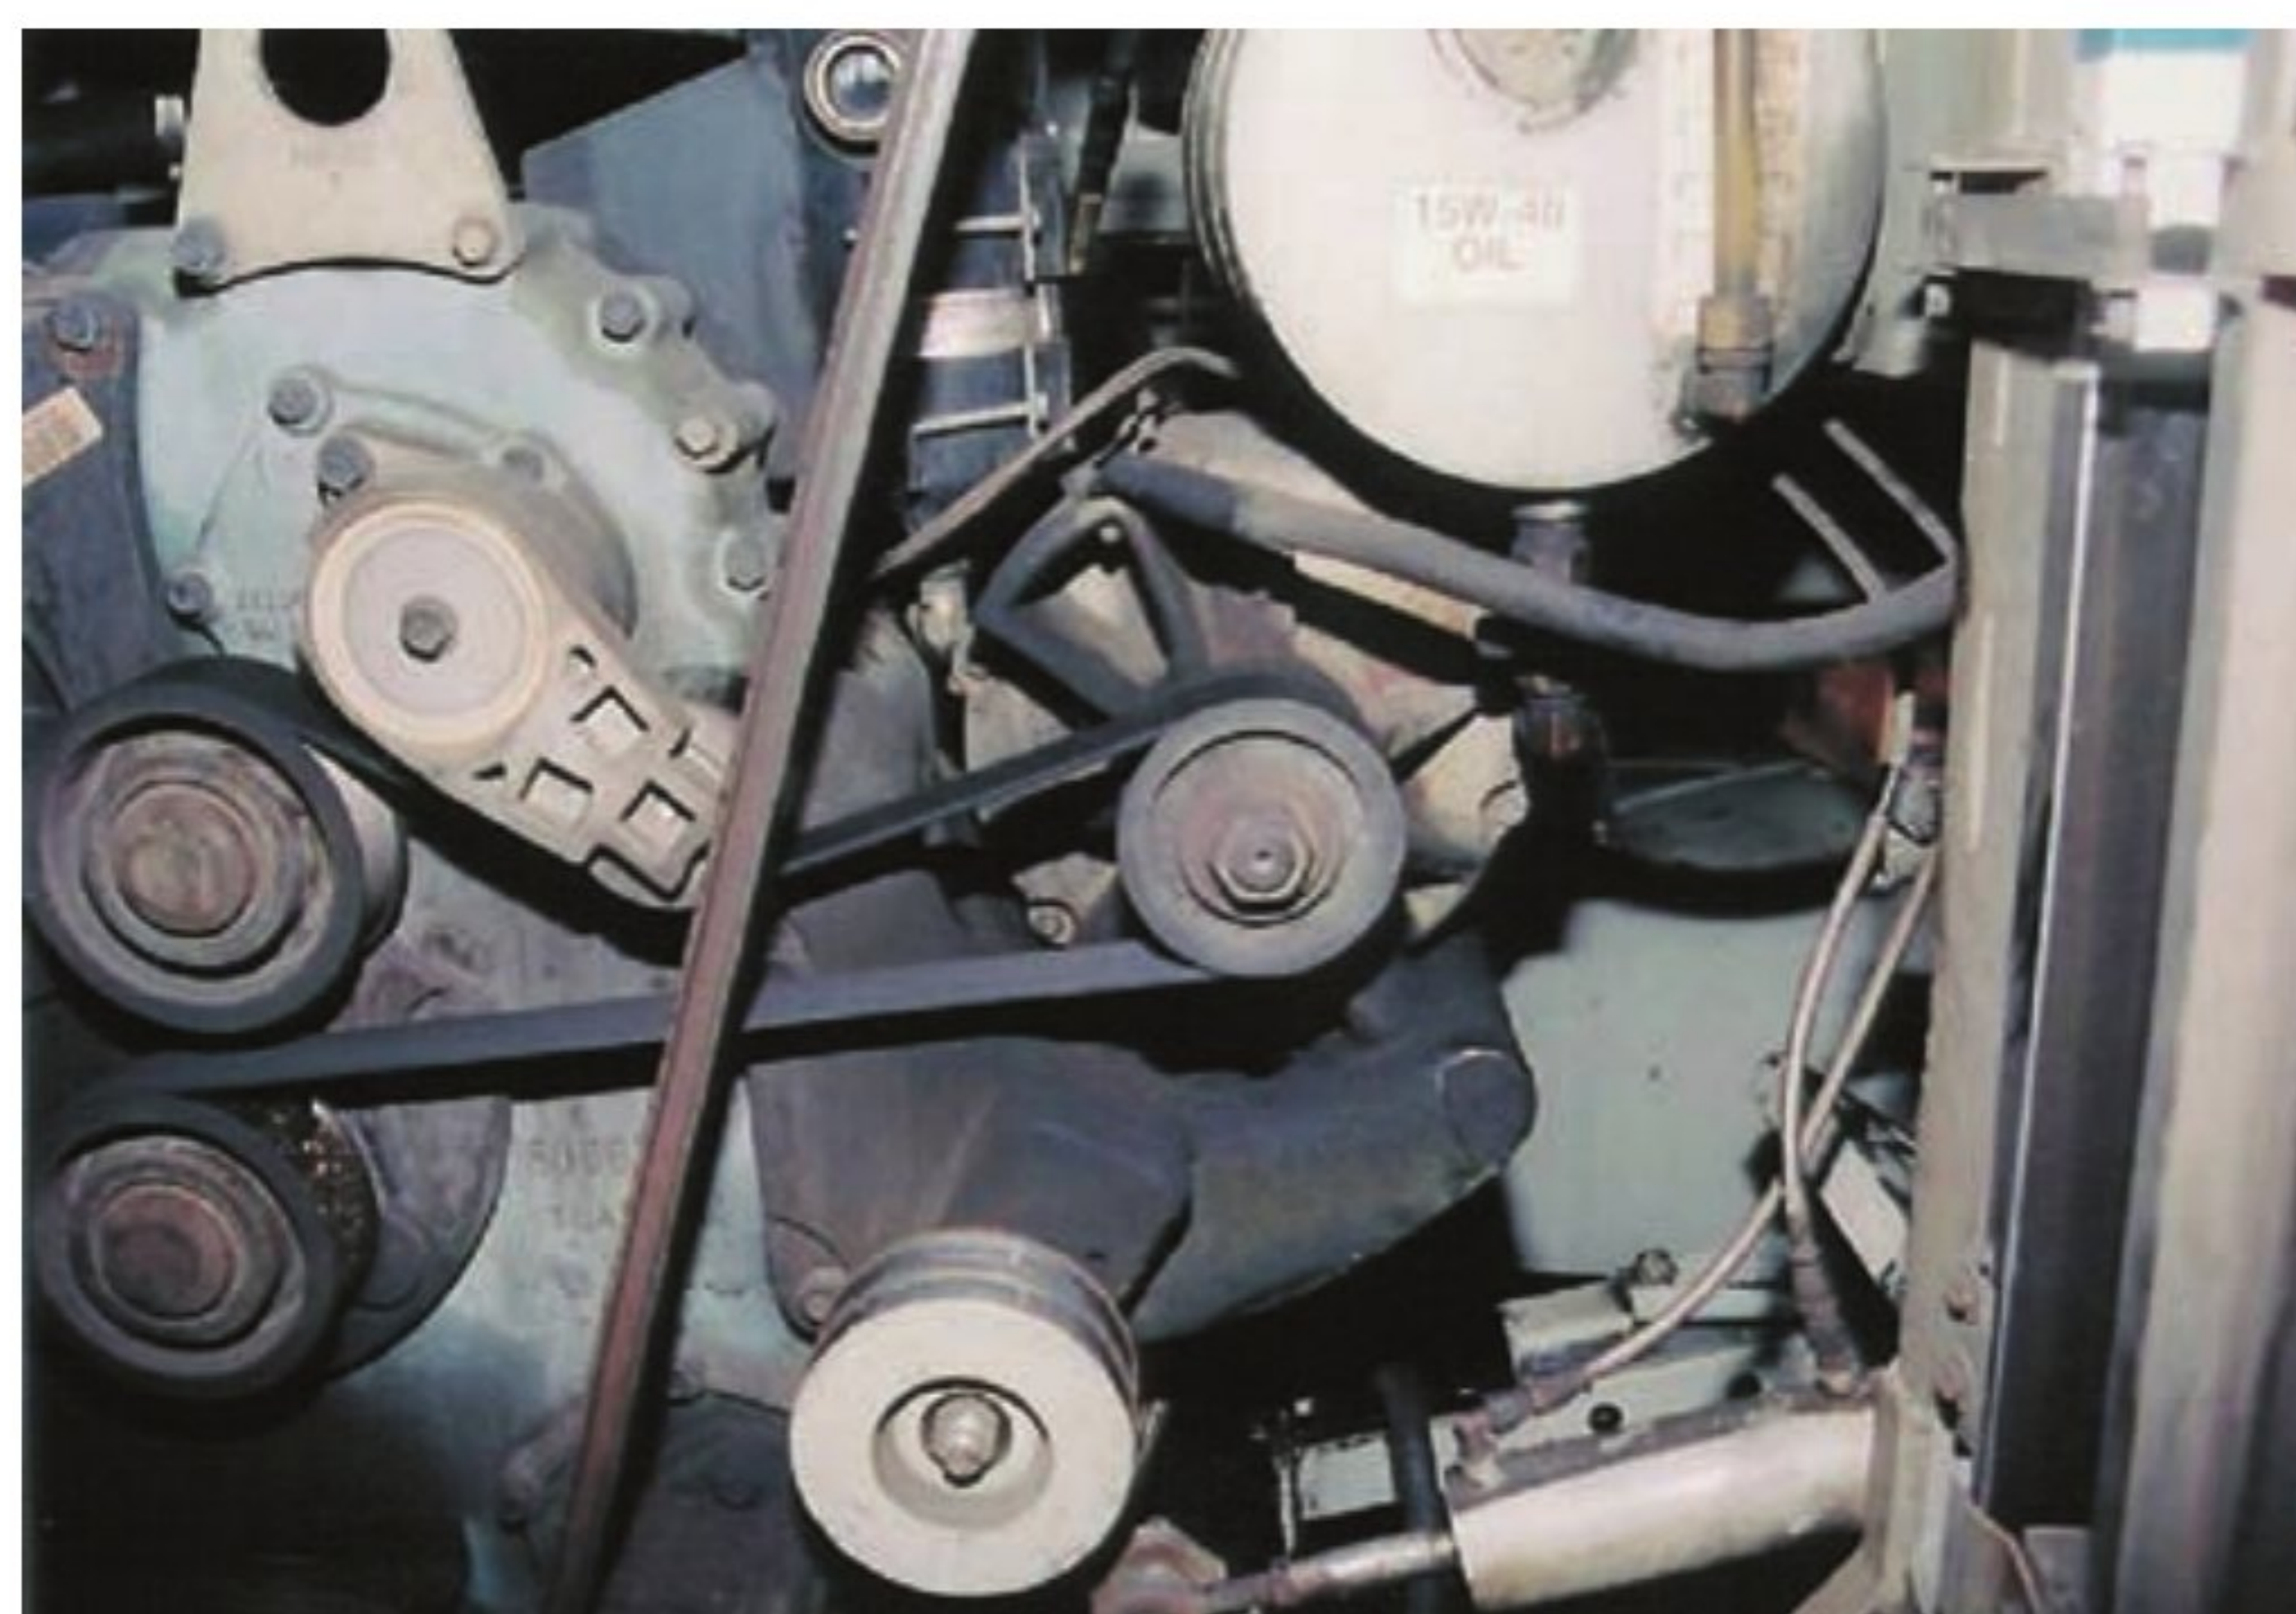


Photo 3A: 50-DN, Series 60



Photo 3C: 50-DN, Series 92

nator similar to an automotive application; but larger. The typical varieties are a Delco 50-DN (Photo 3a) or an air cooled dual Bosch T1 (Photo 3b) configuration. The author must stress that these manufacturers are not being singled out for any particular reason; however, they are the most commonly found units within this type of vehicle. For most applications, the charging system for the motorcoach produces 275 amperes or more — as much amperage as a typical single family home may have. With this, the alternator (and system) carries great potential as an ignition source.

Typically with a 50-DN installation (Photos 3a & 3c), the B+ (direct battery feed) cable is routed to a large stud on the back of the alternator. This in turn is held in place with a nut (to the stud) along with various clamping methods to secure the cable end from any movement (Photo 4).

These connections must be quality checked after the alternator has been installed and inspected periodically as

well as to ensure there is no movement. *It is noteworthy to point out that with some applications, these cables may need to be temporarily removed to facilitate other non-alternator related repairs. The same care and vigilance should be used whether alternator or other repairs are being made.* If the B+ cable is loose, it can, by its own weight either fail the plastic insu-



Photo 3B: Bosch T1, Series 60

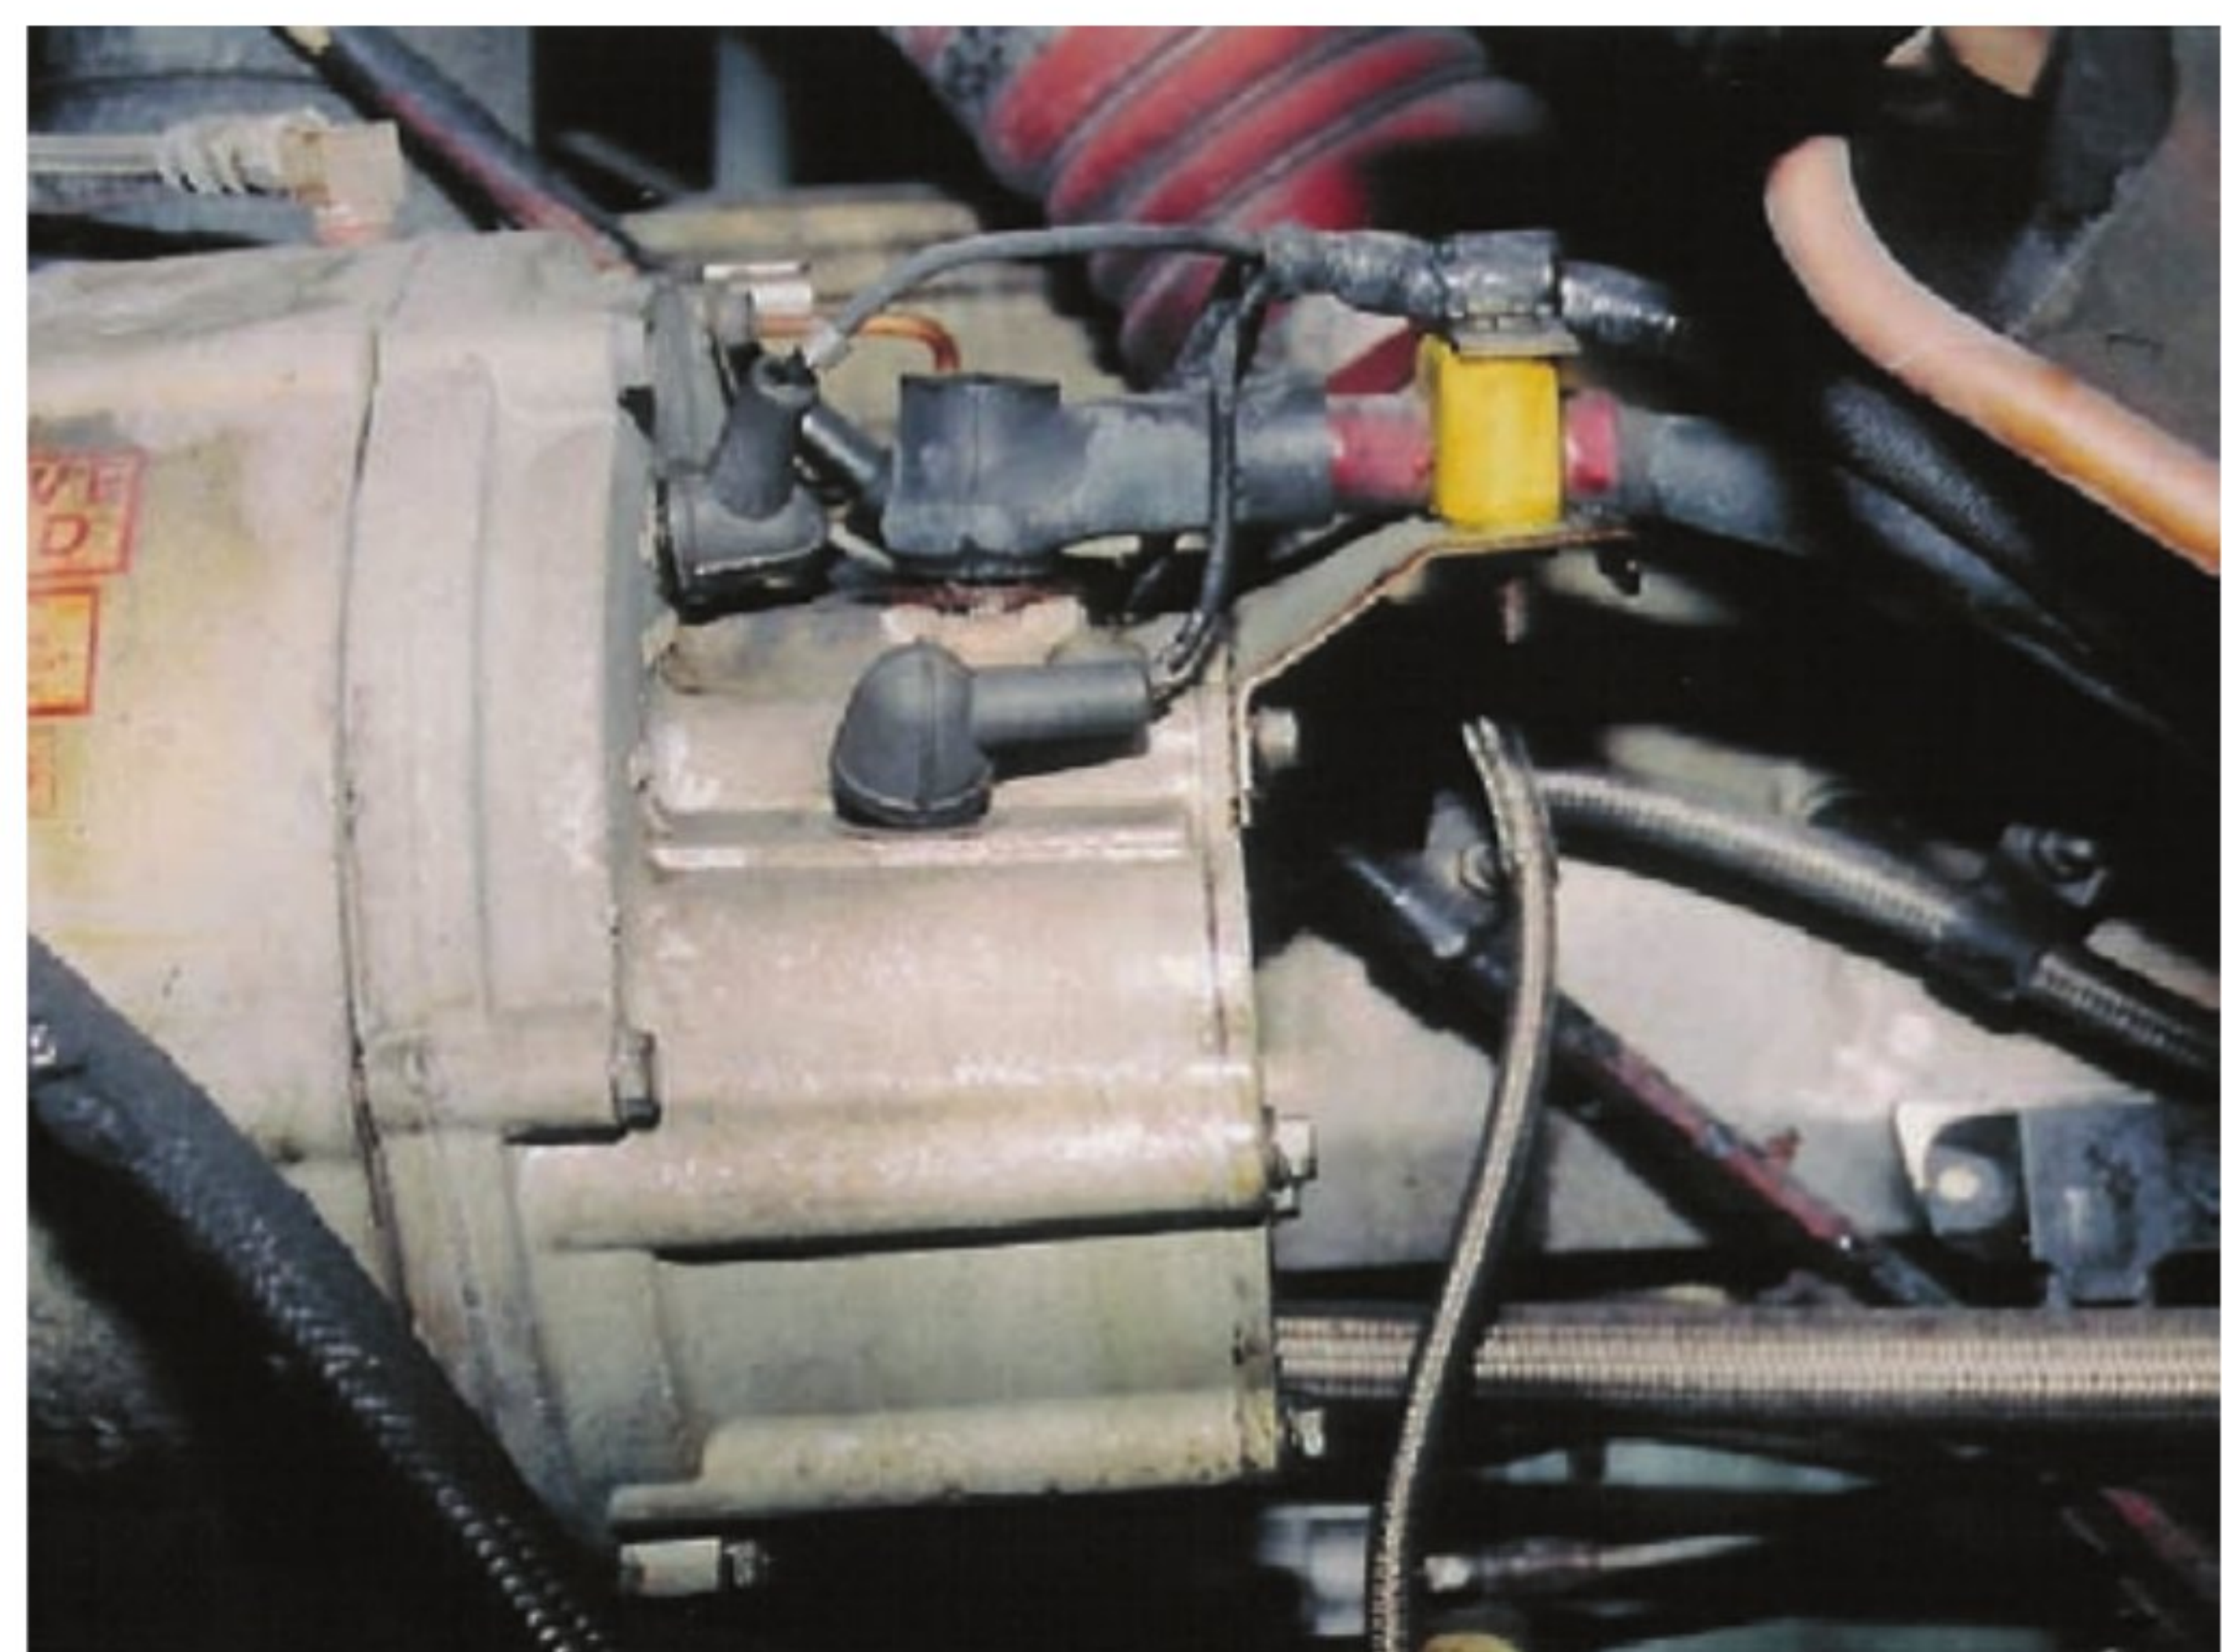


Photo 4: 50-DN, Series 60, MCI Installation



Photo 5: 50-DN, B+ Bracket, Series 60

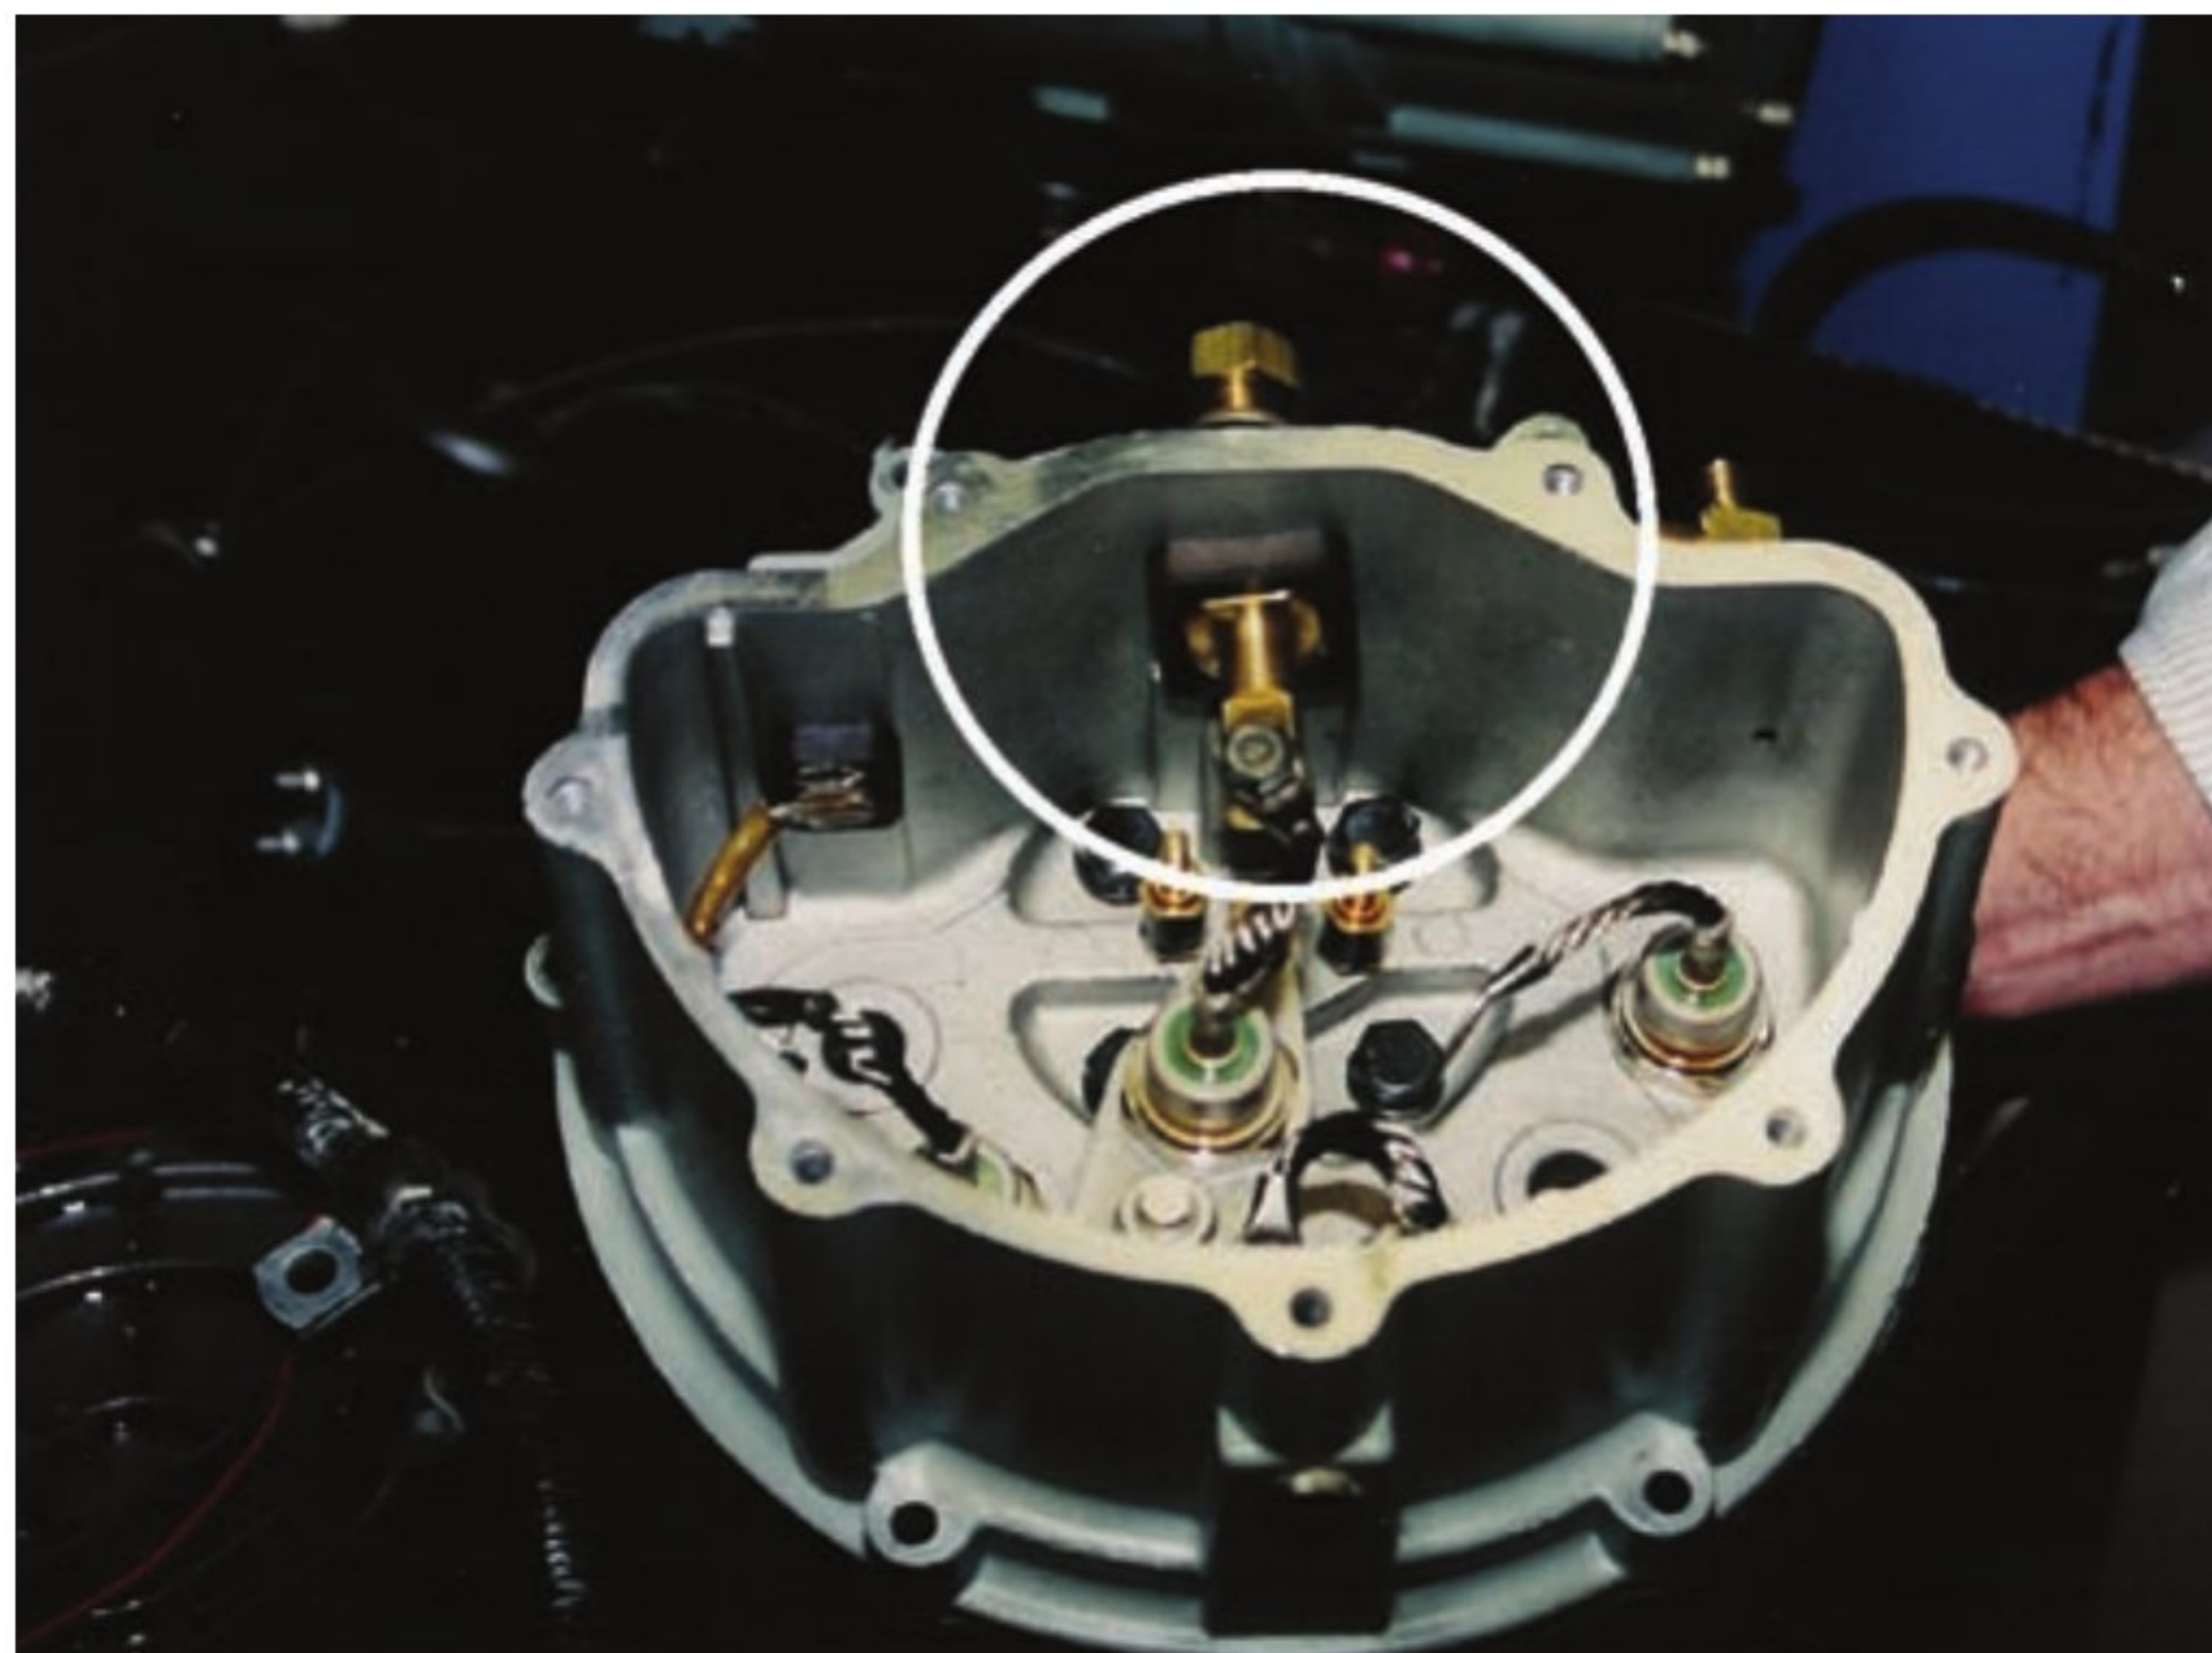


Photo 6A: 50-DN, B+ Stud Insulator



Photo 6B: 50-DN, Result of Failed B+ Stud Insulator

lator material surrounding the stud at its base, internal to the alternator, or wear through the cable insulation locally and make unwanted contact with the support bracket. When this occurs the cable can act similarly to an arc welding machine and cut its way through the bracket (Photo 5).

Once the B+ cable end is free, the cable can drop, making contact with a ground source, resulting in a sustained duration spark. This is exceptionally critical in that with some engine applications the alternator is installed above and on the fuel side of the engine.

In addition to the cable and its' mounting system there is another potential fire hazard. When installing the B+ cable to the stud (50-DN) the proper torque must be used to ensure that the plastic material (internal insulator) is not broken or compromised in any way (Photo 6a). If this nut is over-torqued, or otherwise installed incorrectly, it could lead to a loose stud subsequently leading to an ignition source and fire (Photo 6b).

In some instances a fire has begun with the vehicles' engine off and after some period of time since the most recent engine shut-down. This can be attributed to an internal alternator failure; specifically a diode failure. Diodes act as a one-way check valve for current. Typically, if a diode fails in this scenario, positive (B+) battery voltages goes to ground and has been known to start a fire. The solution to this potential fire scenario is to park the motorcoach with the main battery switch off. This will disconnect the batteries from the alternator eliminating this potential.

Remote Jump Post: With some applications a convenience feature is provided in the engine compartment for "jumping" a disabled vehicle. This is typically a positive (+) cable running from the starter to an exposed stud. These connections must be inspected and maintained to provide integrity. Additionally, this stud is covered with a flexible rubber boot (Photo 7).

This boot must be in good condition and over the positive (+) stud at all times. A loose jumping stud/cable can create a sustained duration spark similar to the alternator B+ cable.

Starter: Most motorcoaches use either a Delco 42MT or 50MT starter. Under normal circumstances the starter draws 800 to 1000 amps respectively while cranking the engine. When it is not cranking the engine (no current flow) it is simply exposed to battery voltage. As with the alternator, the starter is connected to the batteries via a B+ (direct battery feed) cable. It too is routed to a stud on the starter

motor. However, this is initially routed to a bulkhead junction (Fig. 3; Photos 8a & 8b); again this is a heavy cable and must be properly connected and supported in its mounting.

Care must be given to the cable condition, cable to starter connections, as well as its' routing so that this B+ cable is not making unwanted contact and potentially coming in contact with ground as a result of an insulation breach.

The starter should be treated and cared for in the same manner as the alternator since they both reside on the fuel side of the engine in some applications.

Combustible Materials: In some remote cases, the onboard fuel supply can be a causal element in a fire. In order for the fuel to ignite, the surface temperature of the engine and related components must be at least at the auto-ignition temperature of diesel fuel. All of the liquids; fuel, power steering fluid, engine oil and hub/gear oil, found on the motorcoach have an auto-ignition temperature (see appendix B). If one or more of these fluids were to come in contact with a sufficiently hot surface at auto-ignition temperature; that fluid would ignite in the absence of an open flame. To minimize fluid fires, all hoses, housings, couplings, fittings and filters must be inspected diligently to reduce or eliminate leaks which could lead to a fire. Practically speaking, the first step is to regularly clean the engine, transmission and interior surfaces of the engine compartment. This has a triple advantage to the operator. First, oil and road dirt covering the engine will act to insulate it holding in engine heat. Second, when the engine is clean it is easier to locate a fluid leak. Lastly, with a clean engine, you reduce the risk of fire and it spreading by virtue of not having any combustible materials on the engine itself.

Hub Failure: Wheel hubs low on oil can have an elevated operating temperature high enough to ignite the surrounding combustible materials by auto-ignition. Coincident to this, in some cases, is a wheel end failure resulting in a "wheel-off" situation.² Typically, the outer wheel bearings' lowest point is above the lowest point of the hub seal. Therefore, since the outer bearing is at that elevation, it starves for oil first. The

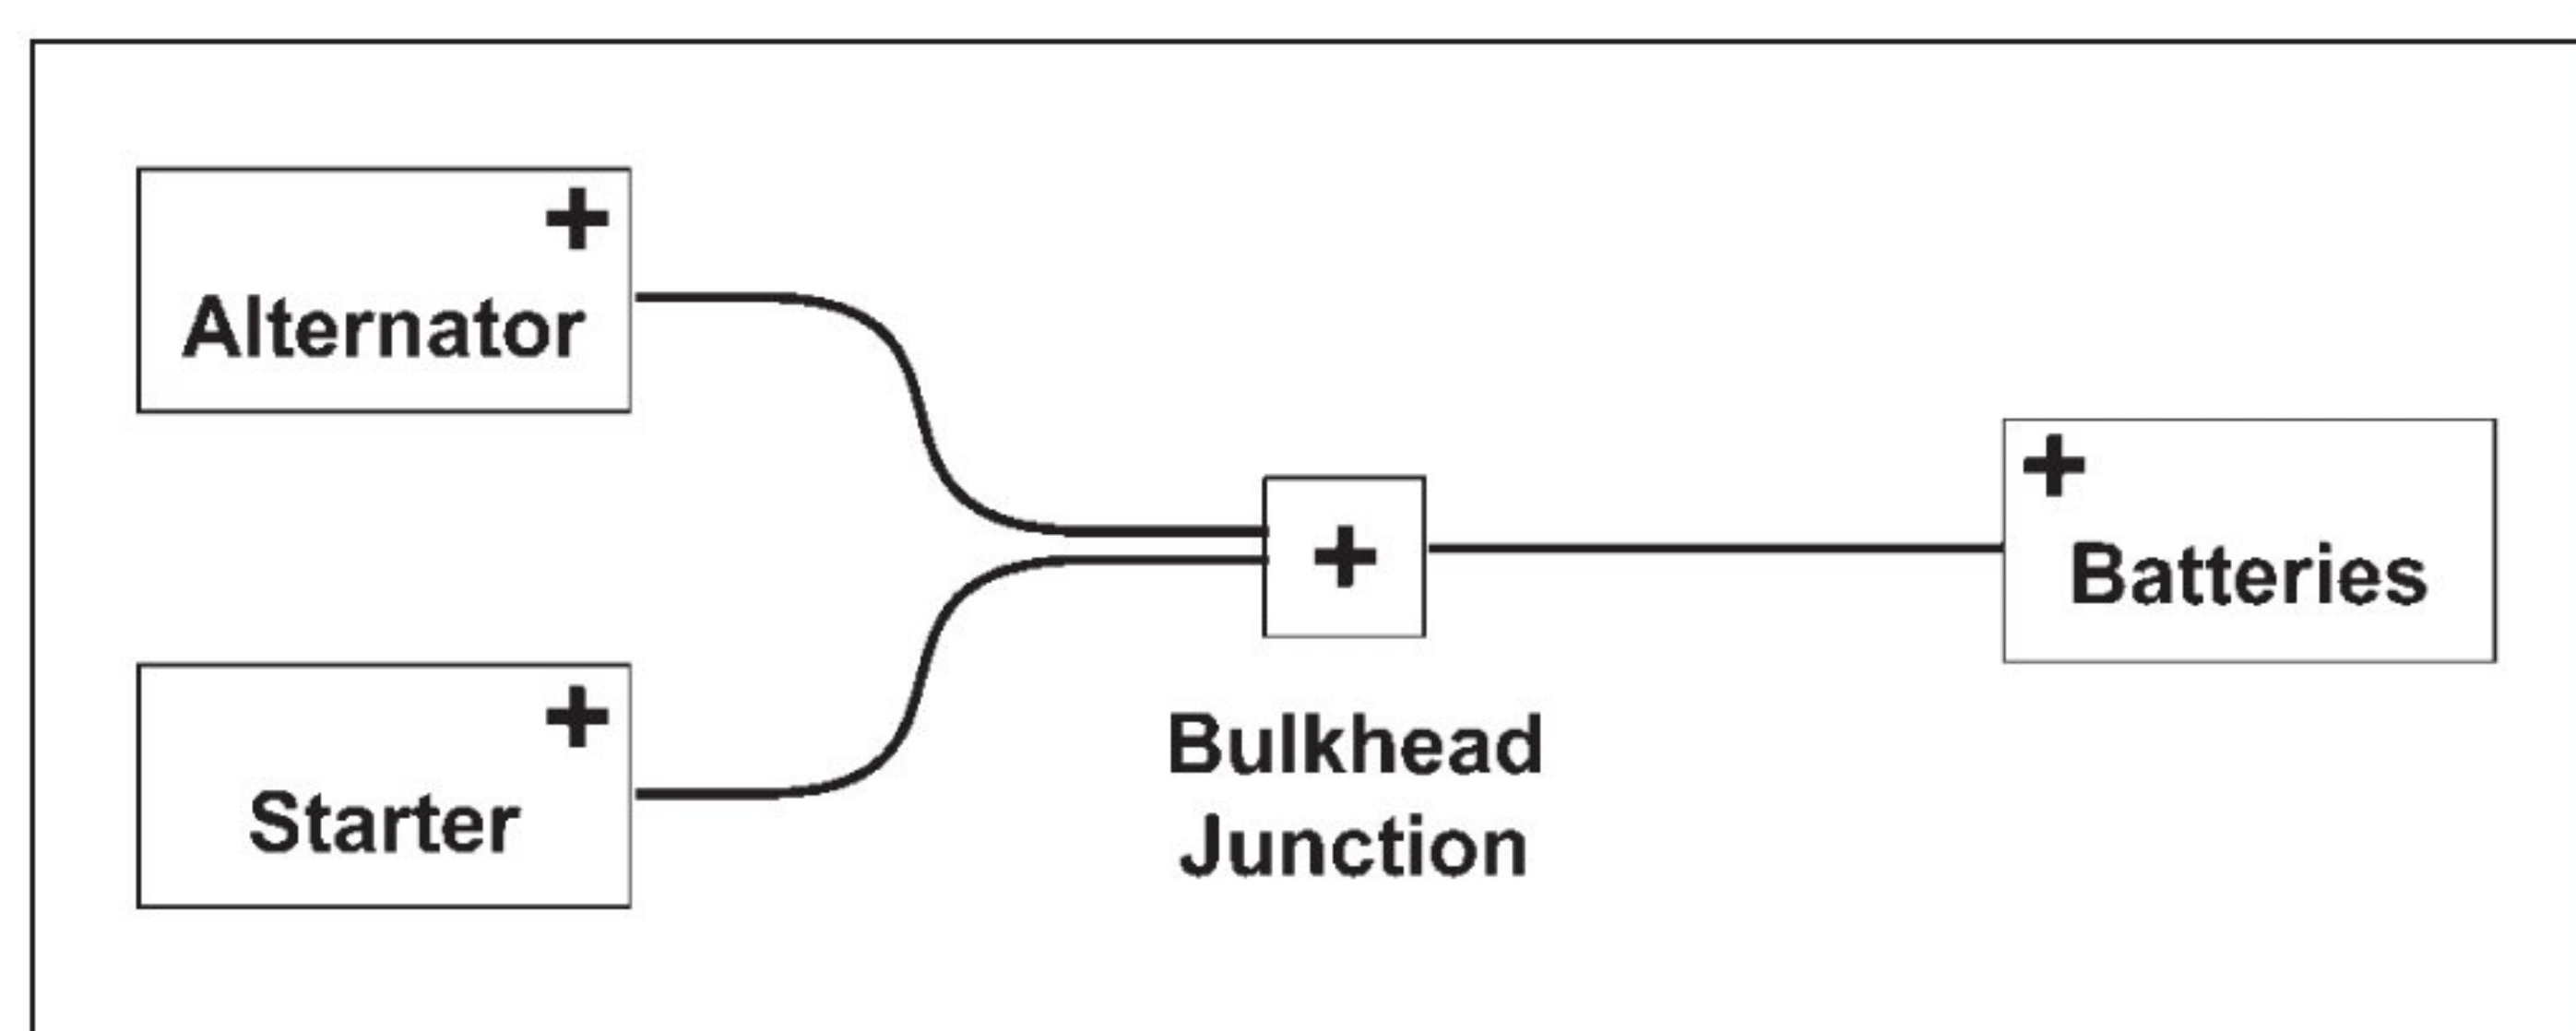


Figure 3

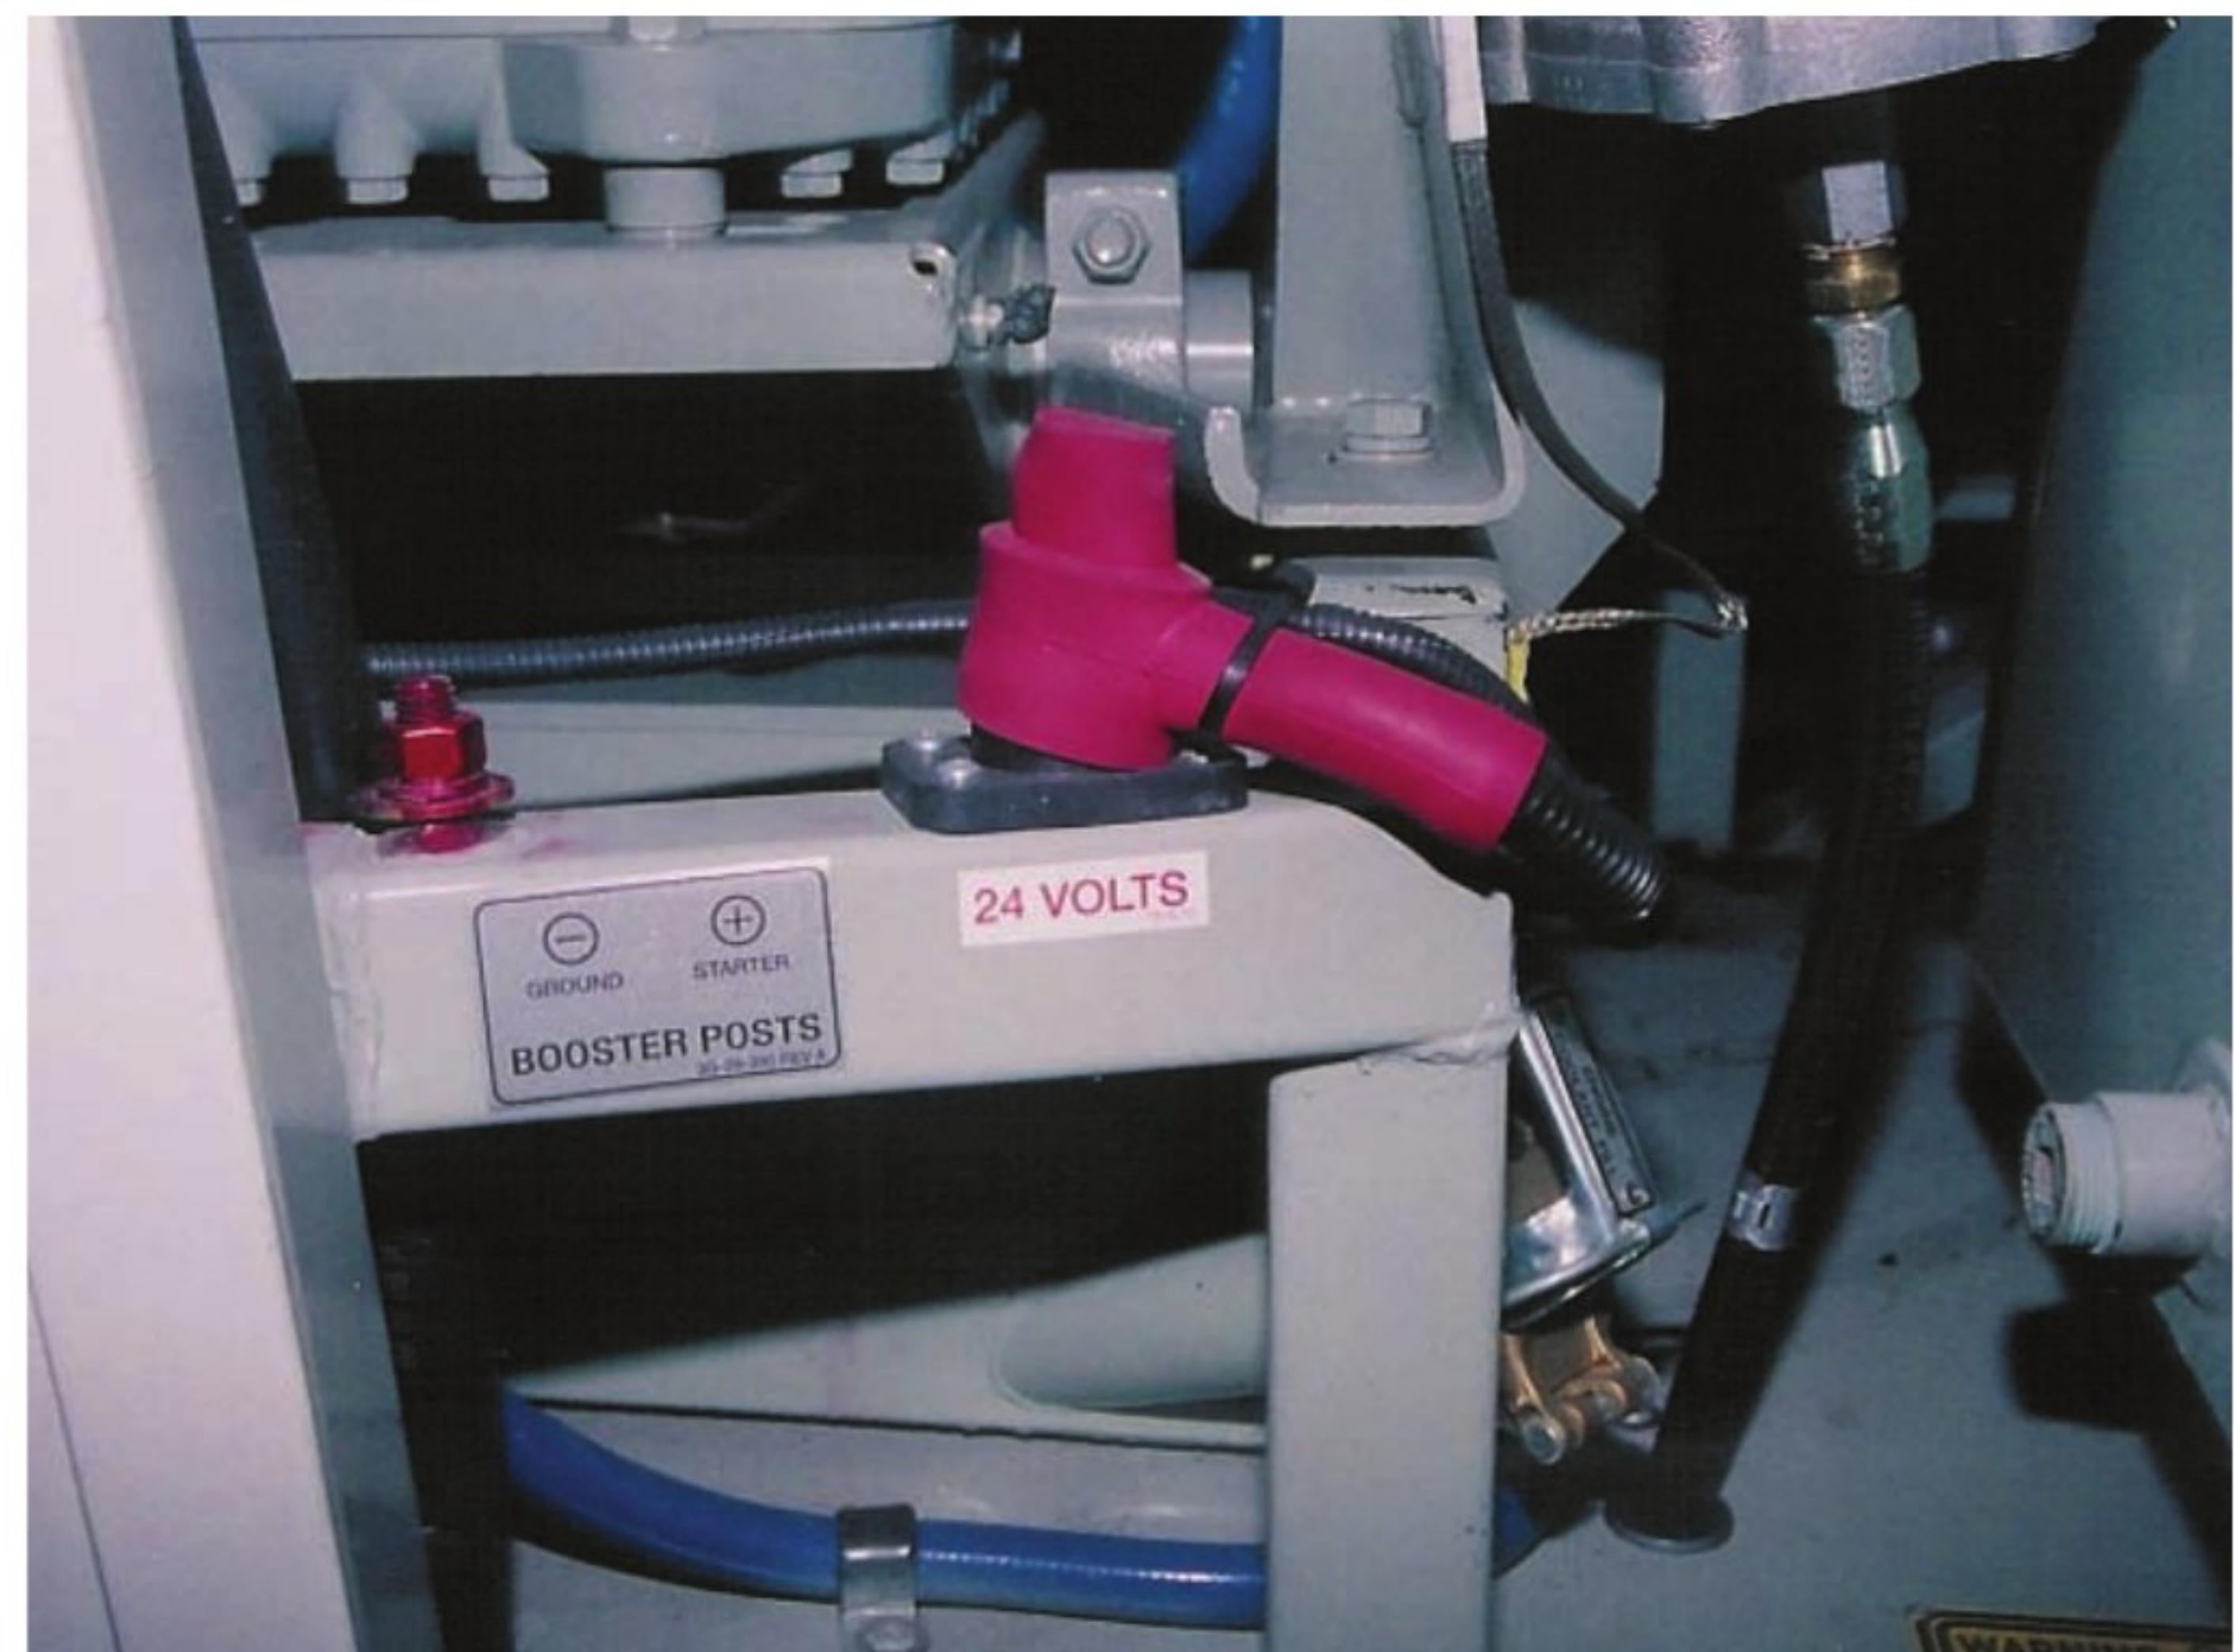


Photo 7: Remote Jump Post



Photo 8A: Bulkhead Connection 50-DN



Photo 8B: Bulkhead Connection Bosch T1



Photo 9: Disc Brake (RH Tag Axle) [Involved]



Photo 10: Disc Brake (LH Tag Axle) [Not Involved]

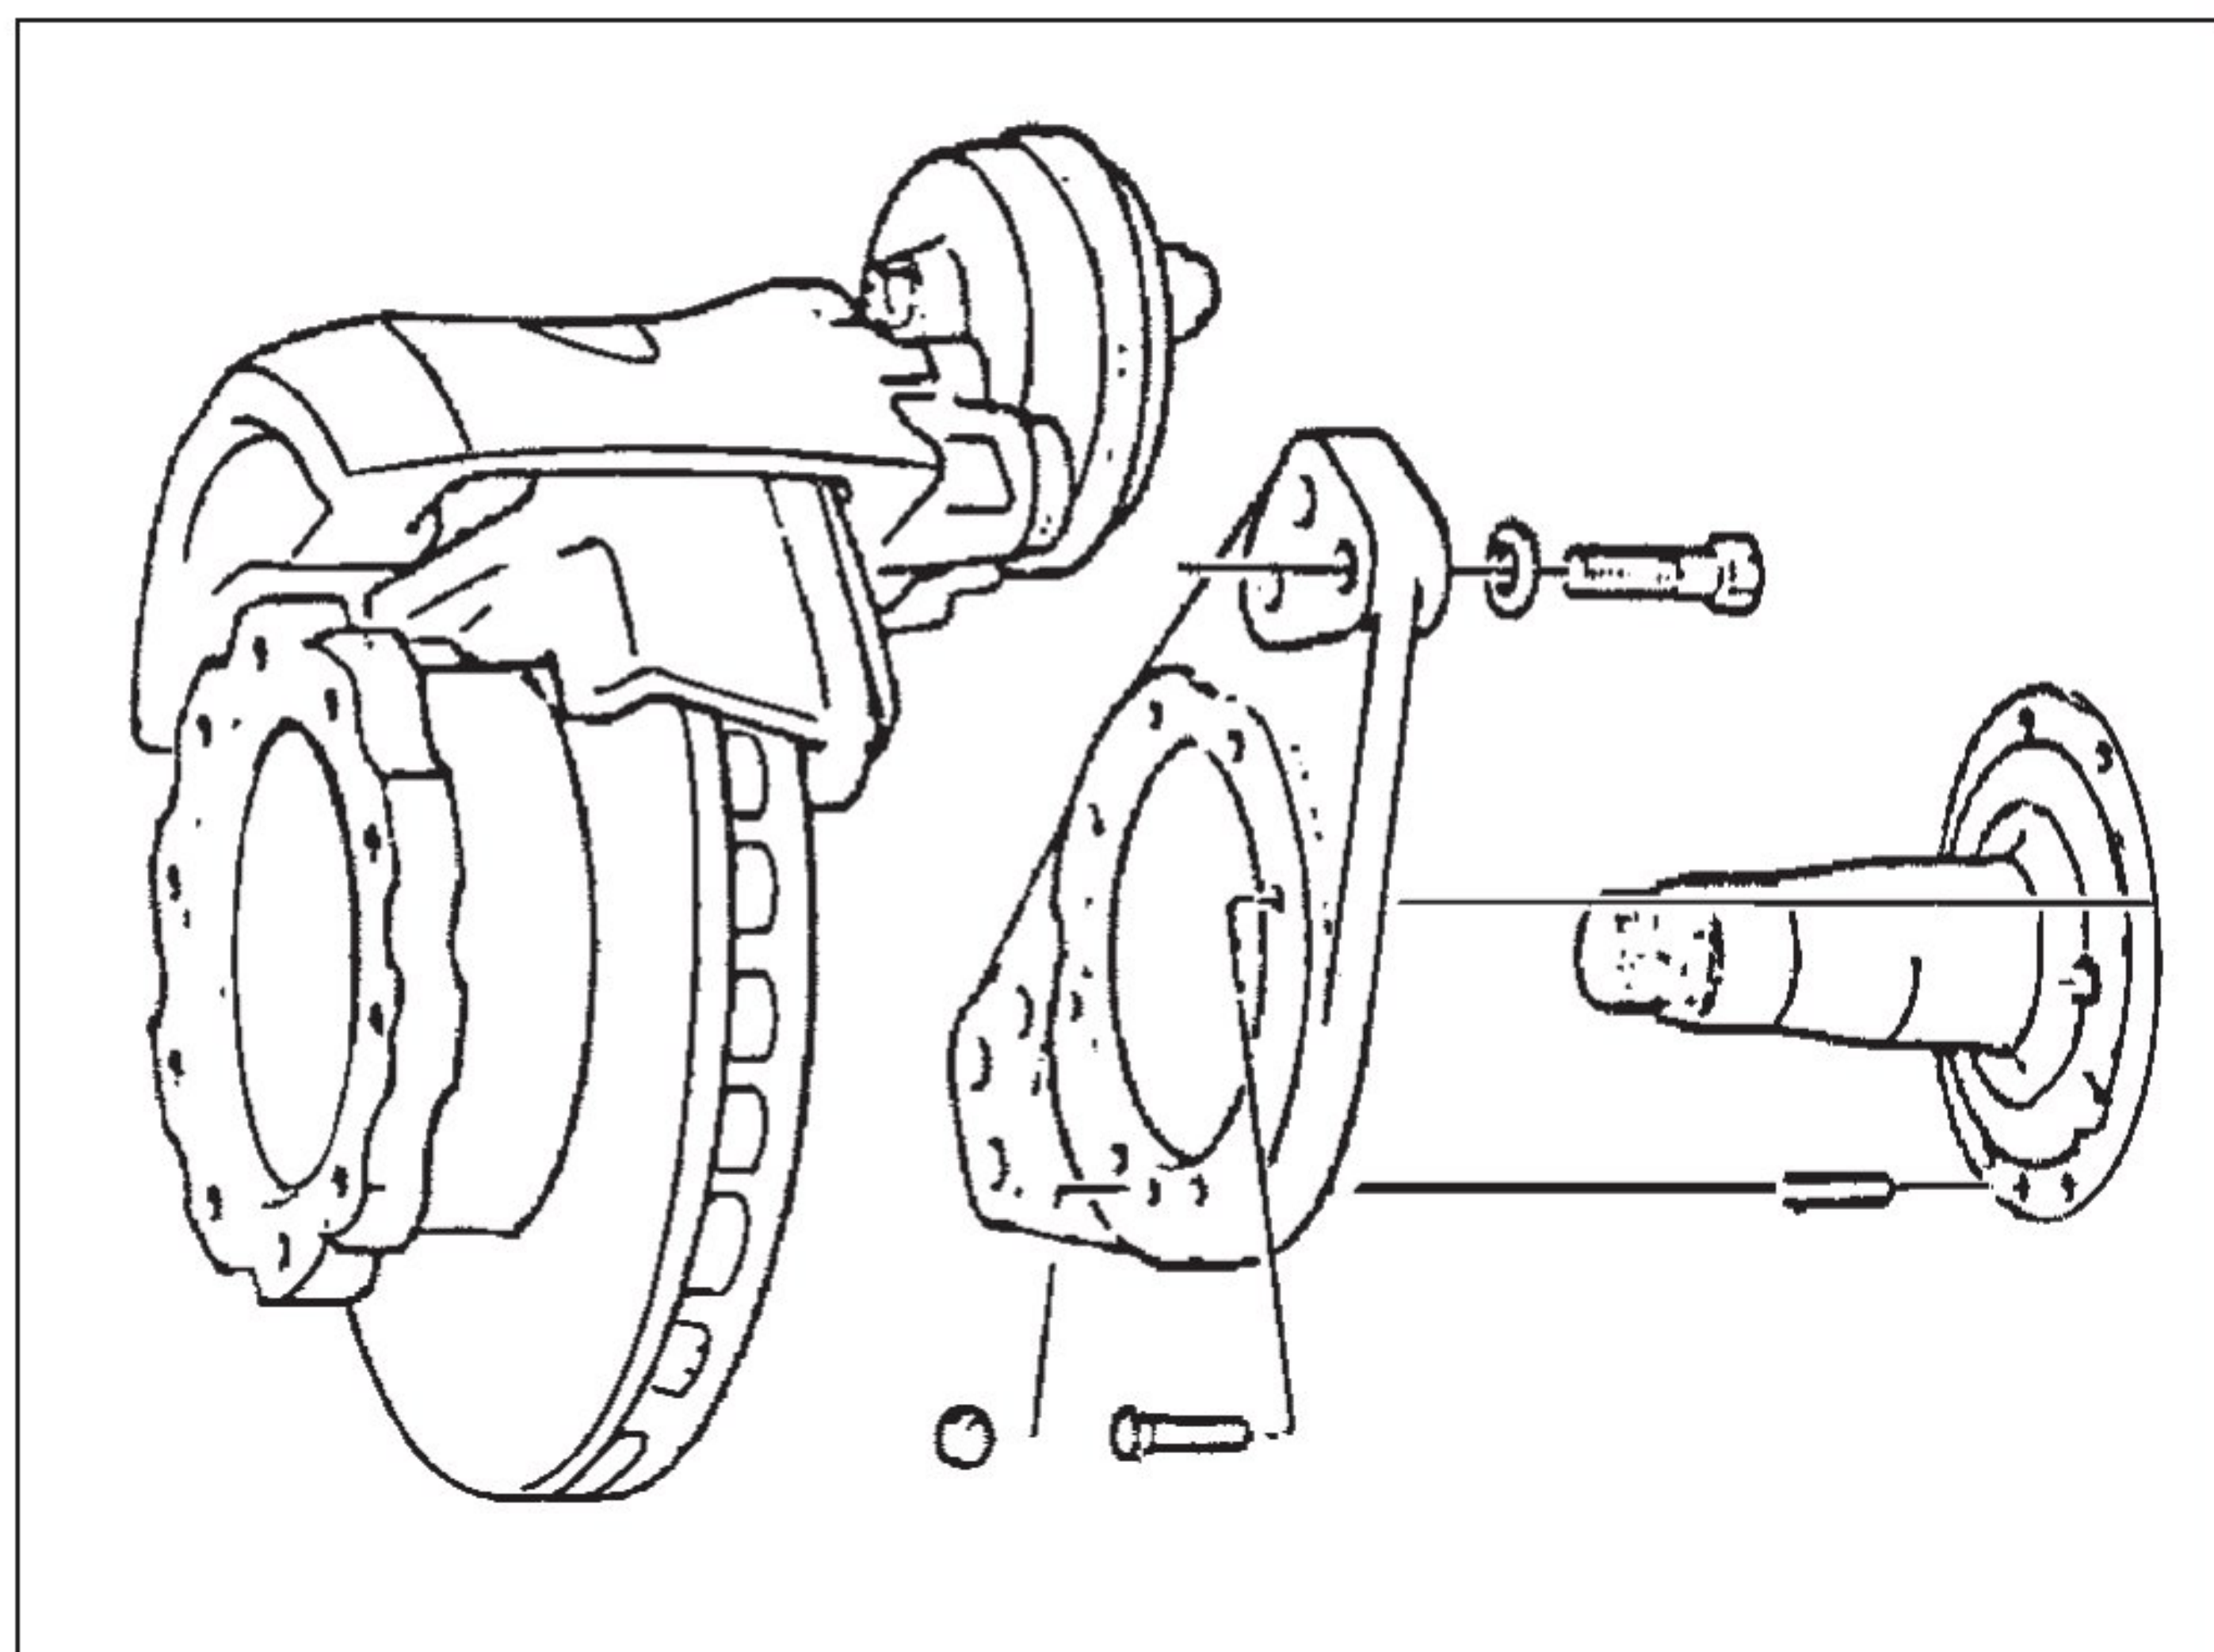


Figure 4: Disc Brake, Caliper, Spider & Spindle

inner bearing is at a lower point in the hub and is usually bathed in oil for a longer period of time. There are two common failure modes for the hub (non-driving) to be low on oil; hubcap failure and seal failure. The hubcap can have at least four failure modes; the plastic site glass, o-ring, the rubber plug and the mounting gasket. For any of these reasons the hub can become low on oil. As for a drive hub, the axle flange gasket or seal can be a leak point allowing the hub to become low on oil. It is noteworthy to mention that when the seal wiper becomes worn (grooved) it may create a leak point despite the integrity of the seal itself. The wiper should be inspected each time the hub is removed and changed if it appears to be excessively worn. *In some cases, during a wheel bearing failure, the vehicles' A.B.S. dash light may become illuminated as a result of the sensor-to-hub gap becoming greater due to the hub beginning to come off of the spindle or axle tube or from a skidding or locked tire/wheel.*

An additional risk exists, with disc brake applications, during a wheel bearing/hub failure. That is, as the outer bearing begins to fail, the hub load is transferred from the outer bearing to the brake caliper, brake pads and rotor. Once the outer bearing has failed completely, no longer able to support the hub load, the caliper, brake pads and rotor are then supporting that particular wheel end (Photos 9 & 10).

This is due to the fact that the caliper rides in the caliper carrier which is attached to the spider which is mounted to the axle tube/spindle (Fig. 4).

Once the brake caliper begins carrying the load, at that particular wheel end, the surface temperature of the brake pads and rotor (or drum) rise well above the auto-ignition temperature of the surrounding combustibles (due to friction) and eventually igniting them. The combustible material typically ignited by this failure mode is the tire(s). Tires generally revert (melt) at approximately 250°F and catch fire over the 600°F mark. It is common, although not mandatory, for the tire fire to occur when the vehicle comes to a stop. This is the condition with the least amount of air flow circulating around the brake rotors, brake drums and tires. Without air flow around these items, their temperature rises rapidly and is transmitted to the tire—subsequently igniting it. This concept of brake caliper/pad/rotor supporting the hub load can typically be seen by a thinner more worn outside brake pad as compared to the inner pad. This is due to the hub moving outward, away from the spindle. As a result of this temporary load support from the caliper, the

operator may continue to drive the vehicle without any indication of a problem until it is too late.

Disc Brakes: A “frozen” disc brake caliper can generate enough heat to ignite the surrounding combustible materials and sustain a fire. Proper inspection and lubrication intervals should be adhered to along with a periodic activation and release sequence confirming that the calipers are releasing and allowing the rotor to turn freely. This scenario applies to both air and hydraulic disc brakes. A simple method to determine the proper action of the calipers is to insert a feeler gauge (.002” - .004”) between the brake pad and rotor. By applying the service brakes a technician can feel if the gauge goes into this space, remains there upon brake application and is then released upon release of the service brakes. In some early applications, Rockwell disc brakes were used which in some instances were not supplied with grease fittings in the calipers* (Photo 11, Fig. 5). This very point leads to a “frozen” caliper scenario which, in the author’s direct experience, results in a fire at that wheel end.

Tires: A flat or under-inflated dual tire can become a fire hazard and in some cases go undetected. Dual tires are spaced apart to provide a gap (Fig. 6).

If the adjacent tire is under-inflated the gap closes and the tires begin to “kiss”. Since an under-inflated tire only bulges at the road surface, a cyclical contact event occurs between the inflated tire and the under-inflated tire. Over time this cyclical contact may generate heat increasing the tires temperature. Therefore, operators should always ensure that all tires, especially dual tires, are inflated and not in contact with one another. In general, operating temperatures for radial tires can be anywhere between ambient plus 60°F (150°–180°F). Under severe conditions the operating temperatures will range in the 200°F areas.³

Turbocharger: Turbochargers are a dual threat as an ignition component. First, since they are typically very hot, on the surface, they can act as an auto-ignition source. Second, upon their own internal failure, they can become an ignition source by virtue of their own internal lubrication oil. The typical turbocharger supports the shaft of the compressor and turbine with a non-conventional bearing. This is unlike the typical roller bearing. Instead the shaft is supported by

*Rockwell Calipers: ADB-1560

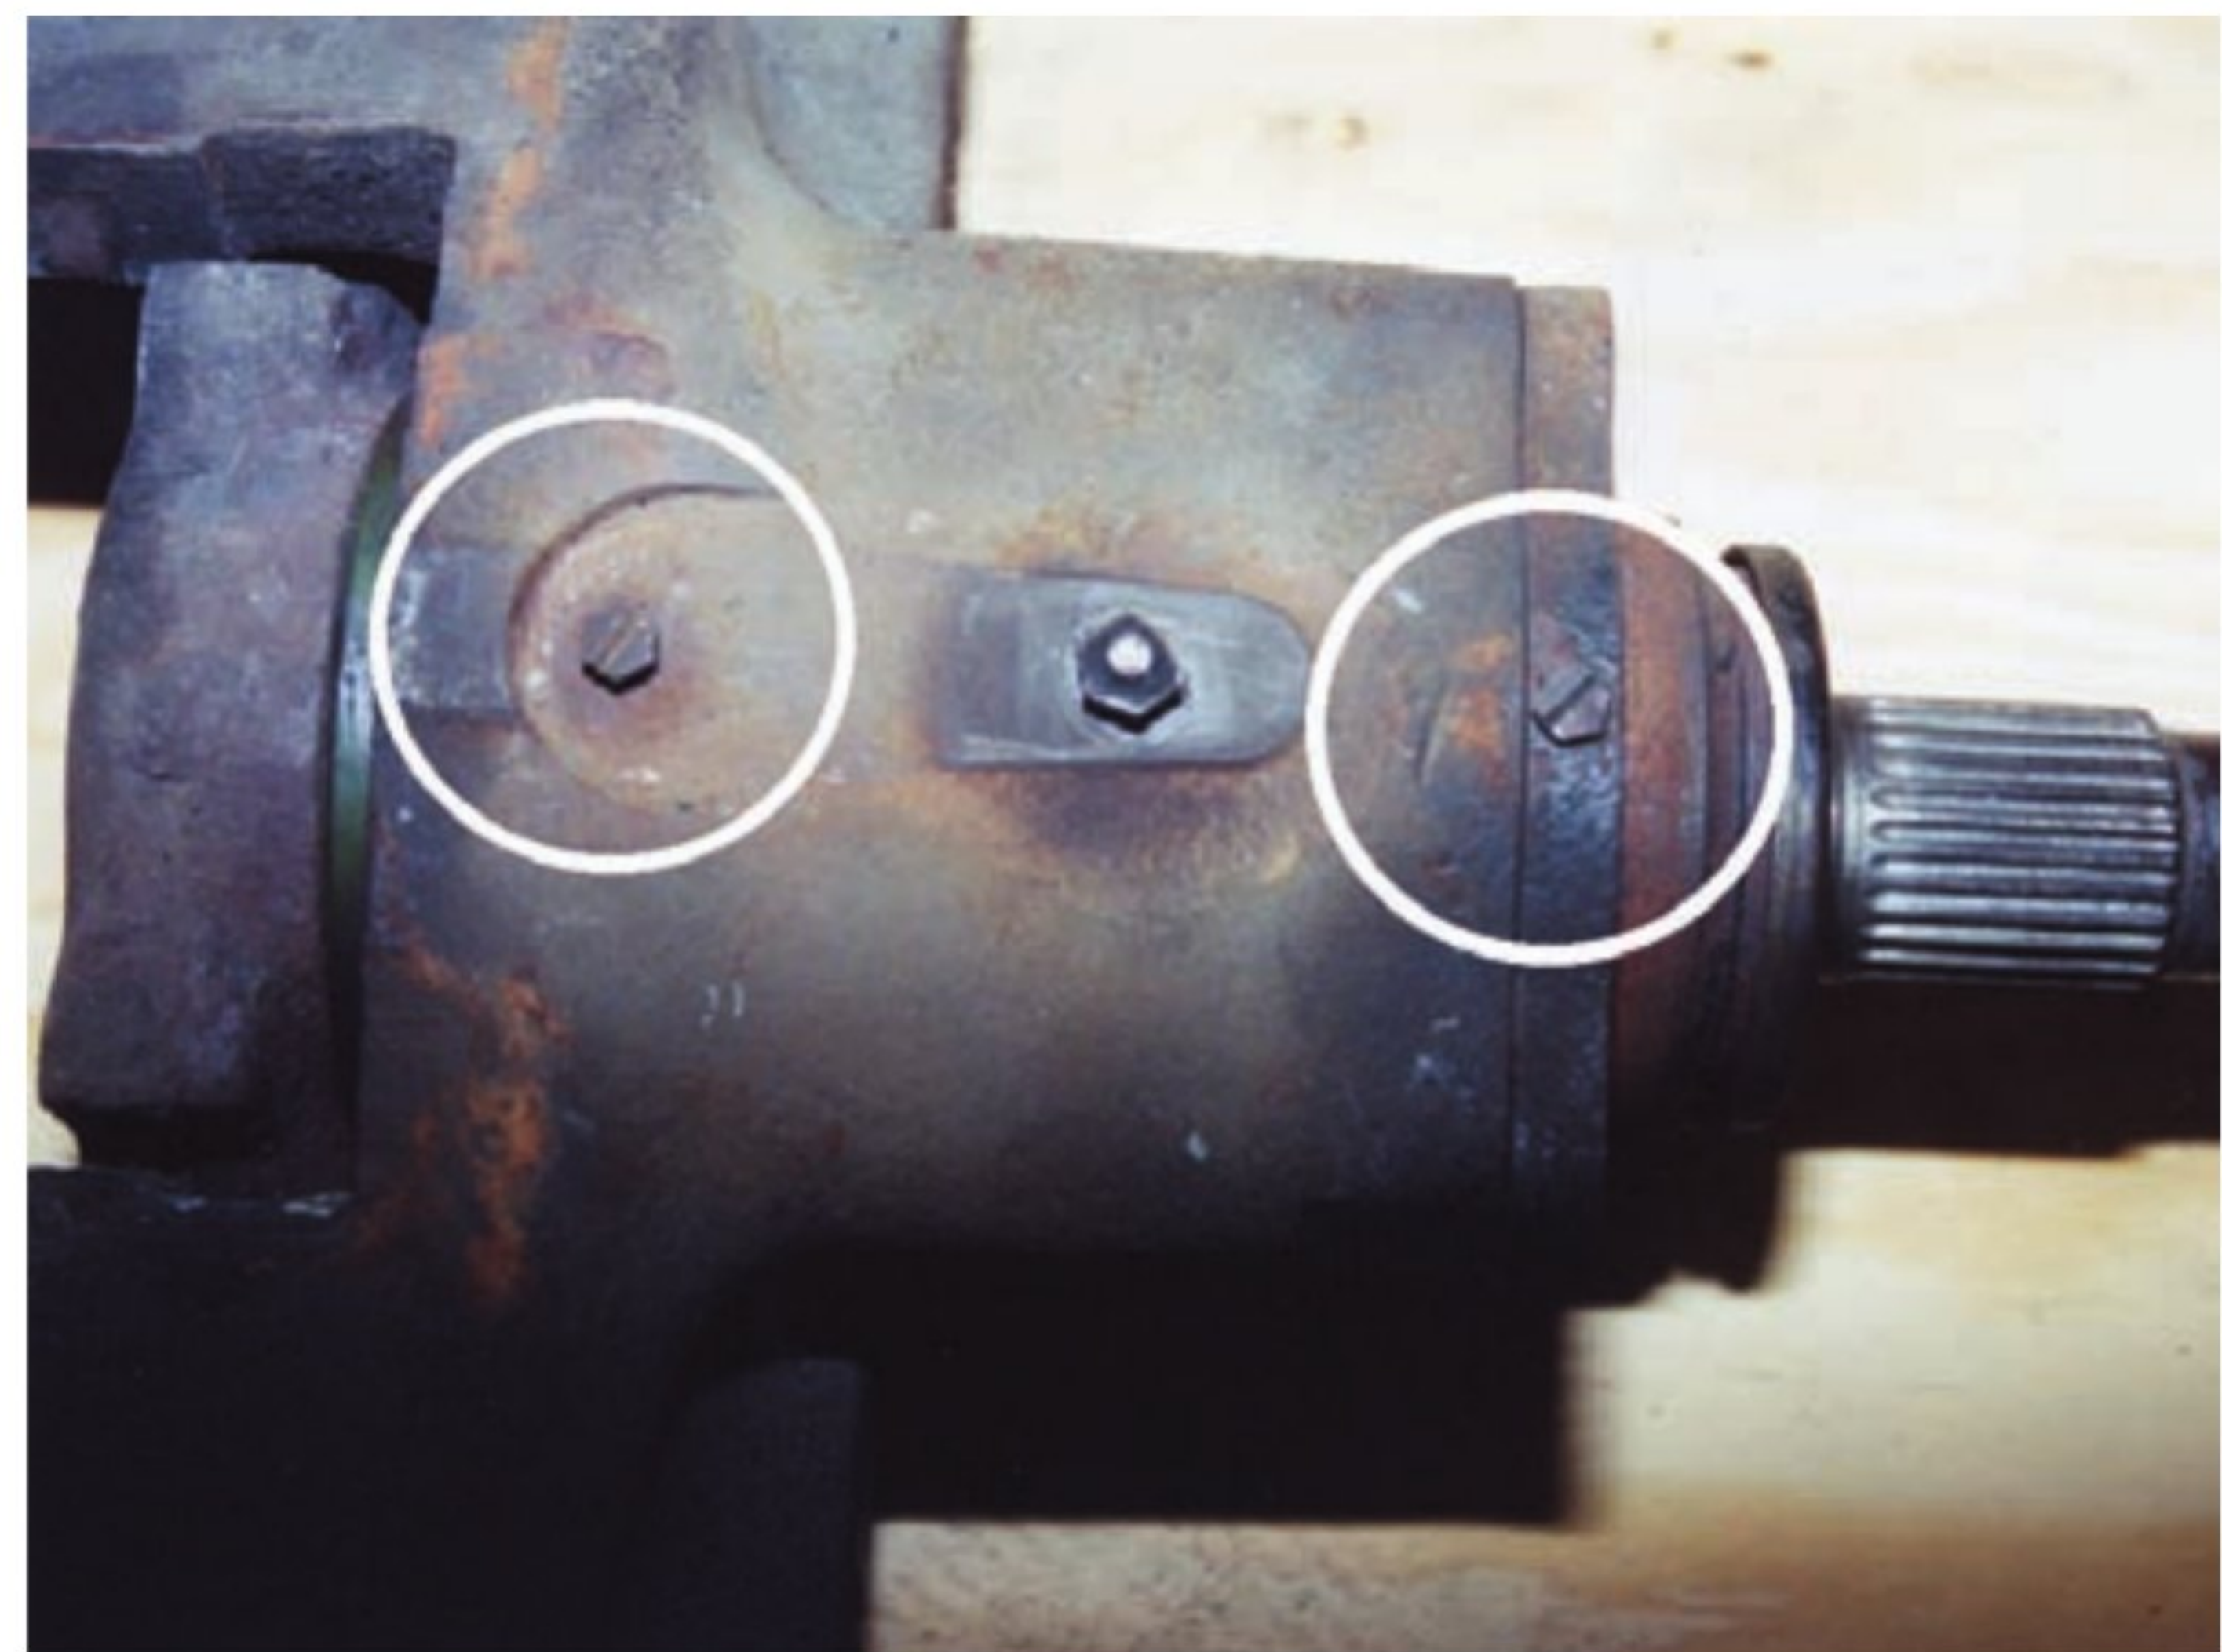


Photo 11: Rockwell Caliper ADB-1560

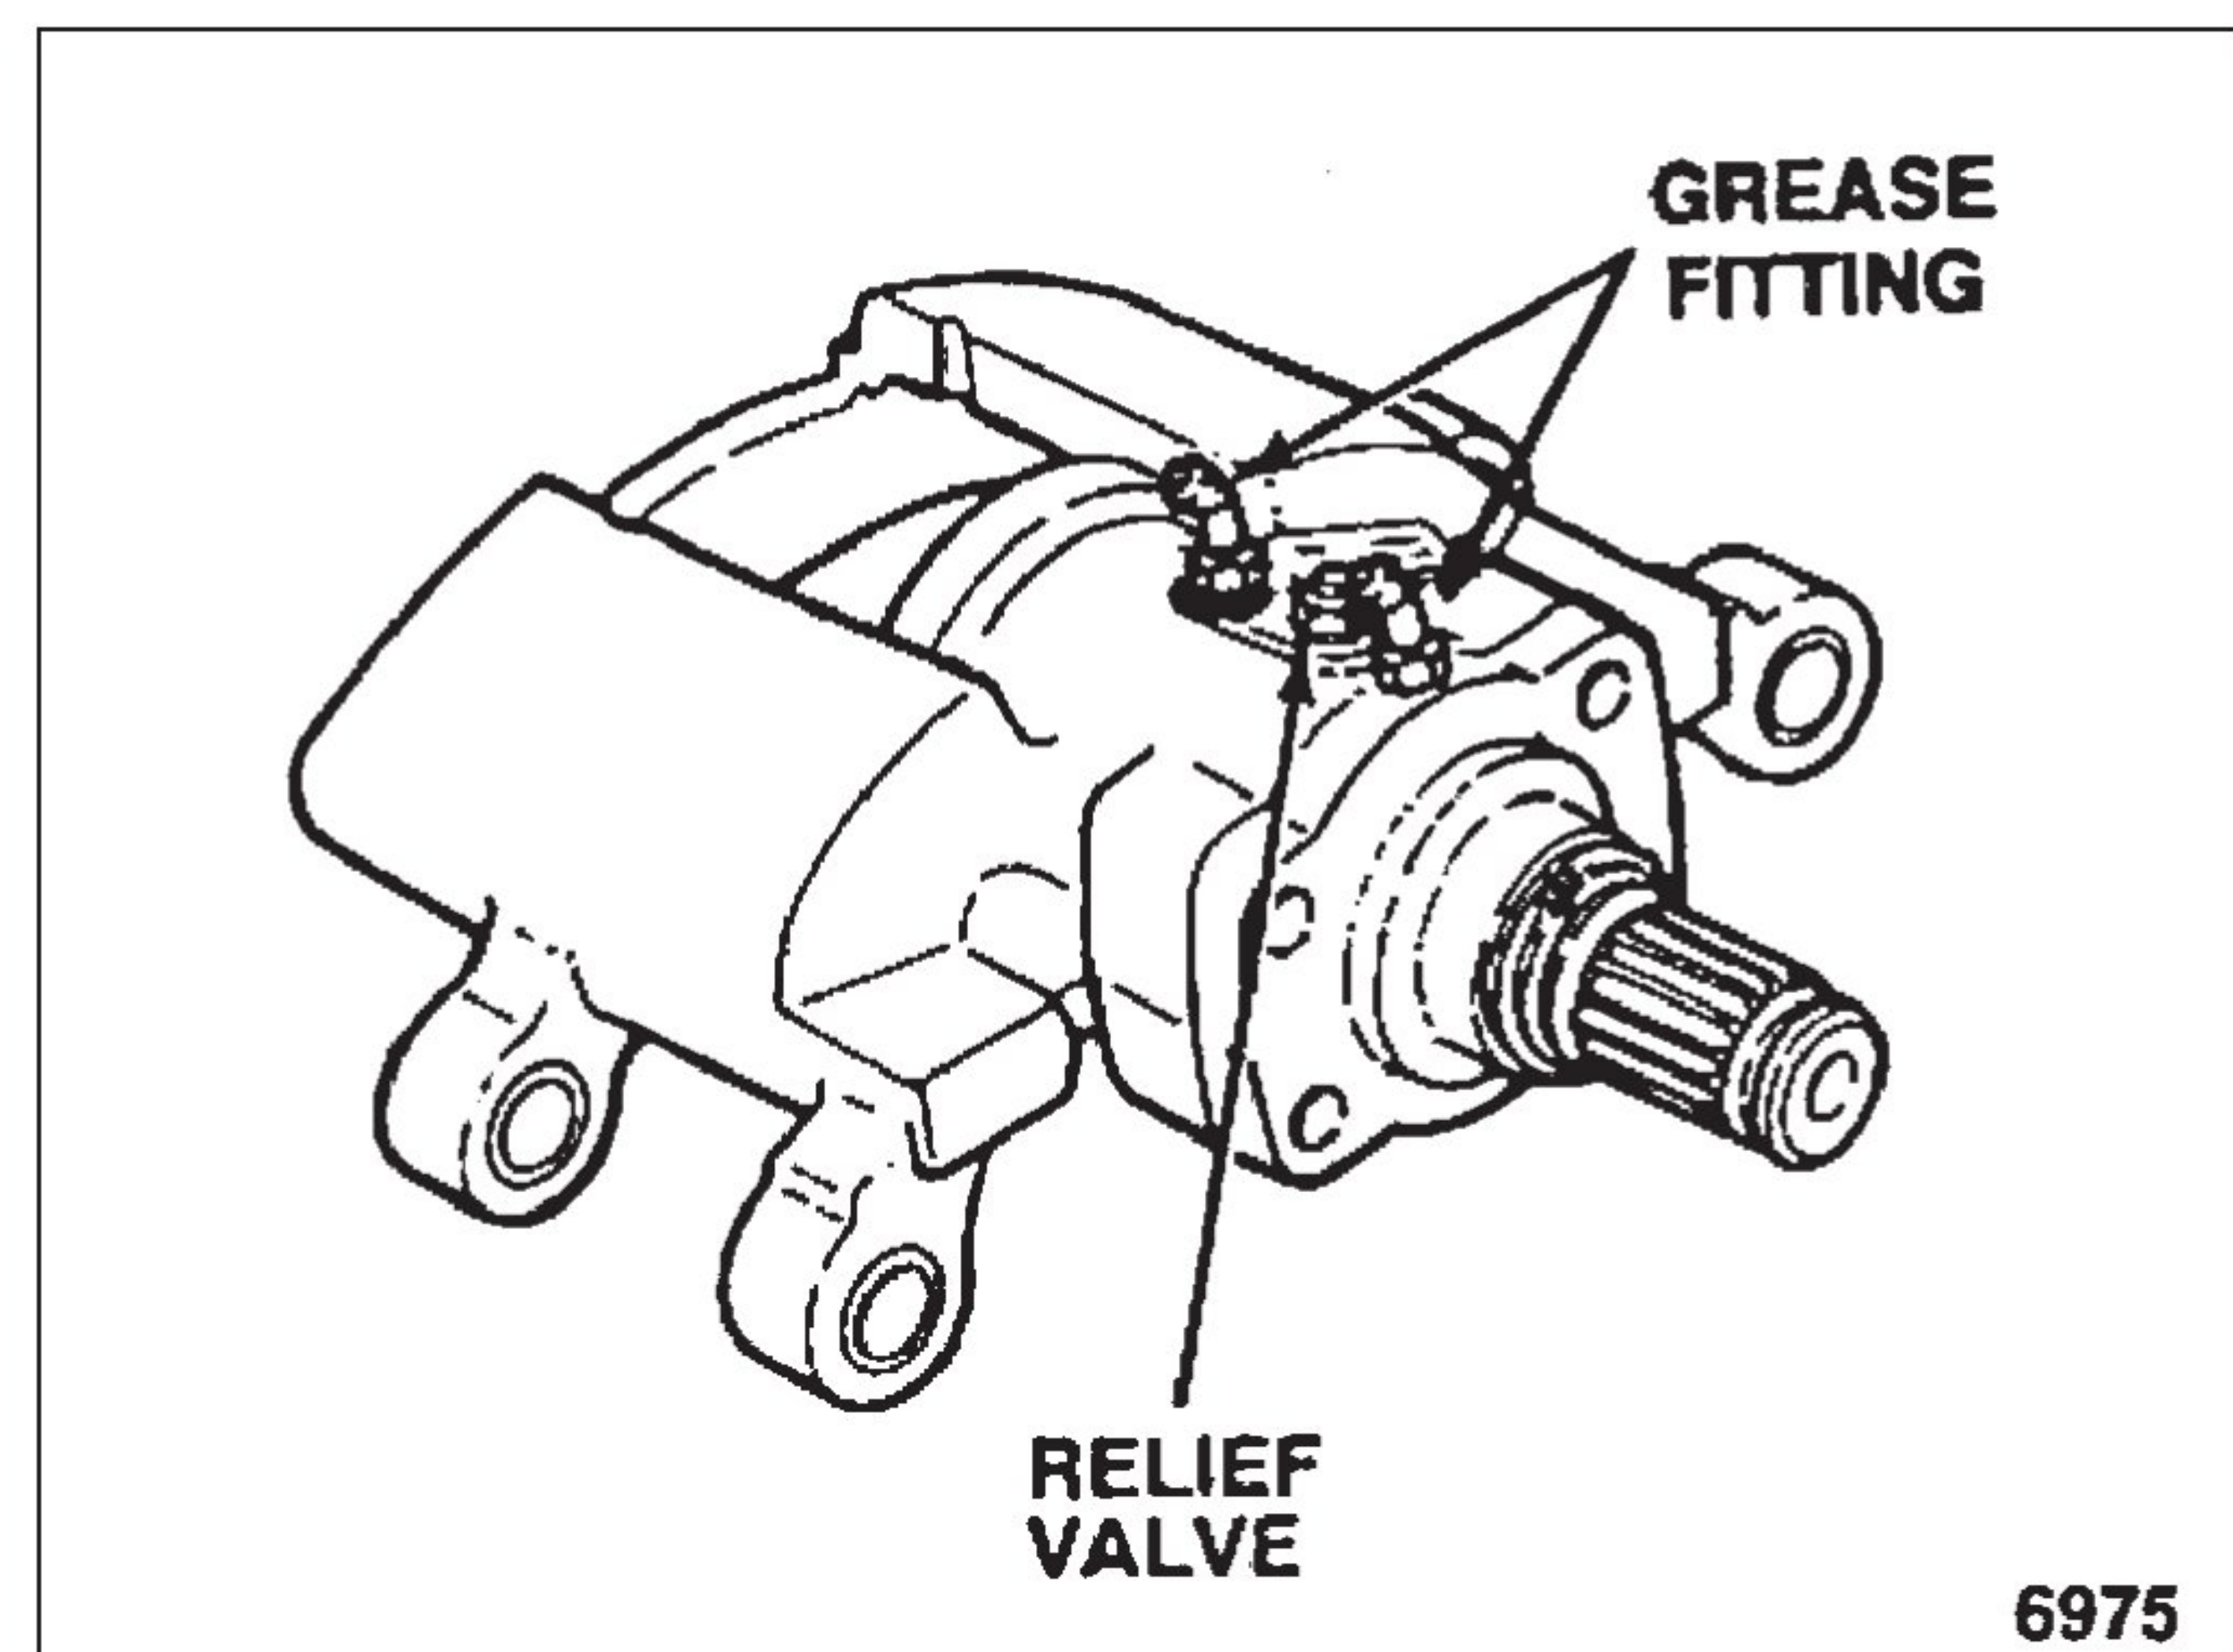


Figure 5: Rockwell Caliper ADB-1560

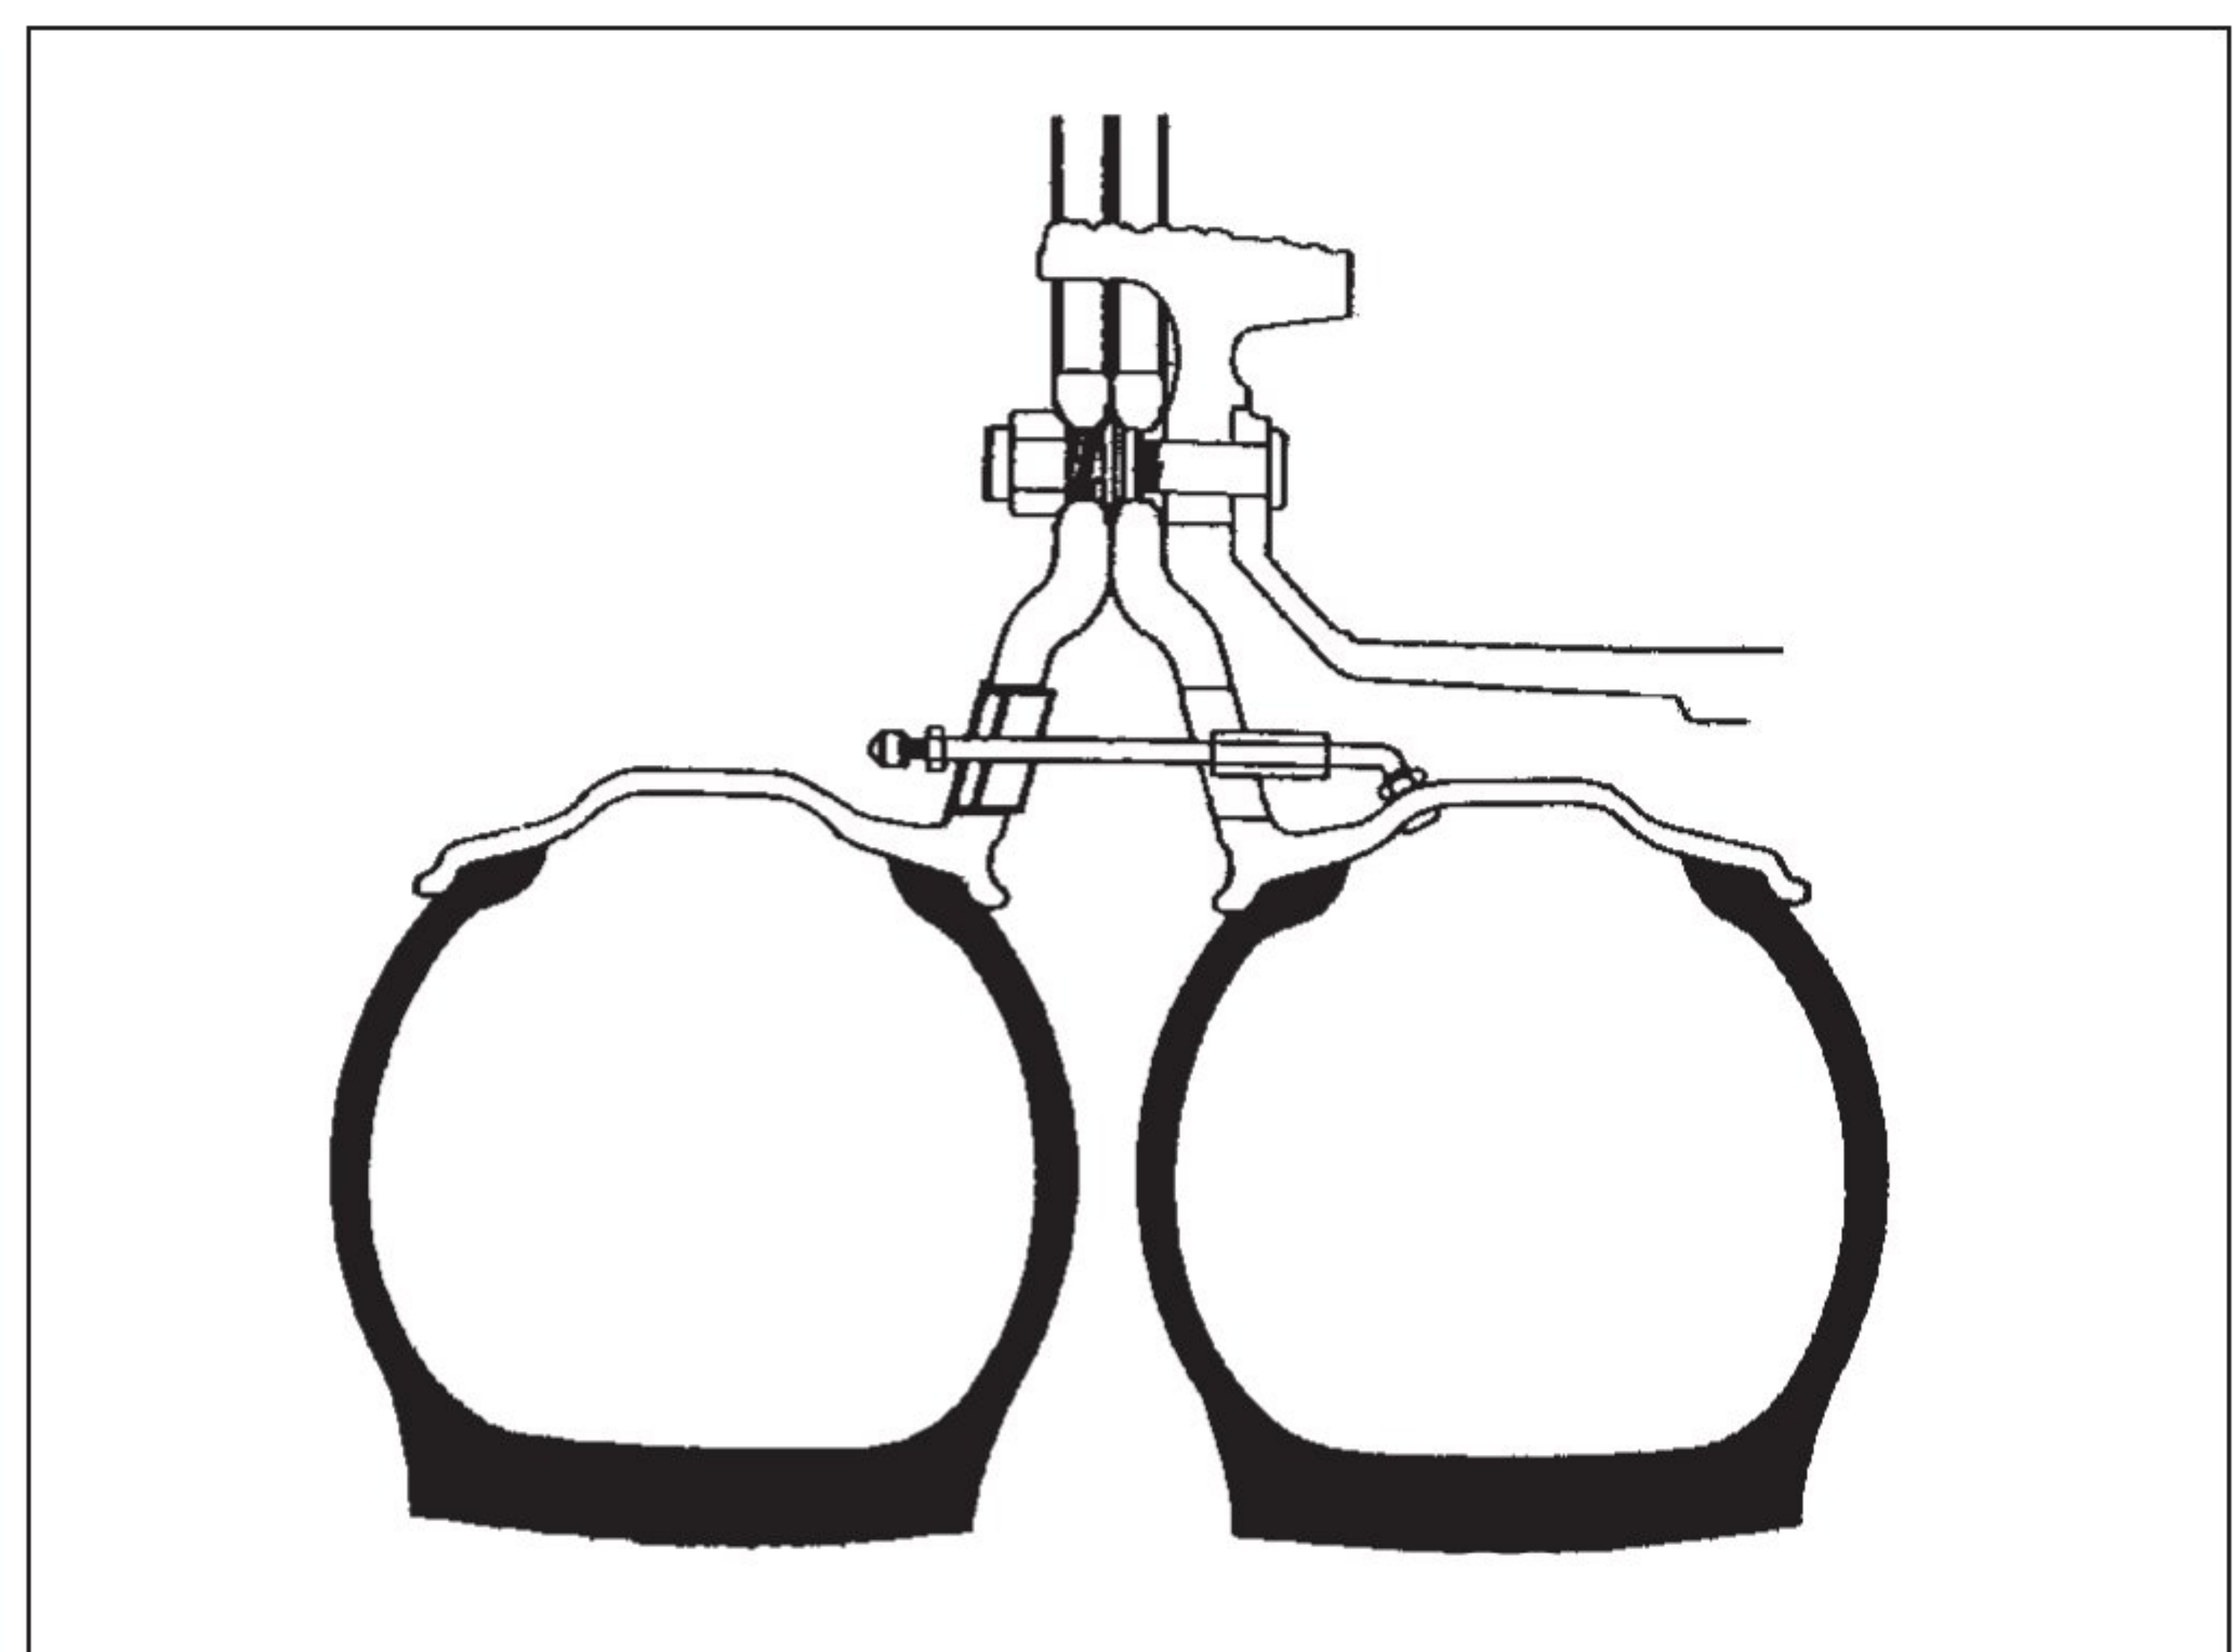


Figure 6: Cross Section View of Dual Tires

two bearing collars which are supported by the boundary lubrication layer (Fig. 7).

Upon a failure of this bearing system or an imbalance of either the turbine or compressor wheels contact is made within the turbocharger housing causing a rapid deterioration of the compressor and turbine (Photos 12 & 13).

Once the shaft has been re-oriented as a result of any one of the aforementioned failure modes, the shaft seal(s), which controls the lubrication oil within the bearing cavity, subsequently fails allowing oil to enter directly into the hot side (turbine) of the housing and then directly into the exhaust system (Fig. 8). This can create and auto-ignition fire within the turbocharger itself or exhaust system.

Some engine manufacturers have reprogrammed engine management software to detect the symptom of this failure.⁴

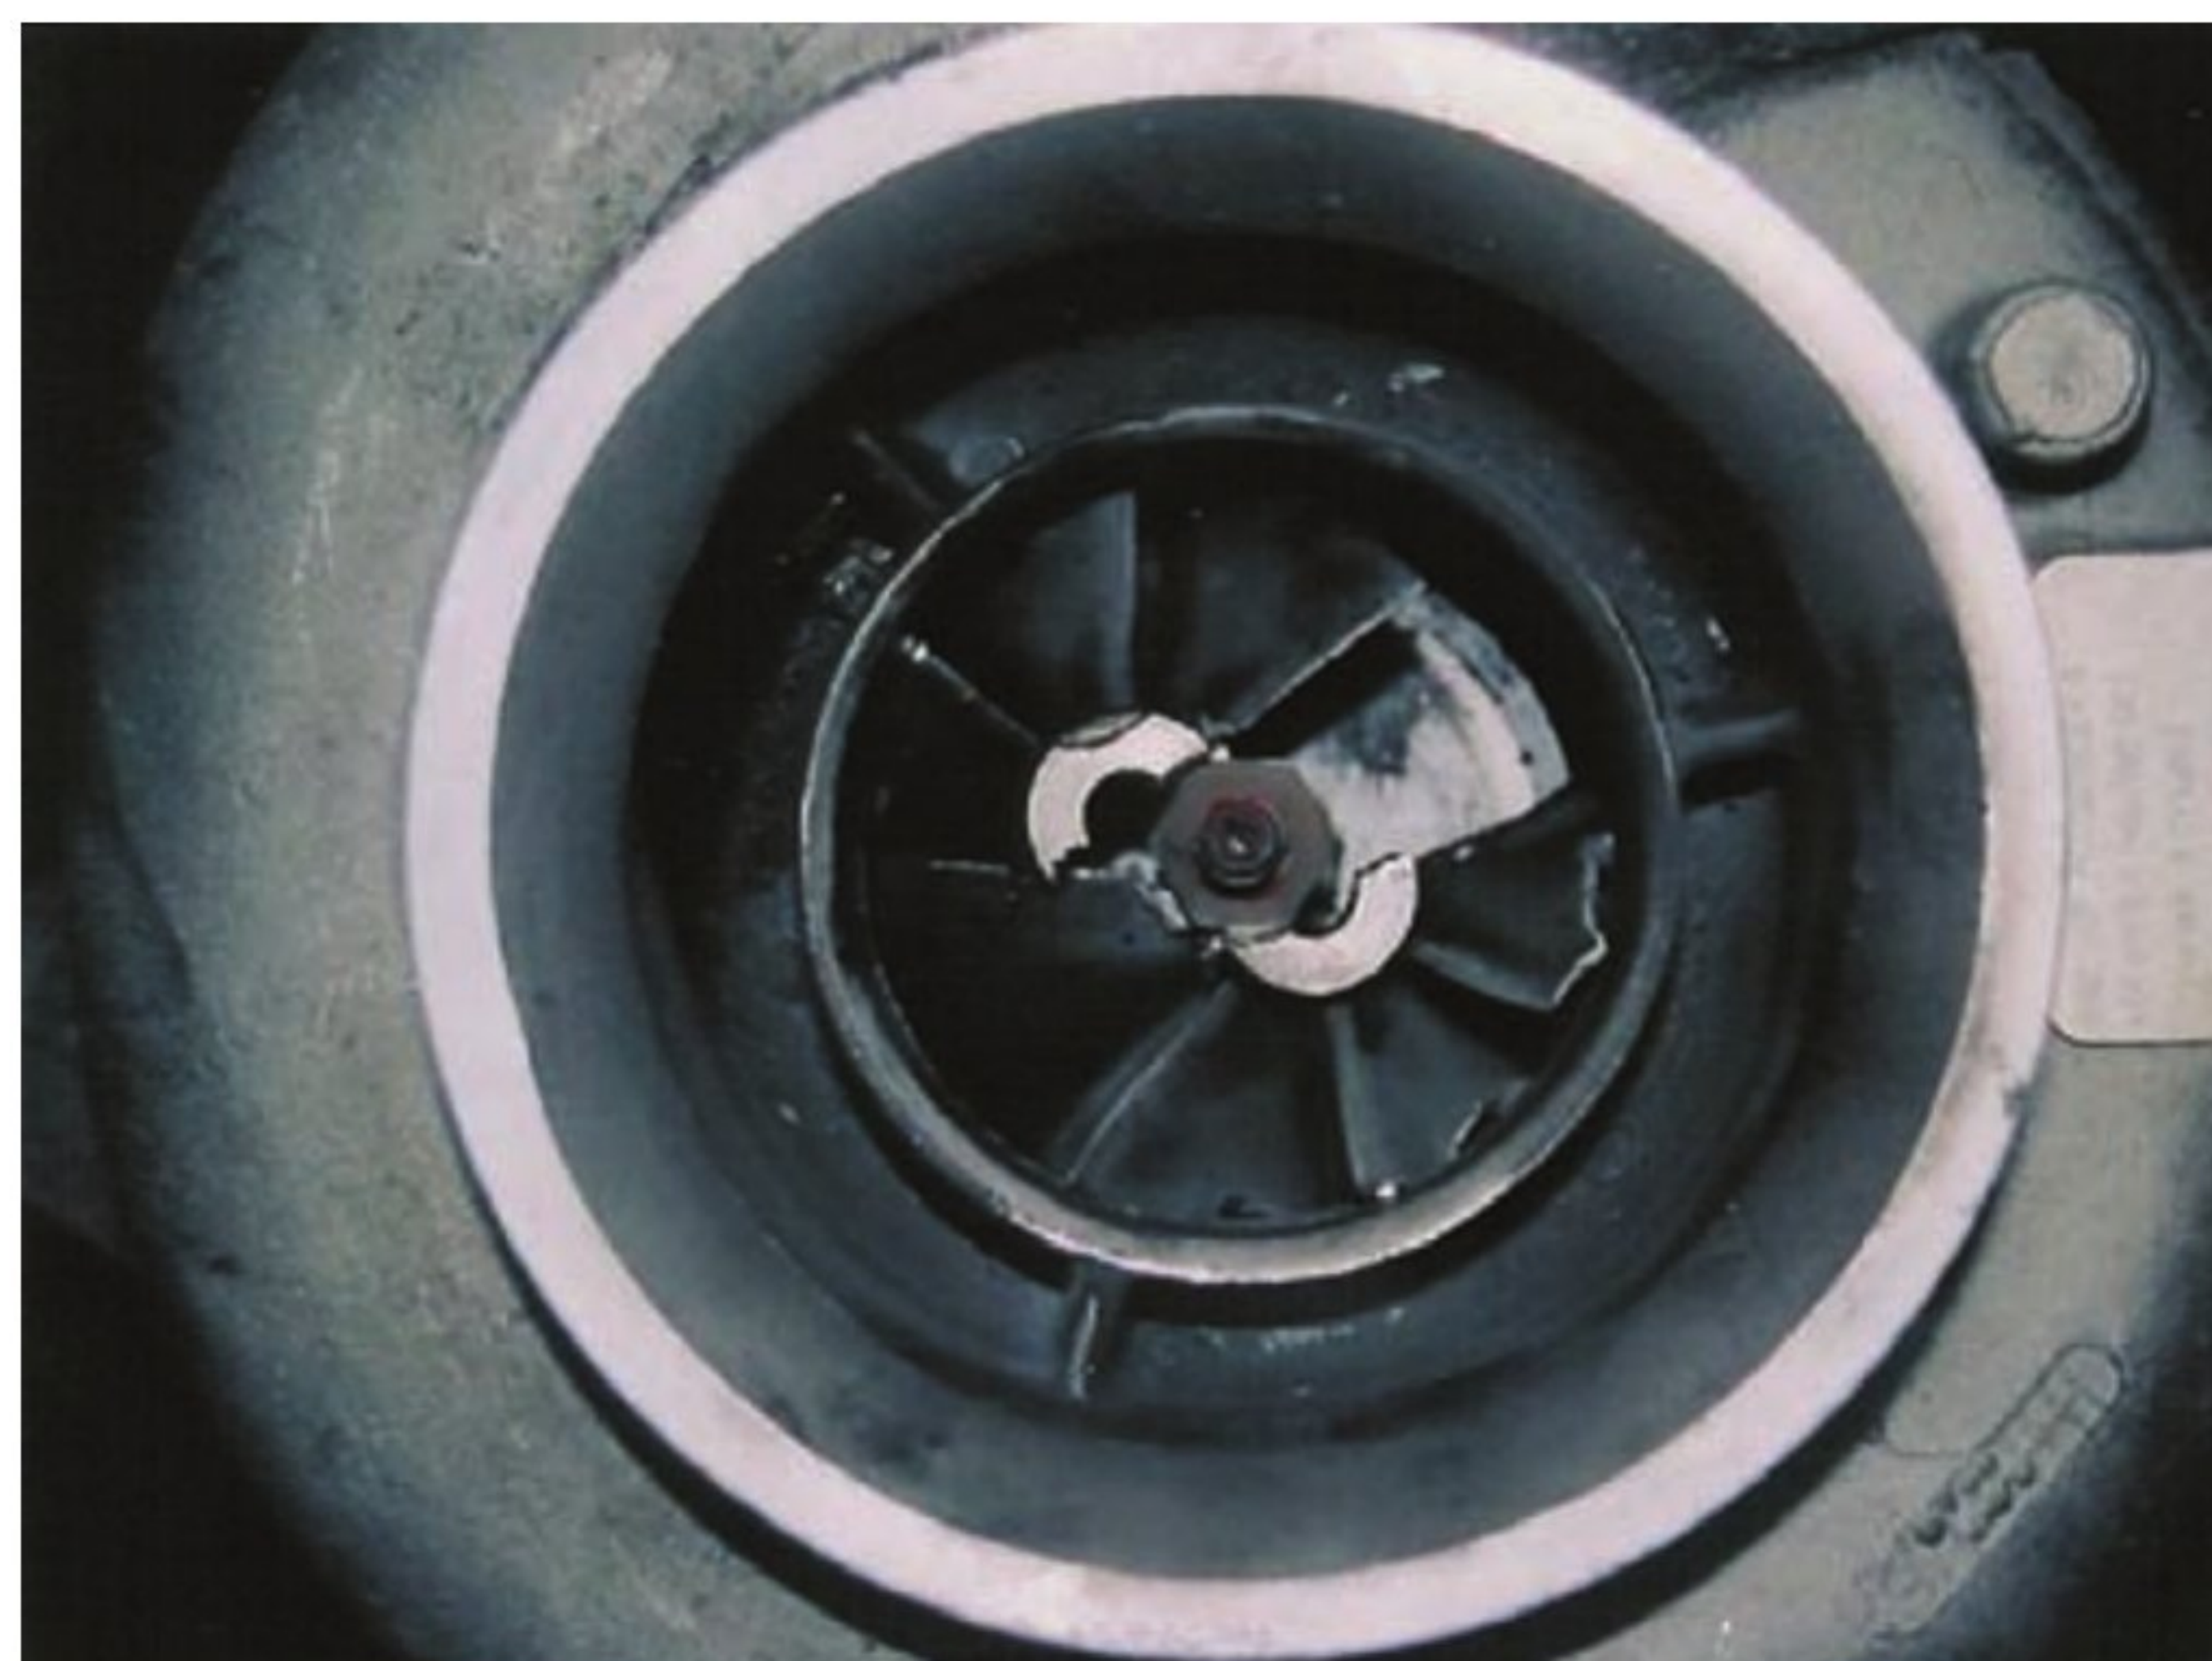


Photo 12: Failed Compressor, Series 60



Photo 13: Failed Turbine, Series 92

The engine's Electronic Control Module (E.C.M.) monitors turbocharger boost pressure for performance and engine management control purposes. With the change in software, the E.C.M. now sets a fault code for low boost pressure which could indicate an internally failed turbocharger. However, if the engine in question precedes any recent software change, two other simple methods can be

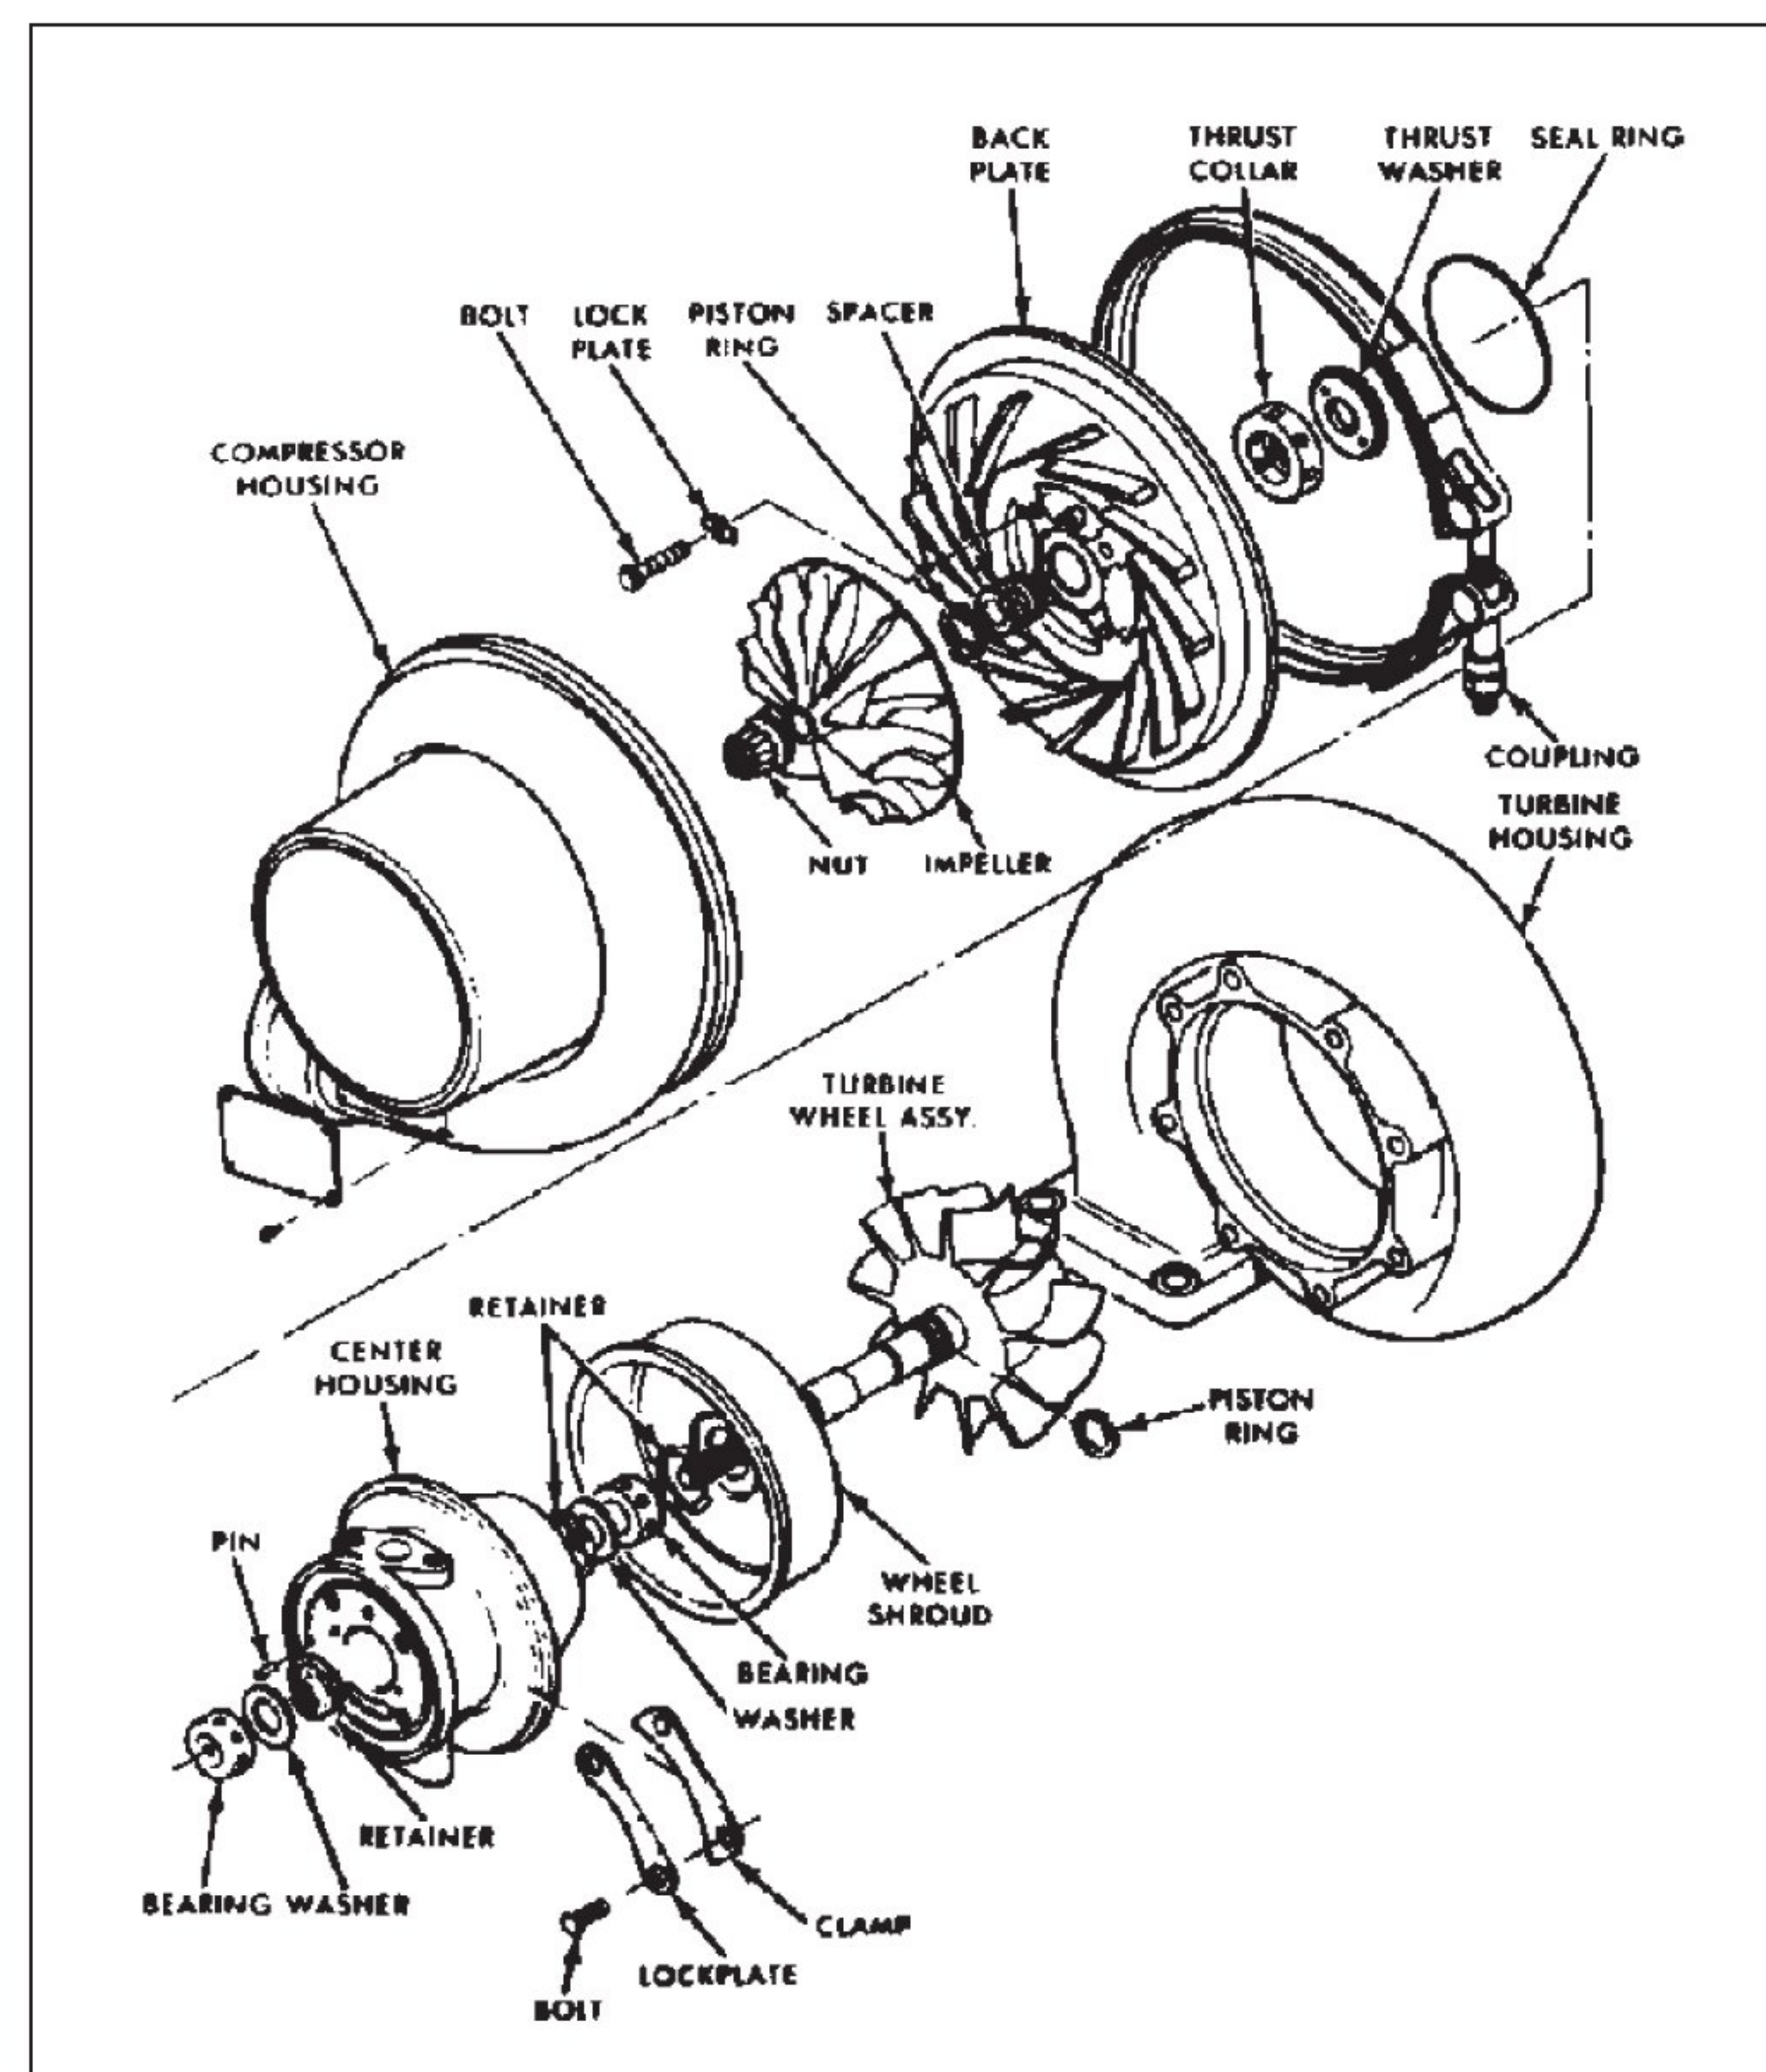


Figure 7: Turbocharger Detail

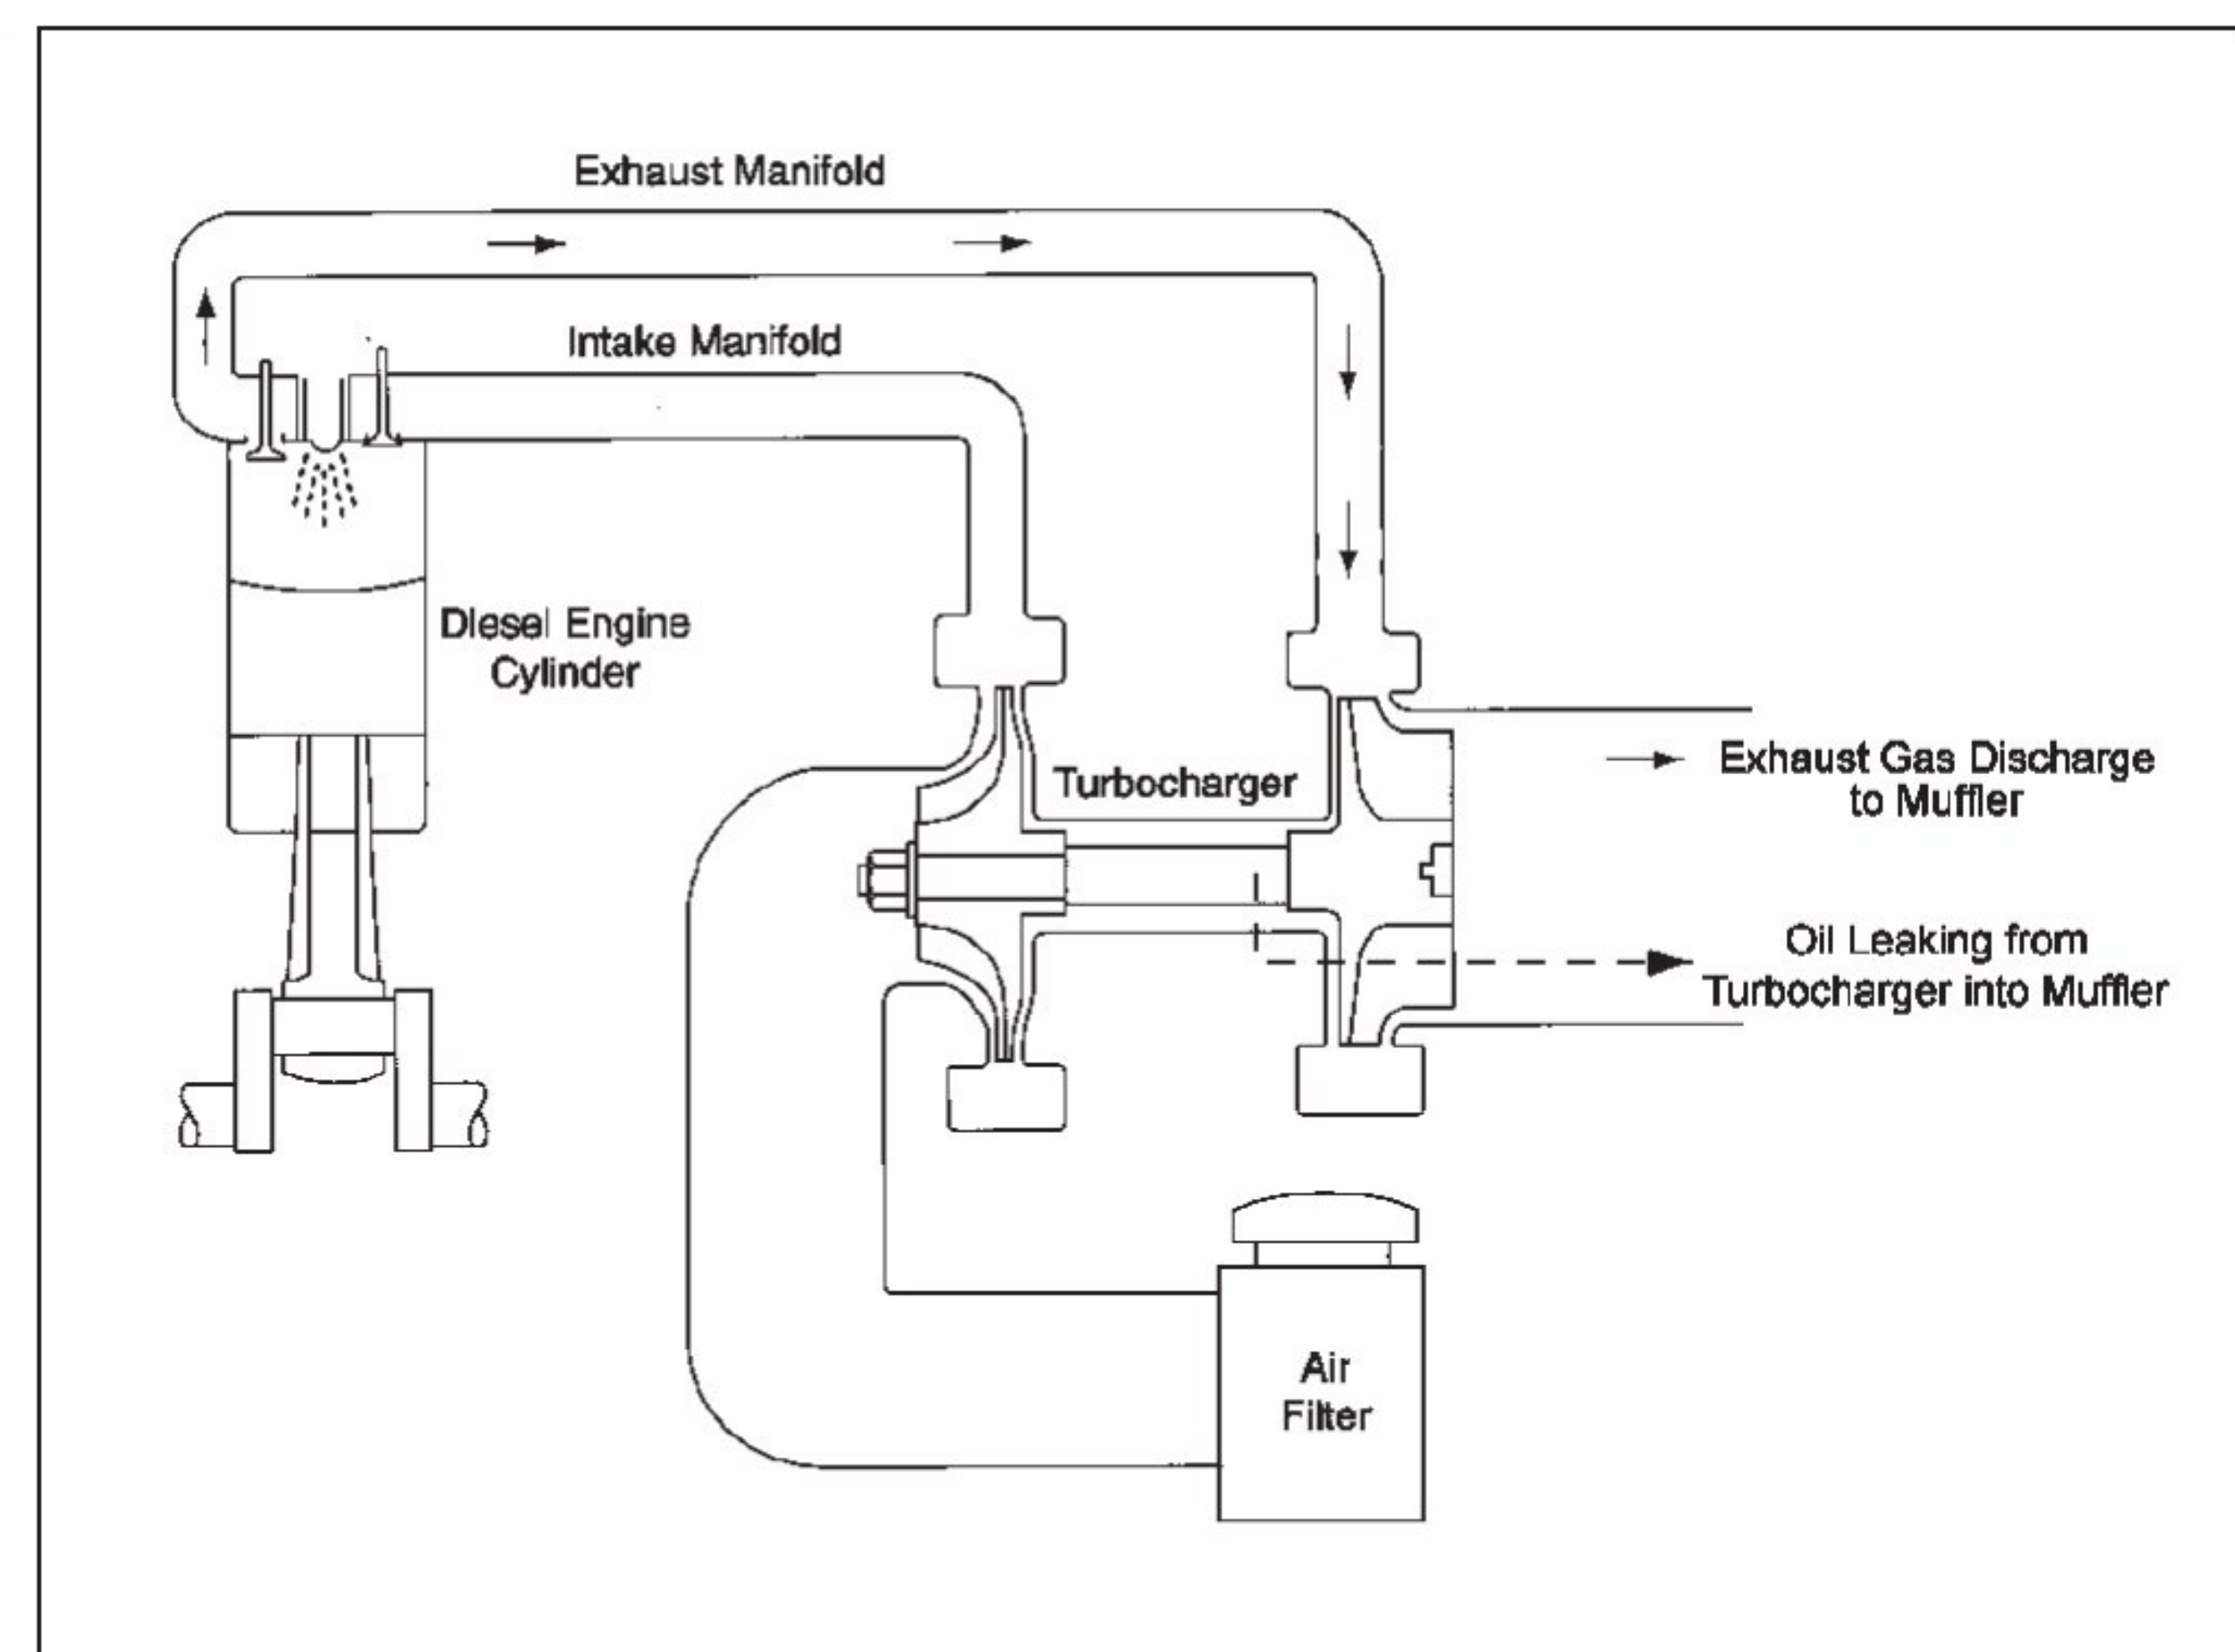


Figure 8: Typical Turbocharger/Intake/Exhaust Schematic

used to detect the onset of an internal turbocharger failure. If the turbocharger has experienced an internal failure the performance of the engine is compromised. Specifically, blue smoke, due to oil consumption along with reduced engine torque will be noticed. Also a specific oil leak, from the waste gate pivot point, can be observed (Photo 14). Once oil has begun to leak from this point on the tur-



Photo 14: Waste Gate Pivot, Series 60

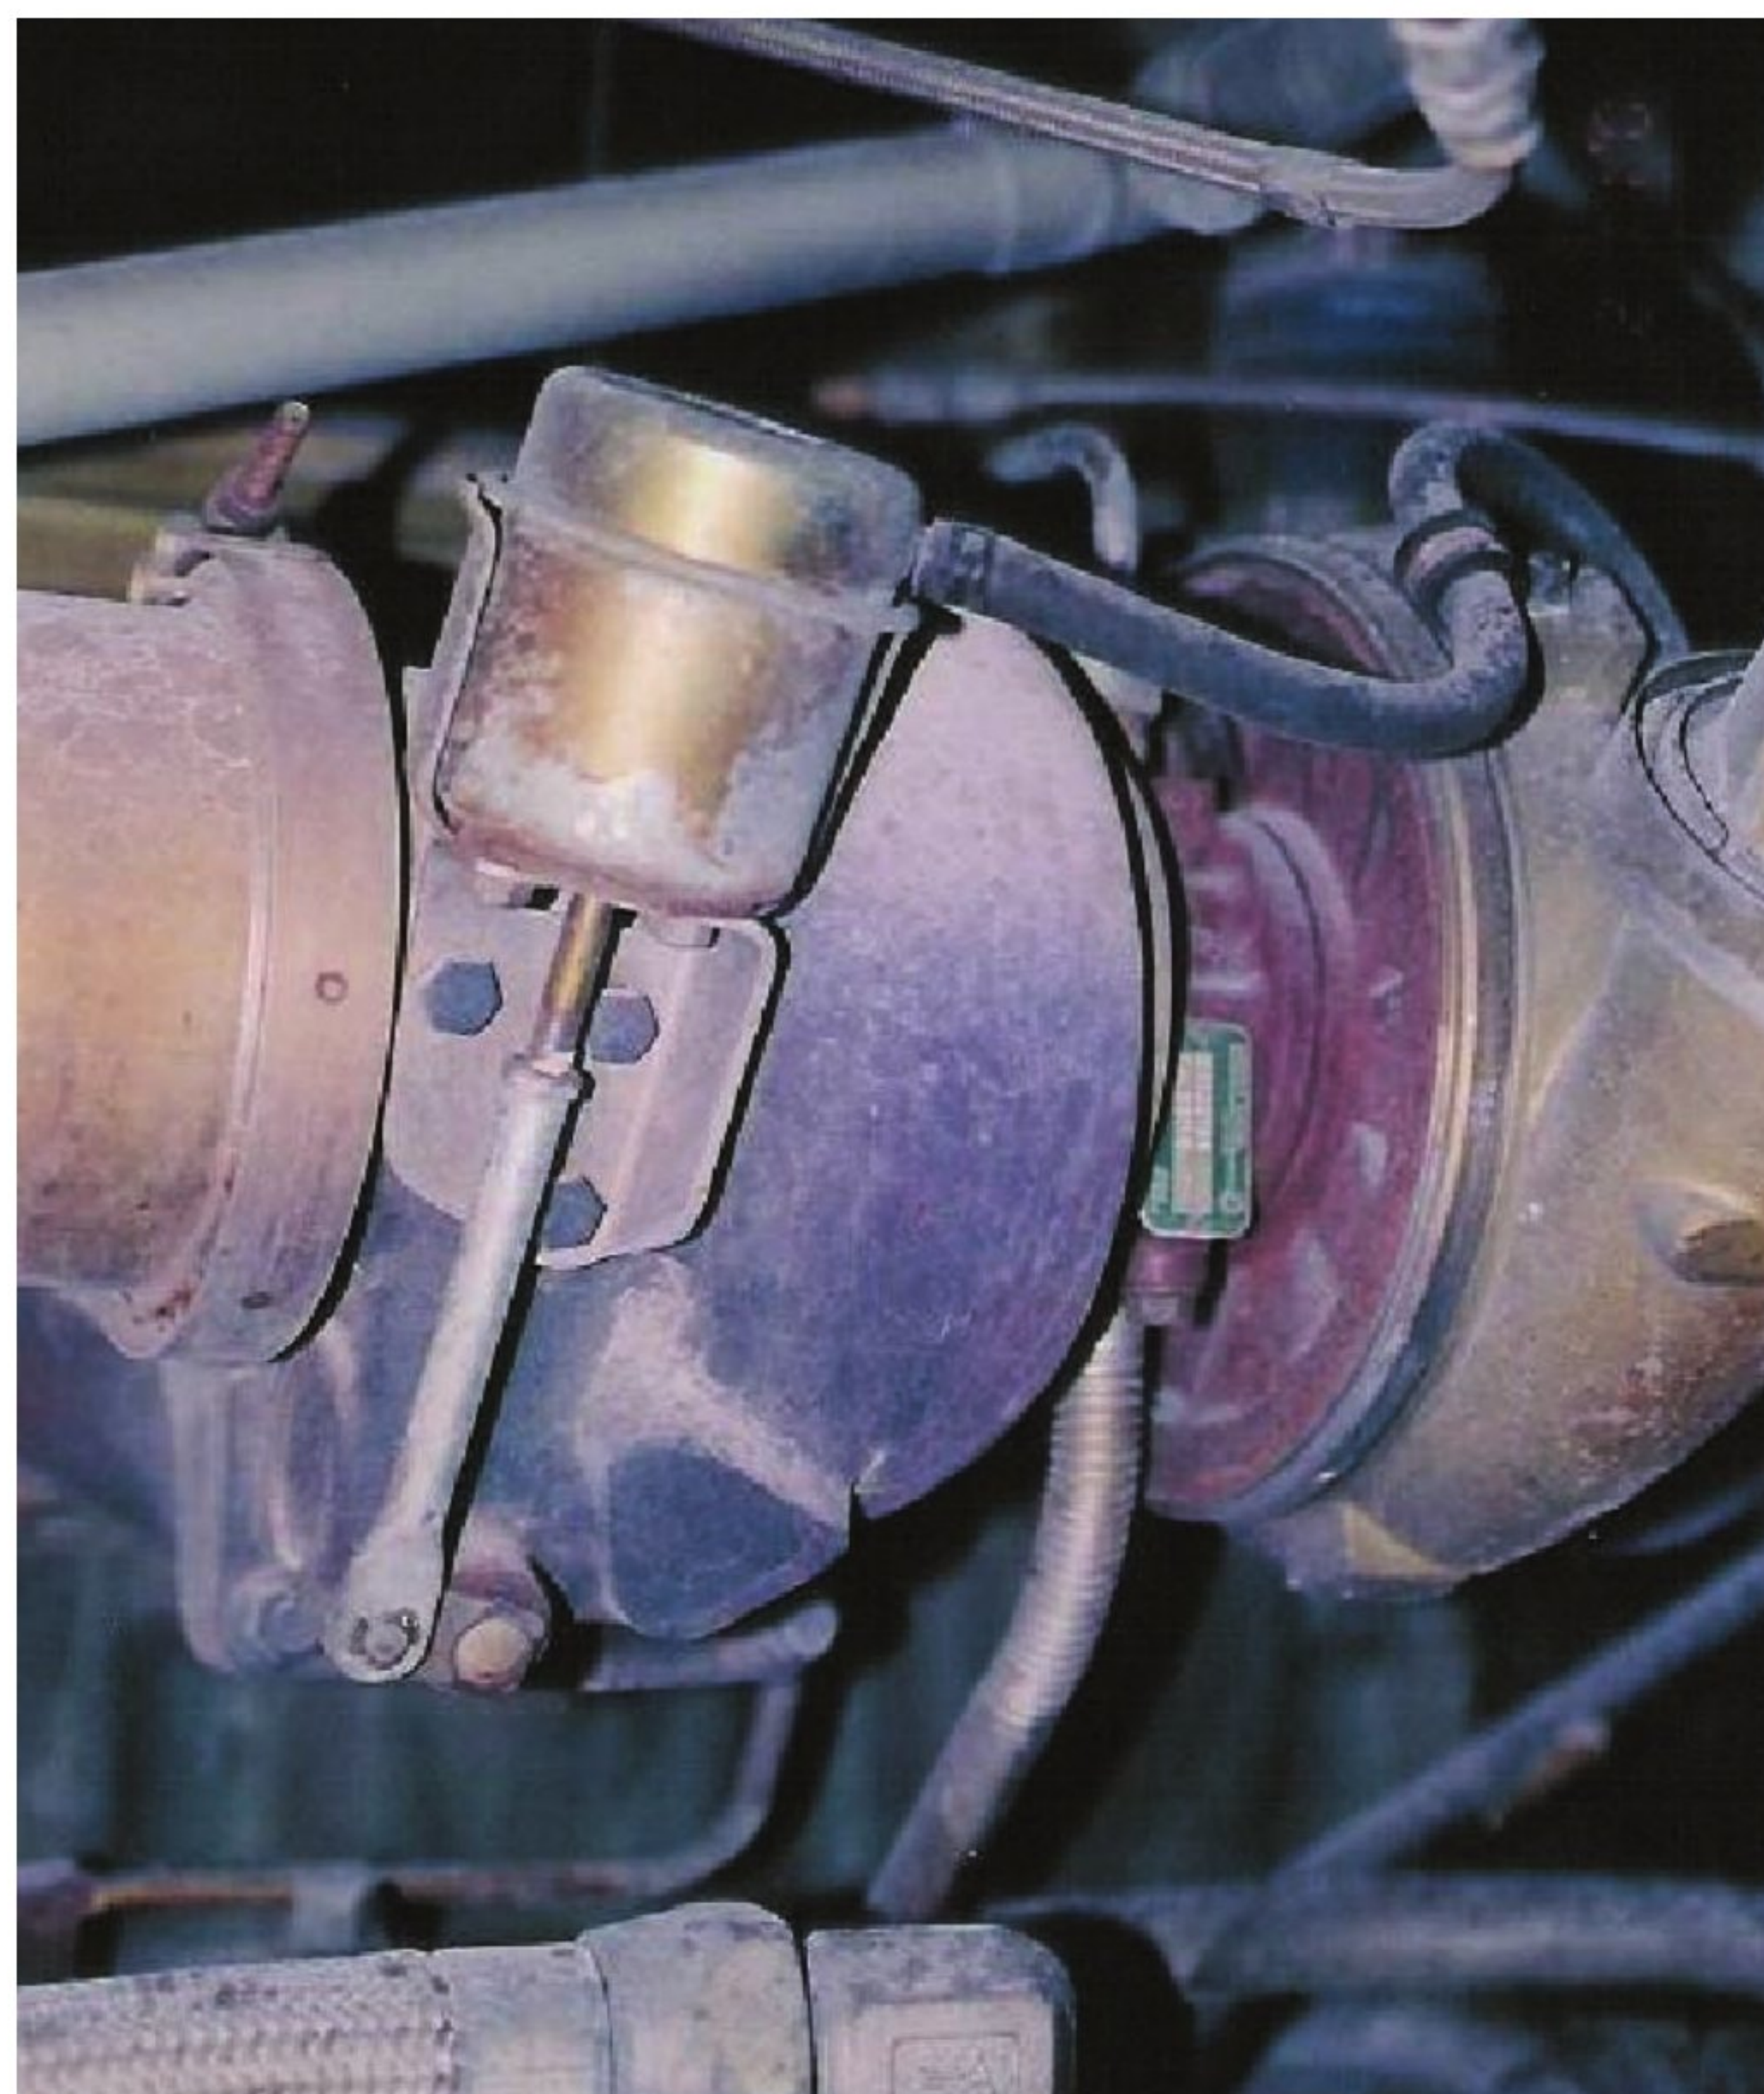


Photo 15: Waste Gate, Series 60

bocharger it should be removed from service and the exhaust system should be thoroughly cleaned. To assist in preventing this failure mode; the turbocharger waste gate or variable geometry function (V.G.T.) must be confirmed. Additionally, the shaft free play, both axially and radially, must be inspected by a mechanic.

To confirm the function of the waste gate (Photo 15), apply regulated air pressure to the boost line (20-30 psi) to exercise the waste gate slave cylinder. To confirm the V.G.T. function (Photo 16), turn on the vehicles' ignition to "on" and observe the slave cylinder motion.

If there is no motion for either system upon these diagnostic tests, they are defective and must be replaced/repared. These two systems regulate turbocharger boost pressure. If they were to fail to regulate this pressure, it may lead to an internal failure thus leading to a fire.

External Turbocharger Oil Lines: With the Detroit Diesel Series 92 application, there is only one external oil line. The oil supply line is positioned on top of the turbocharger and must be inspected periodically for leaks (Photo 17).

With most 4-stroke inline engine applications, the turbocharger has two oil lines which need to be periodically

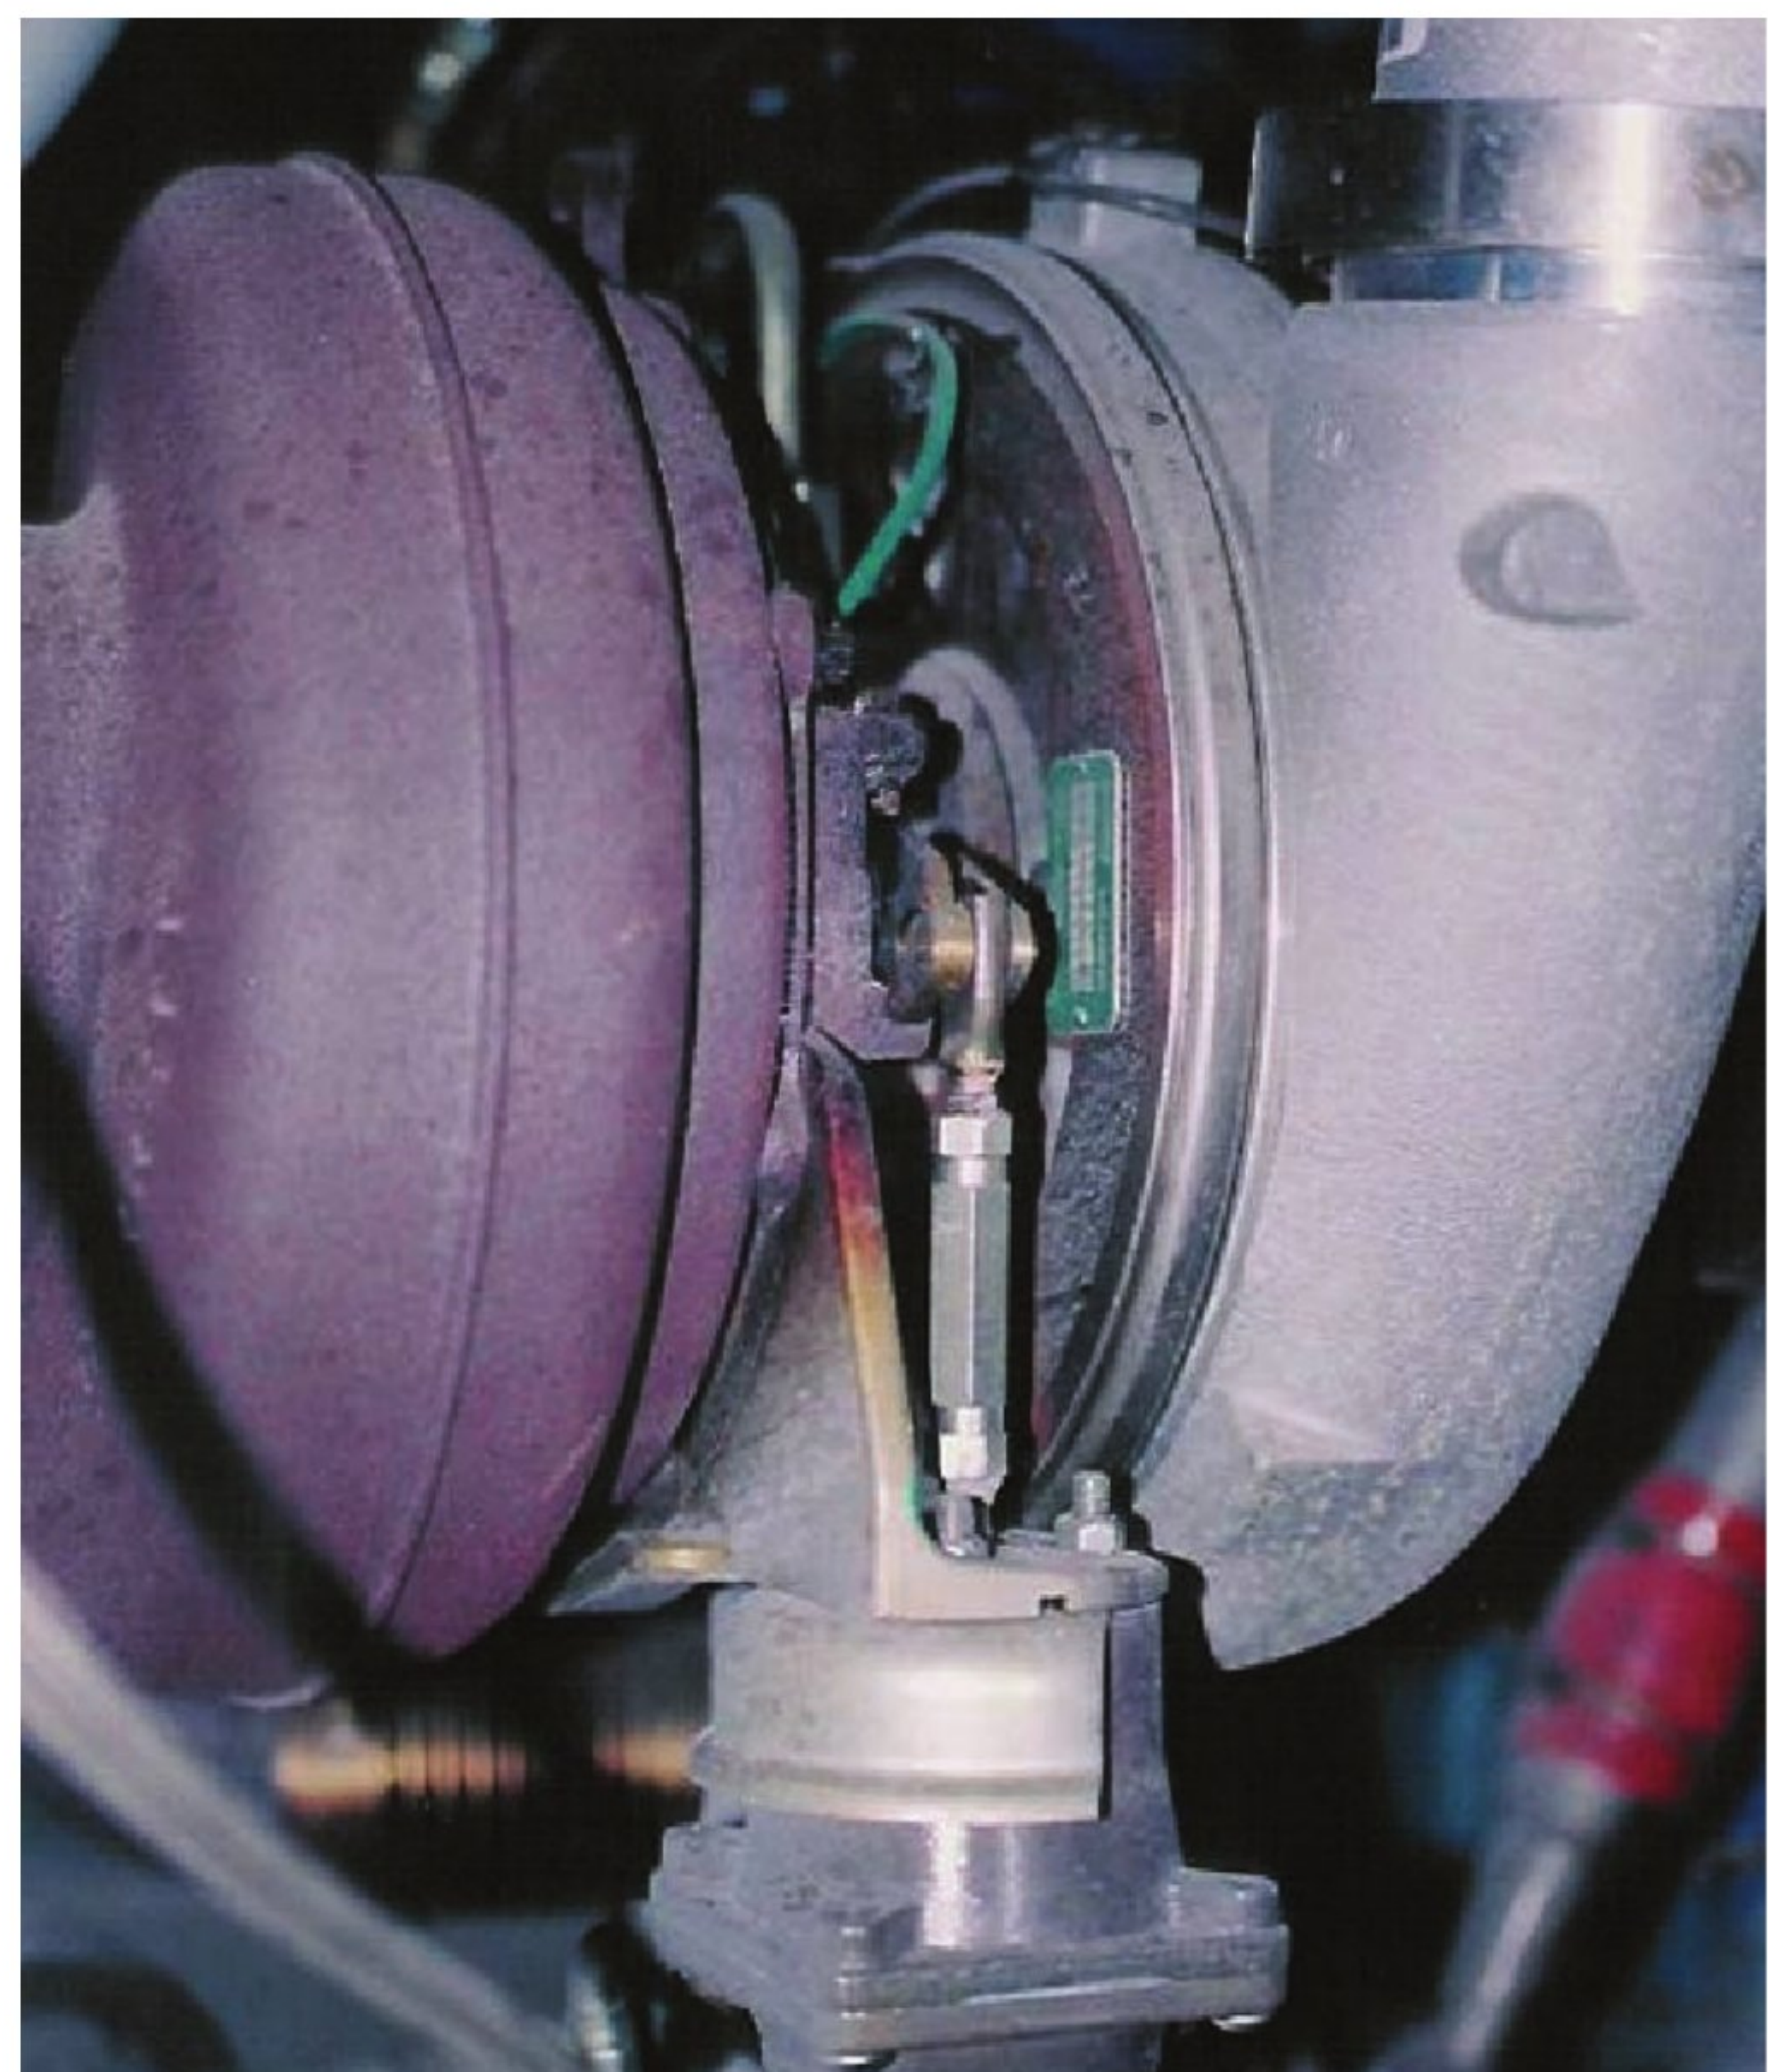


Photo 16: V.G.T., Series 60

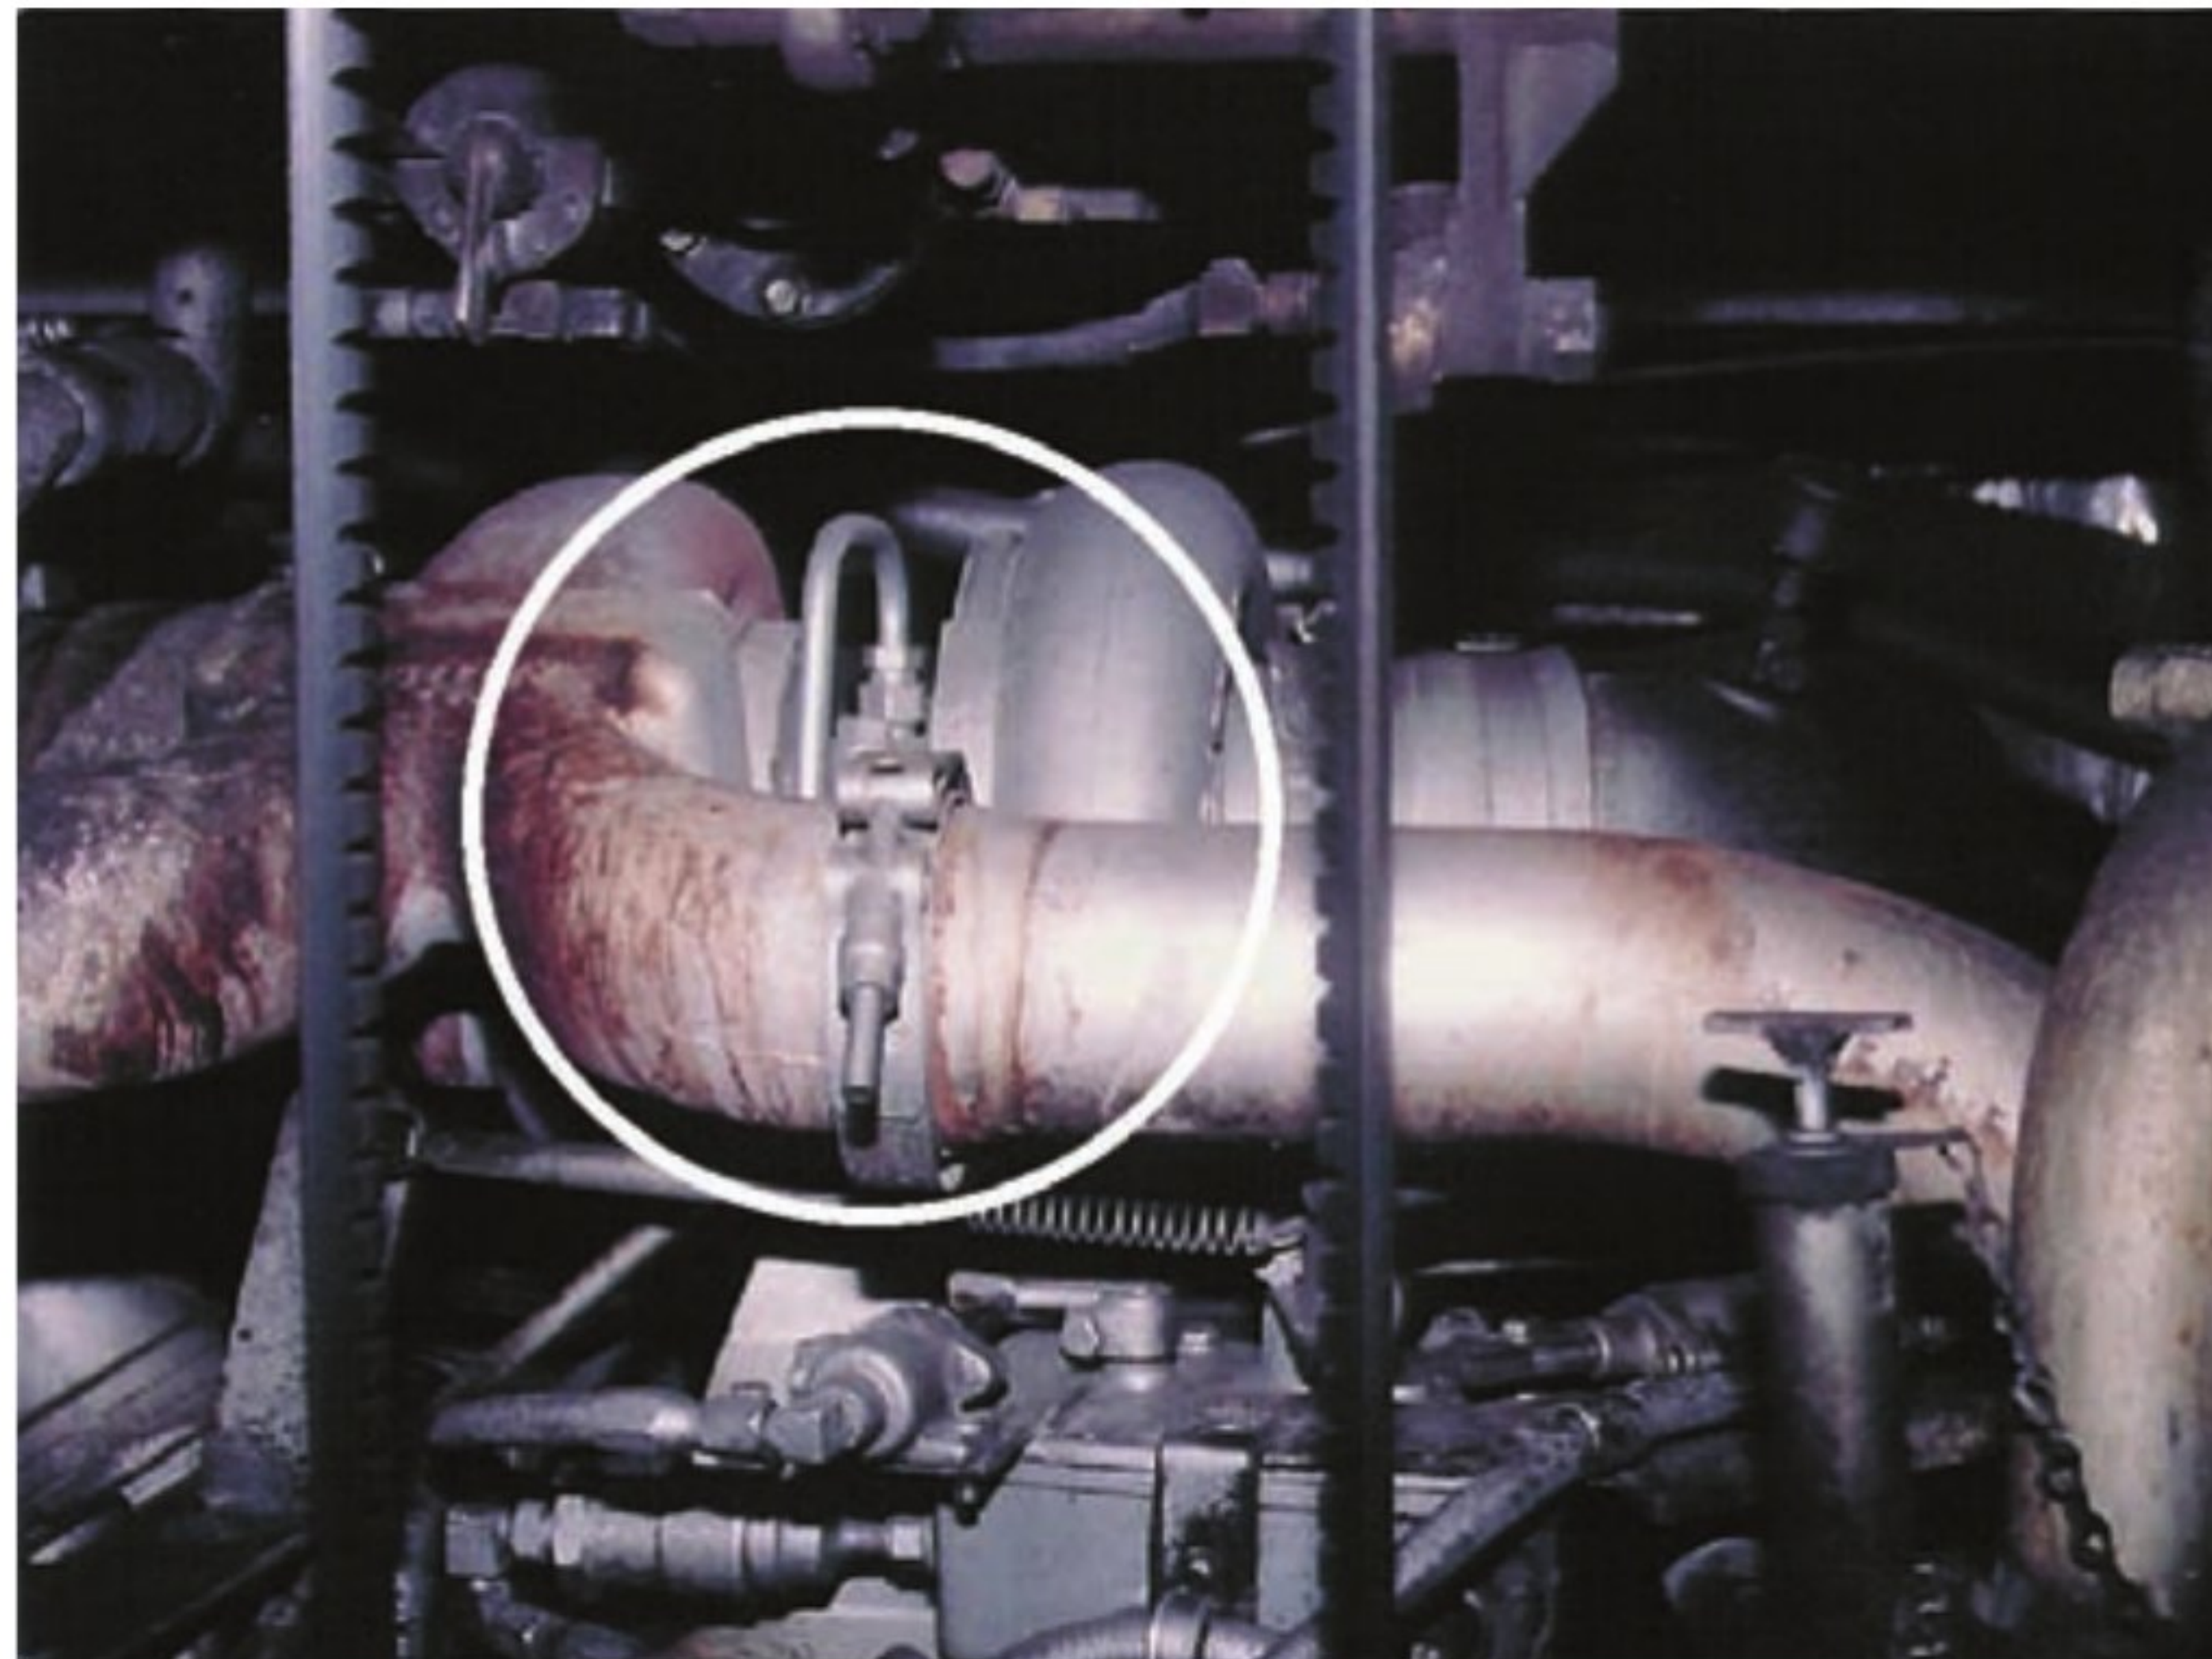


Photo 17: Turbocharger Oil Inlet Line, Series 92

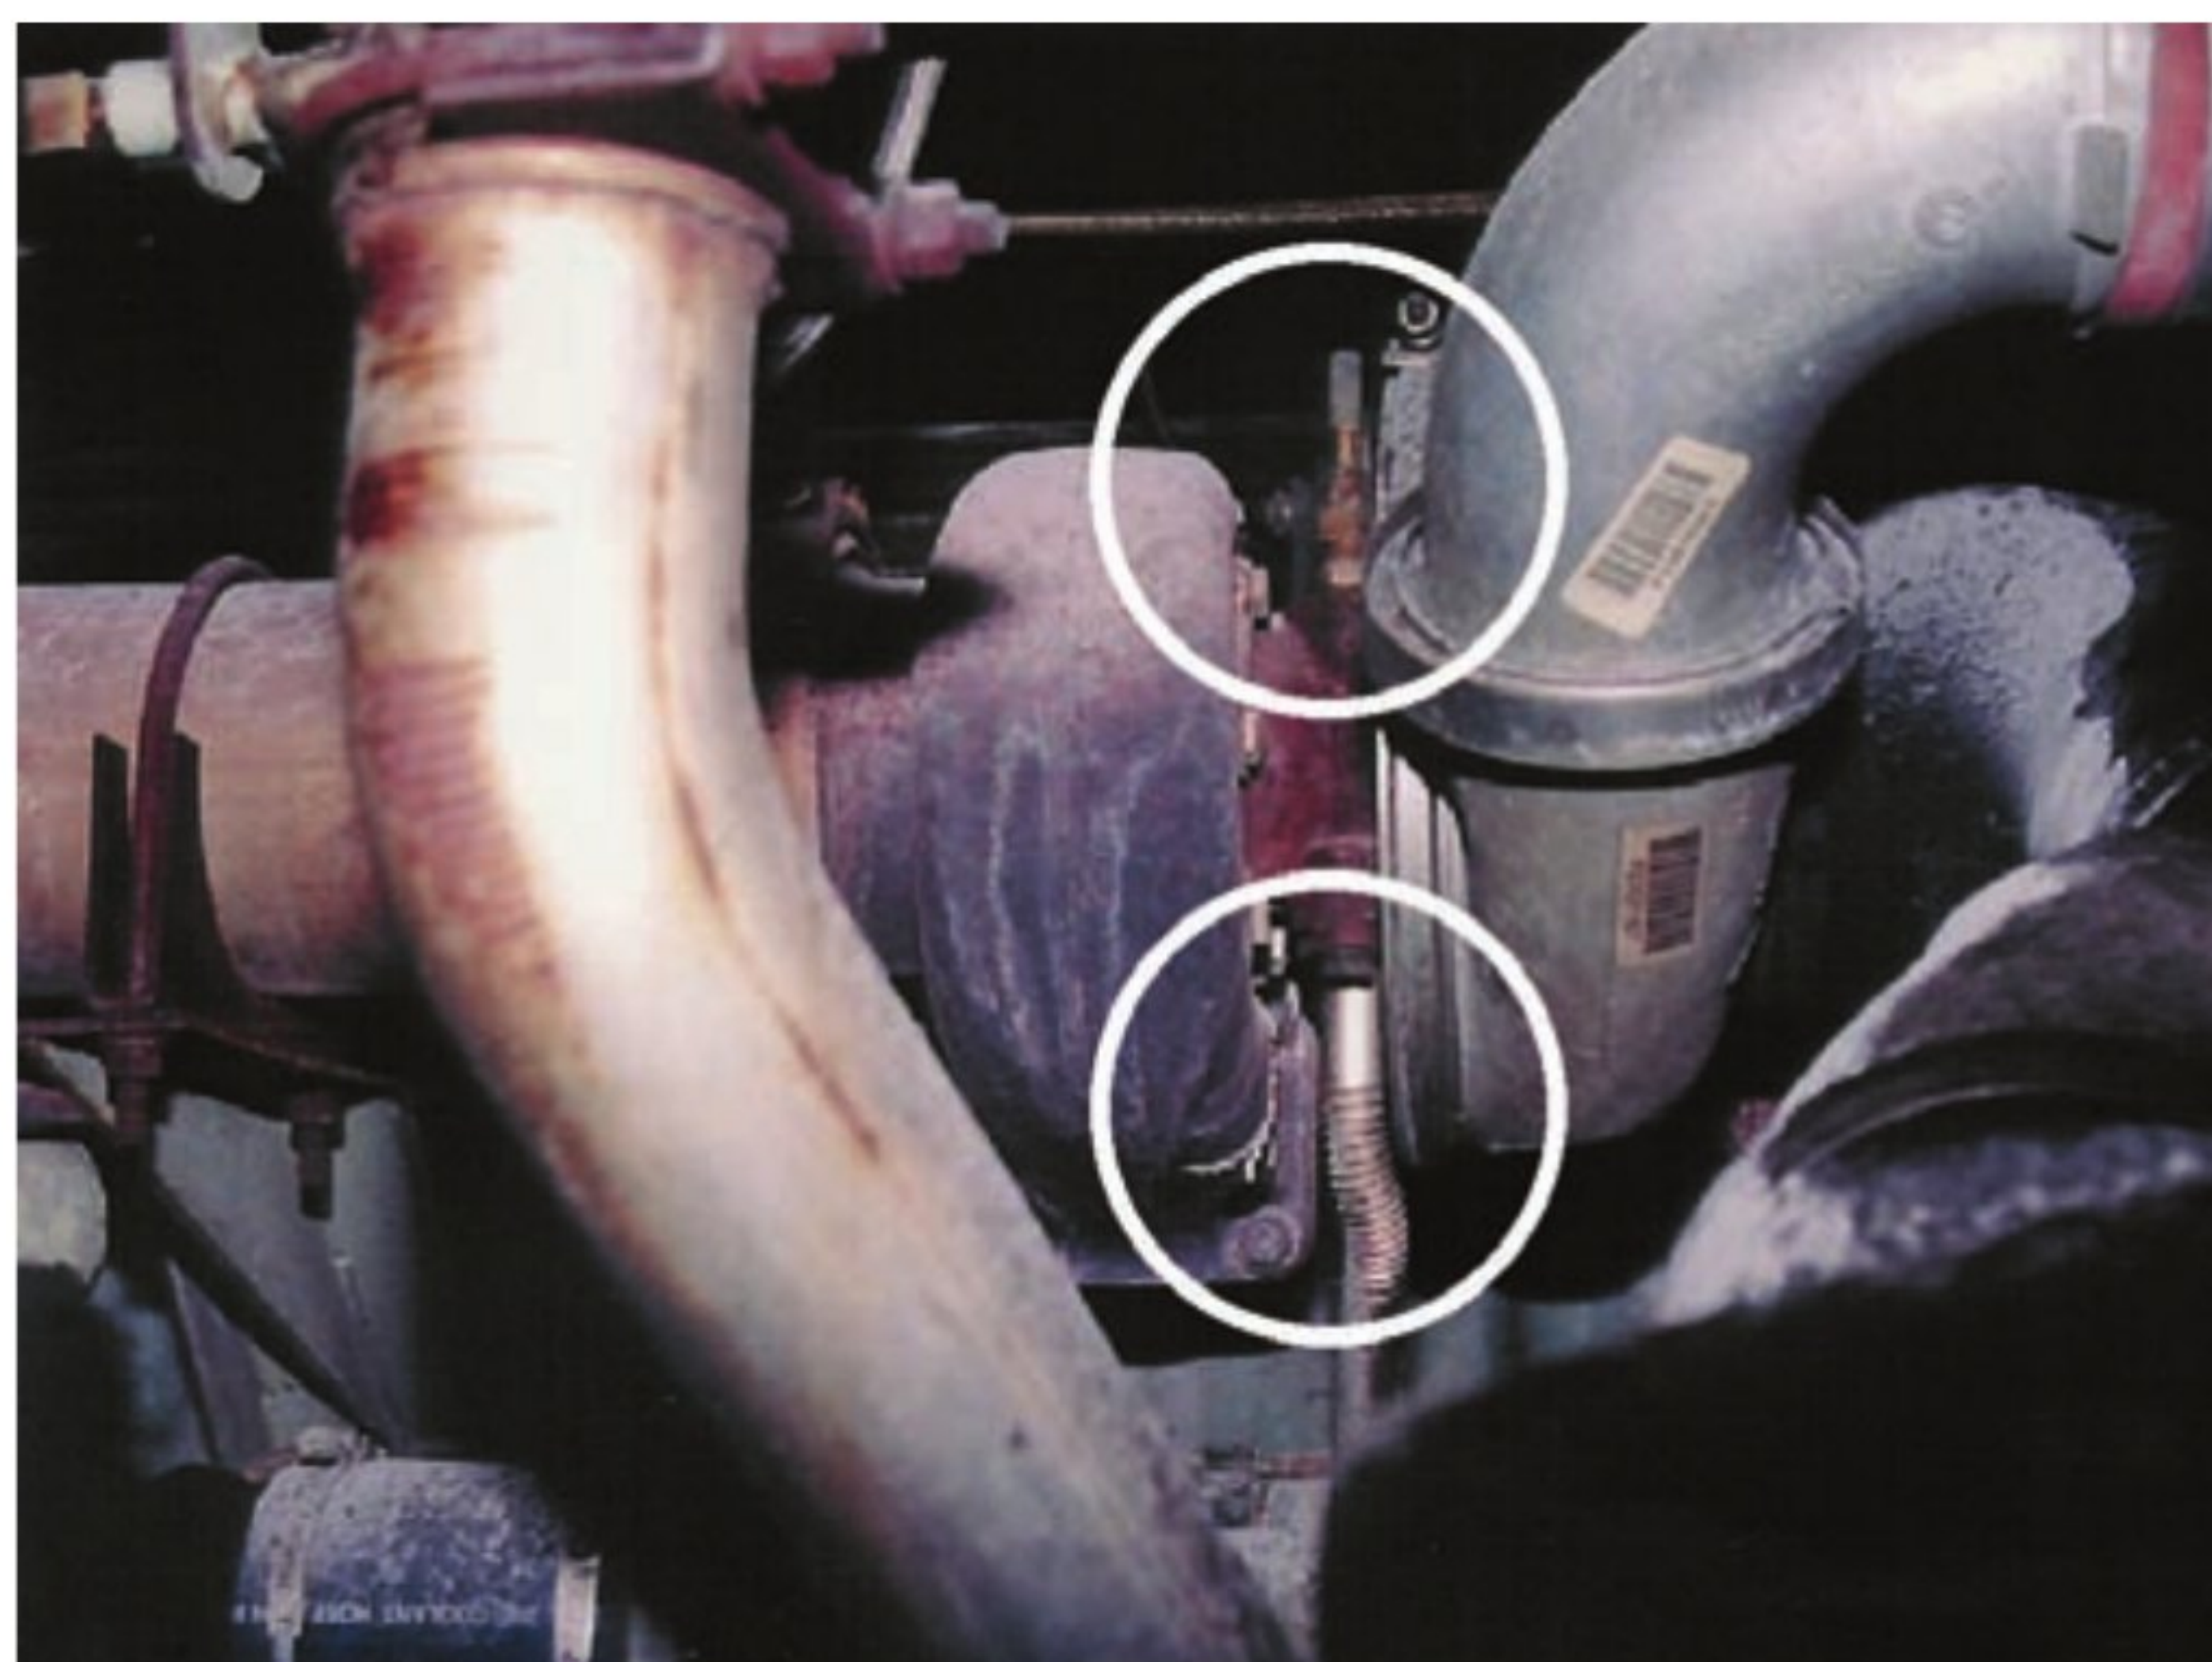


Photo 18: Turbocharger Oil Inlet and Outlet Line, Series 60

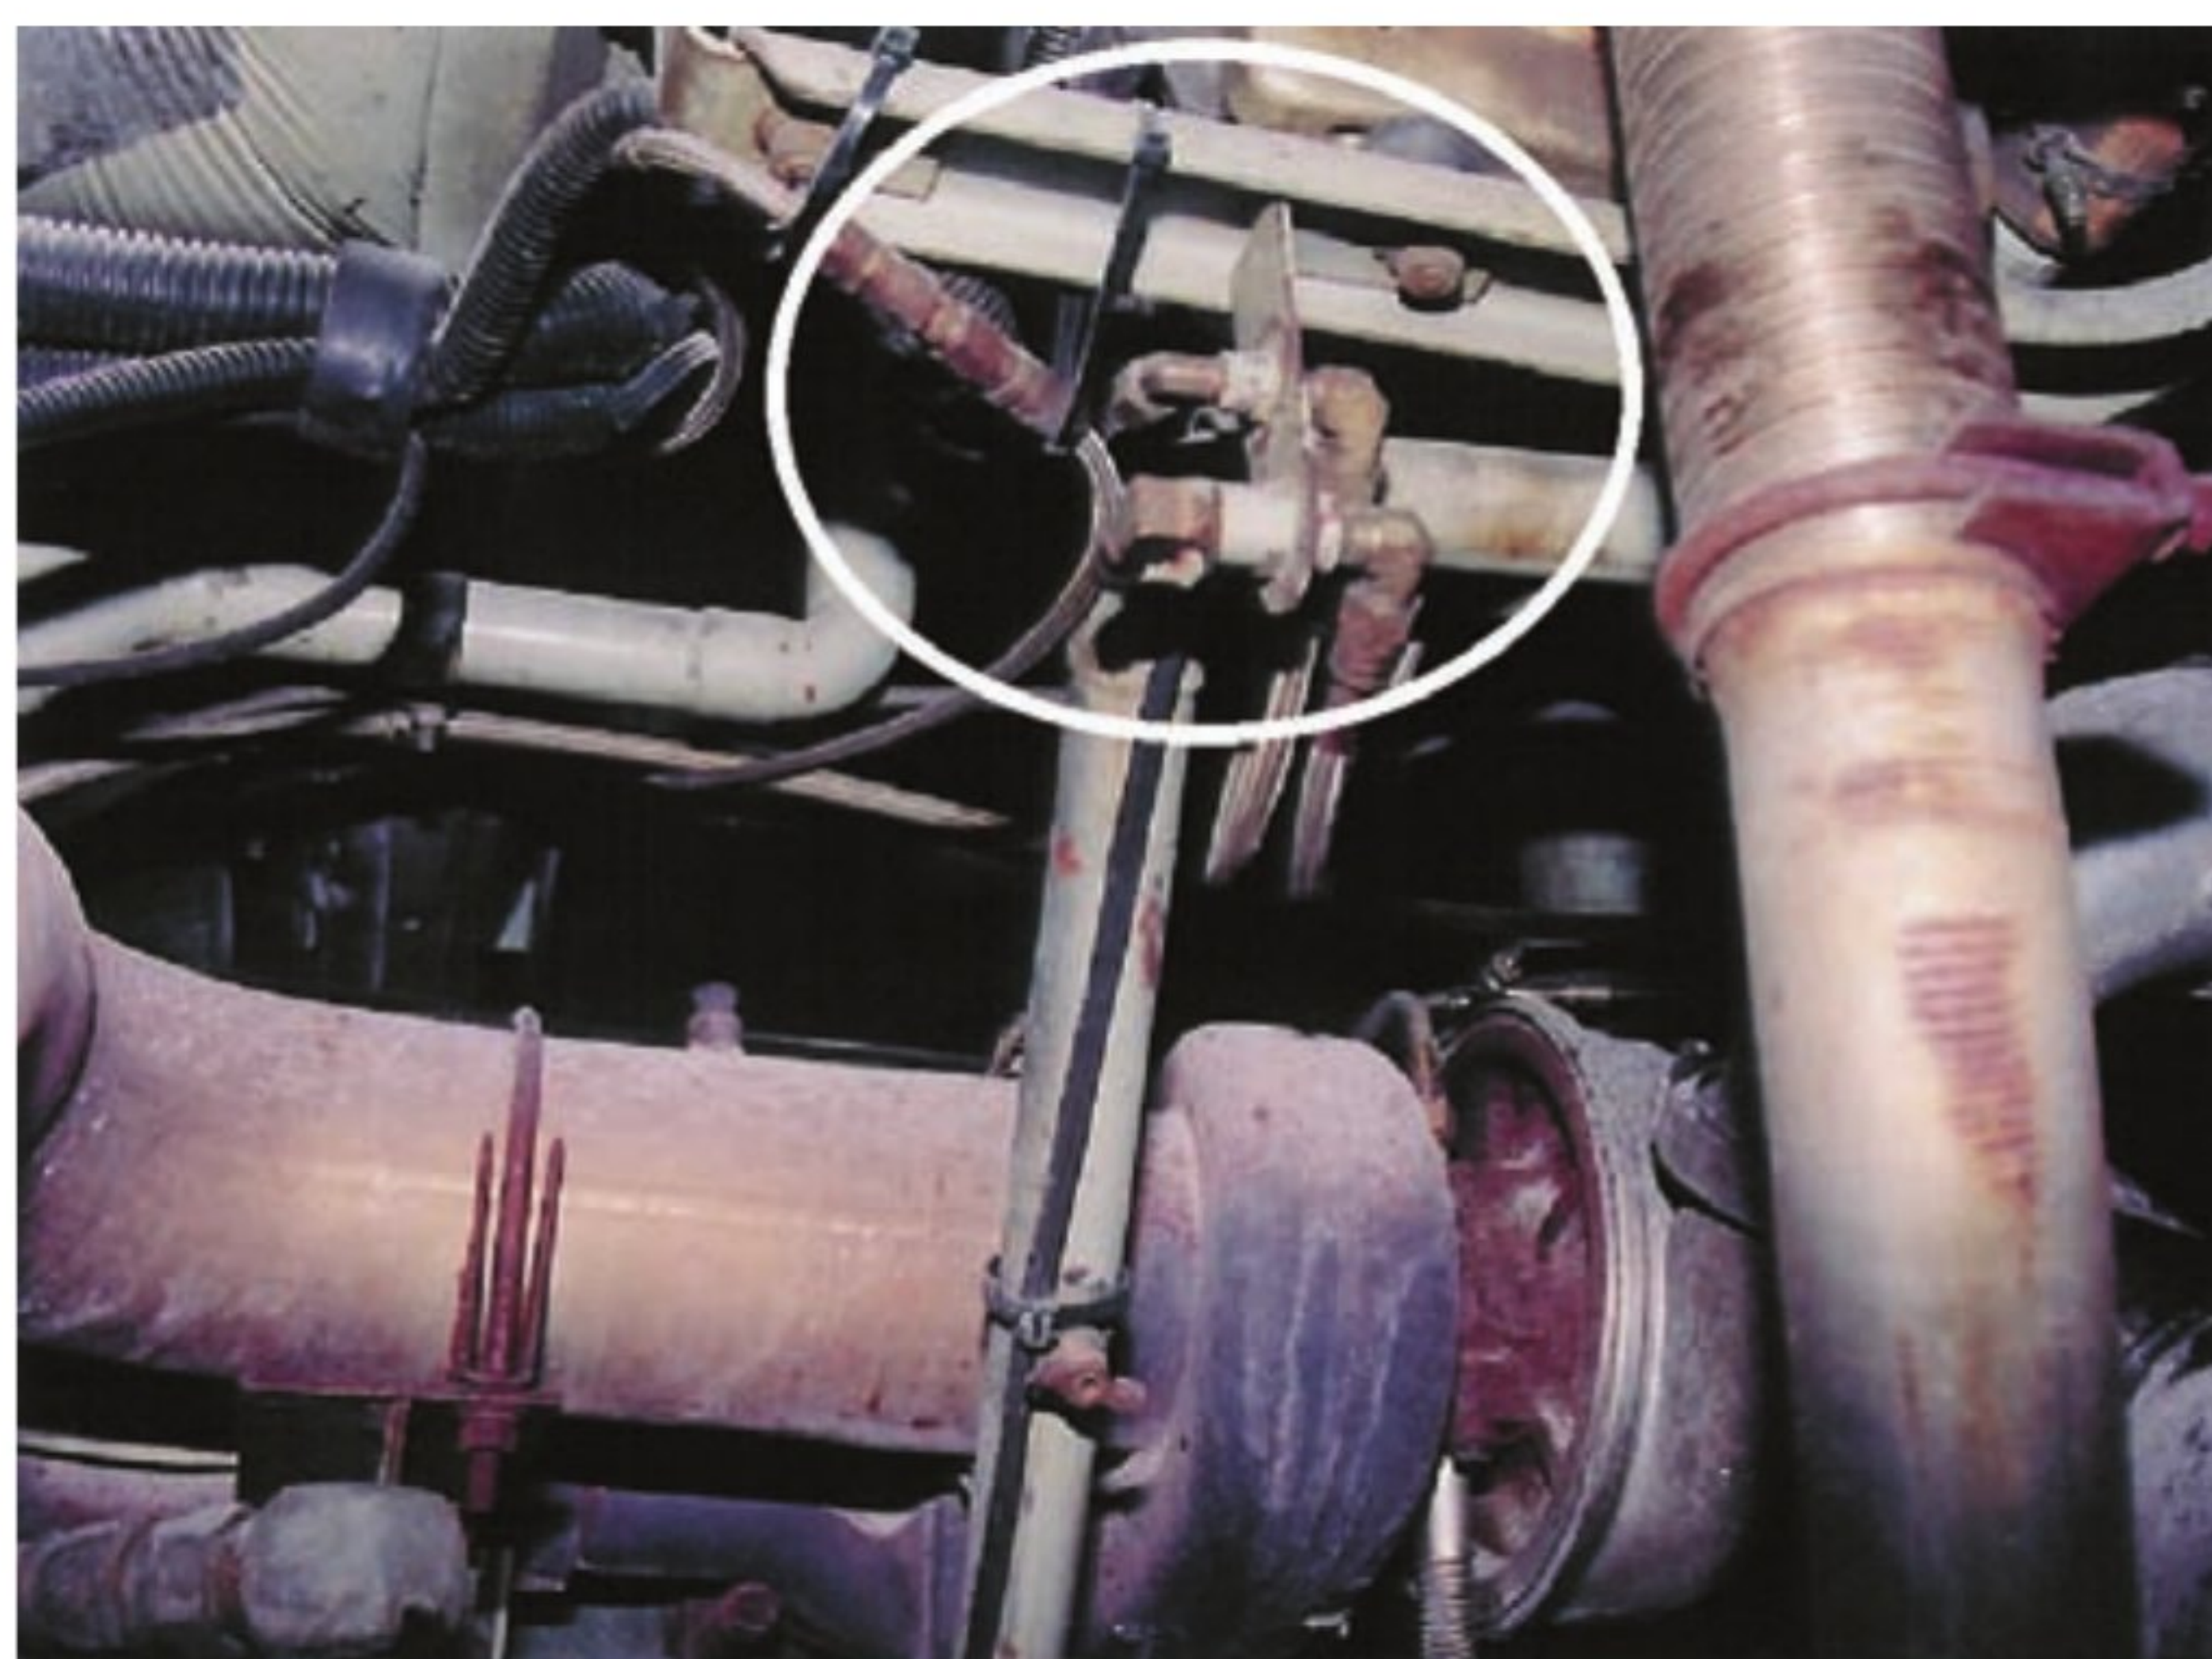


Photo 19: Looped Fuel Lines, Auxiliary Heater

inspected (Photo 18). These turbochargers have an external supply and return oil line. In either case, a leaking oil line must be repaired to prevent an auto-ignition fire.

Sensors: In most applications there are sensors which are exposed to either fuel, engine oil, transmission fluid and hydraulic oil, to name a few. These sensors are typically diaphragm type; that is to say, an internal diaphragm is moved by the fluid pressure inside the sensor/switch. Since pressurized fluid enters these sensors/switches it is vital that they be periodically inspected for leaks. Based on their position on the engine/transmission they may become a source for a combustible material which may come in contact with an ignition source and initiate a fire.

Auxiliary Heaters: Also known as diesel furnaces, auxiliary heaters heat the onboard coolant when the engine is not running. However since it is a furnace which burns diesel as fuel it must be periodically inspected for function, control and integrity. Specifically, its cycle time and control must be verified to assure it is functioning when it should be, as well as, turning off when commanded. Additionally, the fuel lines must be inspected to confirm there are no leaks. In fact, in the summer months it is good practice to disconnect the heater function power supply and loop the supply and return fuel lines together (Photo 19). This will assure that fuel does not leak from the furnace itself when not in service. It should be pointed out that the heaters' exhaust pipe (Photo 20), within minutes of heater activation, reaches 375°F and continues to climb approaching the auto-ignition temperature of most of the vehicles fluids. Therefore, it is vital that

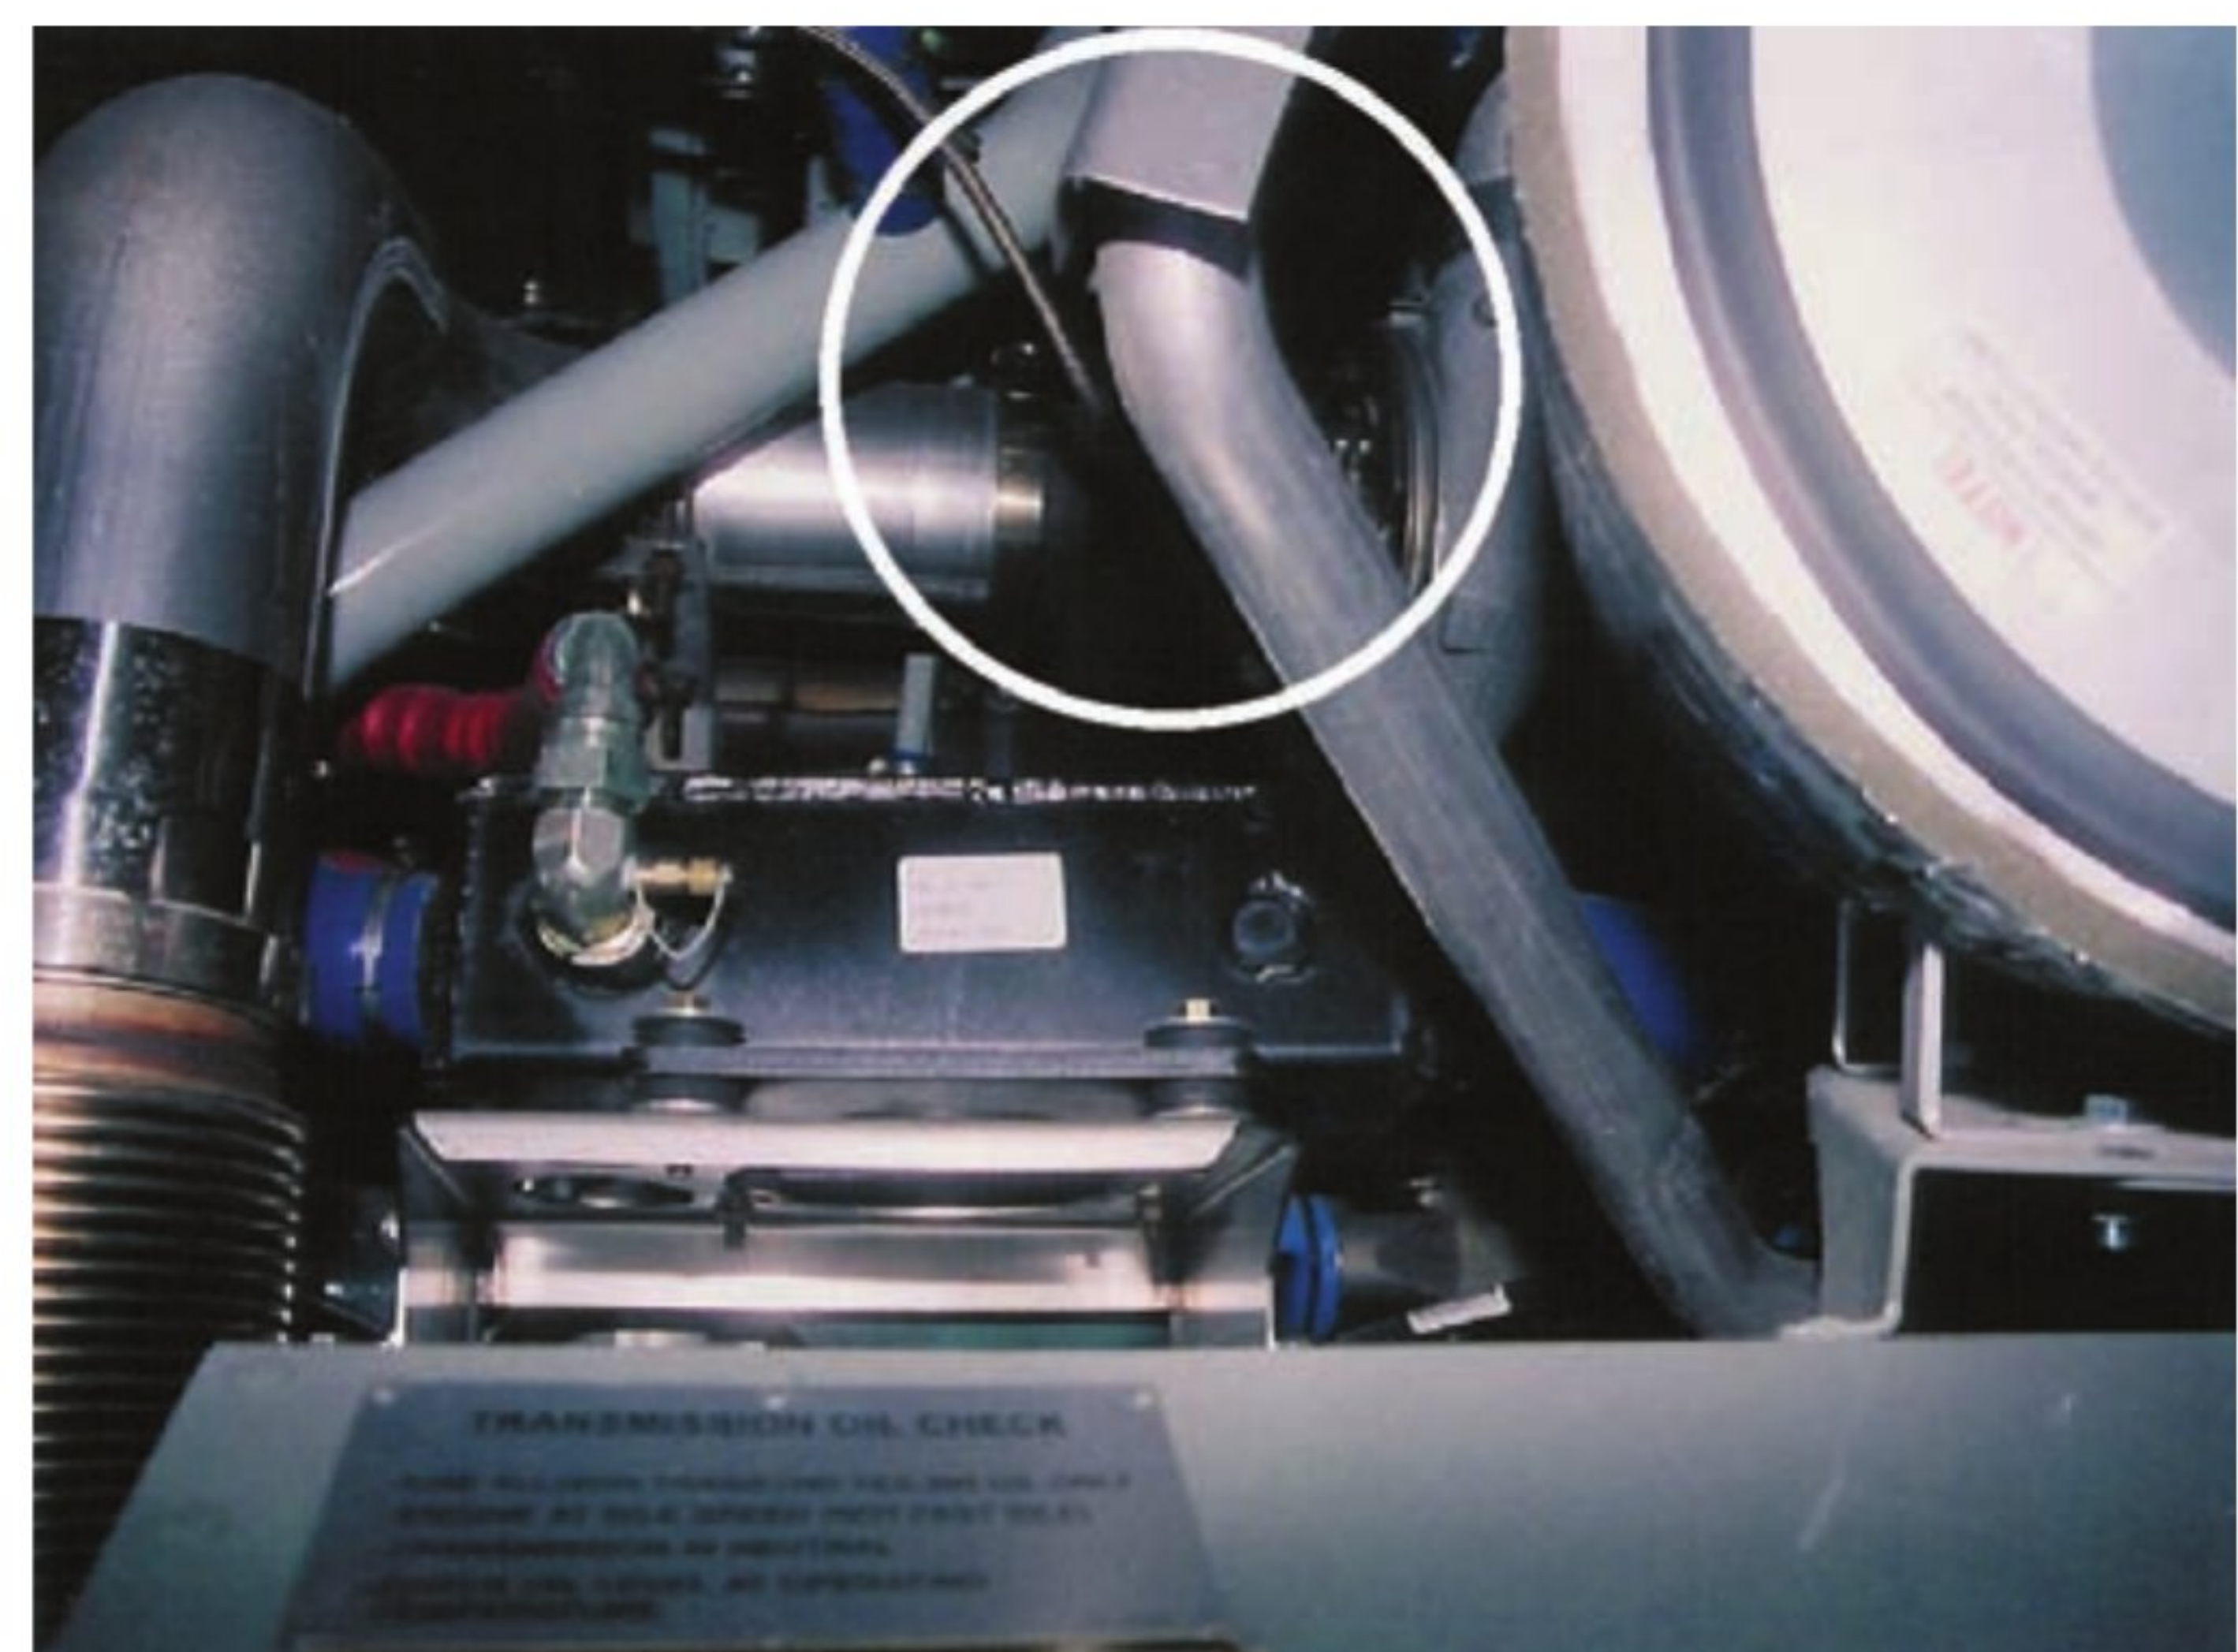


Photo 20: Auxiliary Heater Exhaust Pipe

any leak, of any fluid in this area, be immediately repaired to minimize high temperature contact and subsequent fire.

2007 Emissions Schemes: At the time of this publication, very few 2007 engines with regeneration capability are in the stream of commerce. However, the design suggests regenerating (cleaning) the particulate trap by elevating its temperature to burn off the material trapped inside.⁵ In order to do this the engine must create exhaust gases with high enough temperatures to complete this process. In some designs, during regeneration, raw fuel is injected near the turbocharger, via a doser, increasing the temperature of the exhaust gases to 1200°F. As with any other component, with a high (>430°F) surface temperature, leaks in the immediate area must be repaired to avoid contact with this system while it is regenerating the particulate trap. Lastly, this systems' interlocks, which dictate when it can function, must be confirmed to be working to avoid a cycle of regeneration at a time or location which is undesirable.

Additional Ignition Sources: Additional body related ignition sources are:

- evaporator motor(s)
- condenser motor(s)
- defroster motor(s)
- A/C compressor clutch coil/wires
- VCR systems
- P.A. systems/ radio
- G.P.S. systems

These systems must be inspected periodically for proper wire/cable routing and support along with proper ground connections and insulation. Usually not a leading fire cause, they must be as vigilantly inspected as any other component on the vehicle.

CONCLUDING REMARKS

The purpose of this paper is to bring to the attention of manufacturers, owners, operators and mechanics that methods are available which can mitigate this type of accident. An inspection list has been provided (see Appendix C) to further assist the reader in preventing motorcoach fires. This list of items can be included in a *Preventative, Periodic and Annual Maintenance Inspection Program*. Additionally, some of the inspection items may be incorporated into a daily driver (pre/post trip) inspection.

Furthermore, it is to assist the investigator in conducting fire cause and origin analysis of motorcoaches, transit and school buses involved in this type of occurrence as well as to show the mechanical finger prints which are associated with it.

REFERENCES

- 1). Ferrone, C.W., "Only You Can Prevent Motorcoach Fires," Bus Ride Magazine, August, 2005.
- 2). Ferrone, C.W., "Hub Maintenance Ensures Hub Retention," Bus Ride Magazine, November, 2005
- 3). Bridgestone Commercial Tires (Tire, M.D.)
- 4). Detroit Diesel Corporation; S-60 Burst Logic Safety Recall, NHTSA-06E-019, DDC: 06C-4.
- 5). Detroit Diesel Corporation; "Introducing the New 2007 Series 60"; brochure and DVD, PT1M, 6SA2000 (0604), PT3M, 6SA2004 (0603).

APPENDIX A

Surface Temperatures in F°/C°

Ambient Temperature (85F°)

Disc Brake Rotor	420° / 215°	MCI DL-3
Drive Axle Hub	150° / 65°	MCI DL-3
Steering Axle Hub	137° / 58°	MCI DL-3
Tag Axle Hub	166° / 74°	MCI DL-3
Turbocharger [hot]	607° / 319°	DDC S-60
Turbocharger [cold]	198° / 92°	DDC S-60
Exhaust Manifold	390° / 198°	DDC S-60
Exhaust at Turbocharger Inlet	585° / 307°	DDC S-60
EGR	261° / 127°	DDC S-60
Engine Block [side]	232° / 111°	DDC S-60
Transmission Housing	198° / 92°	Allison B-500

Note: These are examples only and are not meant to represent all temperatures found on a motorcoach, transit or school bus.

APPENDIX B

Auto-Ignition Temperatures in F°/C°

On Board Fluids

Diesel Fuel	446° / 230°
Power Steering	417° / 213°
Engine Oil	449° / 231°
Transmission Fluid	417° / 213°
Coolant (50/50)	903° / 483°
Hub/Gear Oil	428° / 220°
Tires (smoldering)	450-500° / 232°-260°


Note: These are examples only and are not meant to represent all types and varieties of fluids found on a motorcoach, transit or school bus.

APPENDIX C




Preventative, Periodic, Annual and Daily (Pre/Post Trip) Maintenance and Inspection Items

- B+ Cable at alternator secure (stud, bracket and clamps in position)
- Alternator oil lines and rear cover plate secure and not leaking
- All alternator electrical studs covered with rubber boots
- Remote Jump Post secure and stud covered with rubber boot
- Starter cables secure and routed properly
- Bulkhead connection for B+ cables (starter and alternator) secure
- Engine compartment clean/dry of fluids
- Engine and Transmission fluid connections/hoses secure and not leaking; sensors not leaking
- No leaks dripping onto pavement
- Hub-Caps; no visible leaks, rubber plug in place, sight glass is clear, oil at proper level
- Oil seals are in good condition, no leaks (only observable from under vehicle)
- Disc brake rotors (if visible) clean with no bluing
- Dual tires not making contact with each other
- Turbocharger oil line(s) not leaking, waste gate pivot pin not leaking oil
- Exhaust system; no oil exiting from muffler, no excessive blue smoke (turbocharger oil consumption)
- Engine has appropriate performance (torque)
- Auxiliary heater not leaking fuel
- No active / Illuminated A.B.S. dash light*

*The illumination of this light could indicate the potential onset of a loose wheel bearing, hub run-out, wheel bearing failure or a skidding or locked tire/wheel.

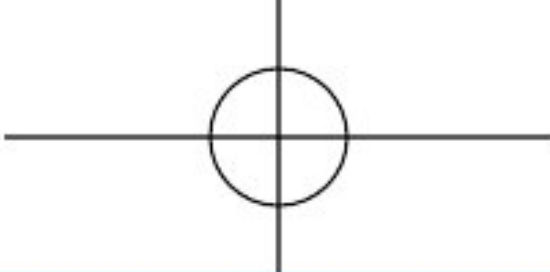

special report • special report • special report • special report • special report • special report

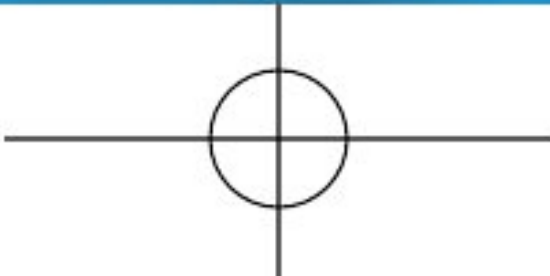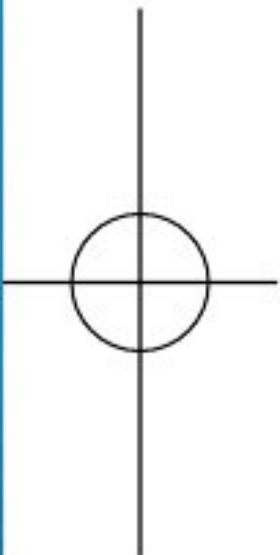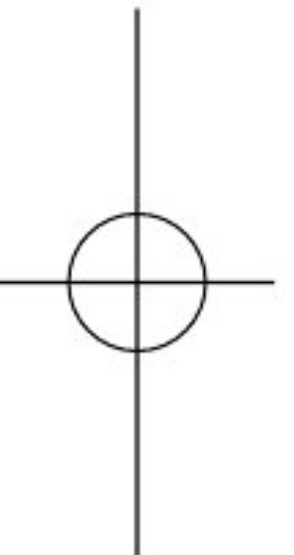

ABOUT THE AUTHOR

Christopher W. Ferrone
President, Americoach Systems, Inc.
Glenview , Illinois

Chris is President of Americoach Systems, Inc. located in Glenview Illinois. He received his degree in Mechanical Engineering from the University of Wisconsin – Madison in 1986.

Prior to becoming an engineer, Chris was a mechanic for the Chicago Sightseeing Co.,* a motorcoach company his family has owned and operated for more than 100 years. Since graduating, he has worked in the areas of procurement, vehicle specifications, maintenance and design in an effort to optimize motorcoaches for both safety and performance.

In 1990 Chris was named Vice President of Logistics and Engineering for Chicago Sightseeing. He continues to work for the family business and has more than 30 years experience in the motorcoach and transportation industry.

In 1988 he founded Americoach Systems, Inc. which specializes in transportation technology, management, safety and logistics.

Among his accomplishments Chris holds several U.S. patents in heavy vehicle technology and has been honored with awards such as; The Energy Pioneer Award, for his work with Bio-Diesel (U.S. Dept. of Energy 1995), The Rising Star Award (BusRide Magazine 1998) and Innovative Motorcoach Operator (Metro Magazine 2006).

Chris has been called upon by manufacturers and government to assist in the testing and analysis of automotive products and processes which include; Detroit Diesel, 3M, Citgo Petroleum, Public Transportation Safety, Inc., Zonar Systems, Motorcoach Industries, the U.S. Department of Energy and U.S. Department of Transportation.

Chris has authored over 100 articles and technical papers and is a frequent speaker at the American Bus Association (B.I.S.C.), Trailways National Bus System, the Ontario Motorcoach Association, BusCon, Society of Automotive Engineers and the American Society of Mechanical Engineers.

*Chicago Sightseeing holdings are: American Sightseeing, Gray Line of Chicago, Prairie Trailways, The O'Hare Express and Chicago's Original Trolley Lines



Copyright © 2007 by Christopher W. Ferrone

COMMERCIAL VEHICLE SAFETY ALLIANCE

1101 17th Street, NW, Suite 803 • Washington, DC 20036
Phone: (202) 775-1623 • Fax: (202) 775-1624 • www.cvsa.org