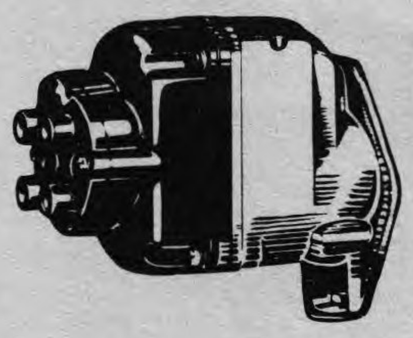


FAIRBANKS-MORSE

MAGNETO DIVISION — BELOIT, WISCONSIN

MAGNETO *Service* INFORMATION

BULLETIN FM194


NEW END CAP FOR TYPE FM-XV4C73 VERTICAL MAGNETO

Reports from the field indicate that during rain difficulty has been experienced with the FM-XV4C73 vertical magneto due to water getting into the end cap through the present vent holes.


End cap GX2430 originally used on this magneto should be replaced, no charge, by end cap identified as LY2430 on all FM-XV4C73 magnetos. If the magneto has not been used, the GX2430 end cap removed may be returned for credit.

If a magneto is brought in for repair which has seen service and water has collected therein, the magneto should be disassembled, the water removed, both the distributor chamber and the inside of magneto cleaned and dried thoroughly, and restored to a serviceable condition, using the LY2430 end cap, all at no charge. There is also the possibility that in some cases the magnetic rotor should be replaced, also on a warranty basis.

We request that at least one LY2430 end cap be carried in stock, which, if not used, may be returned for credit at a later date.

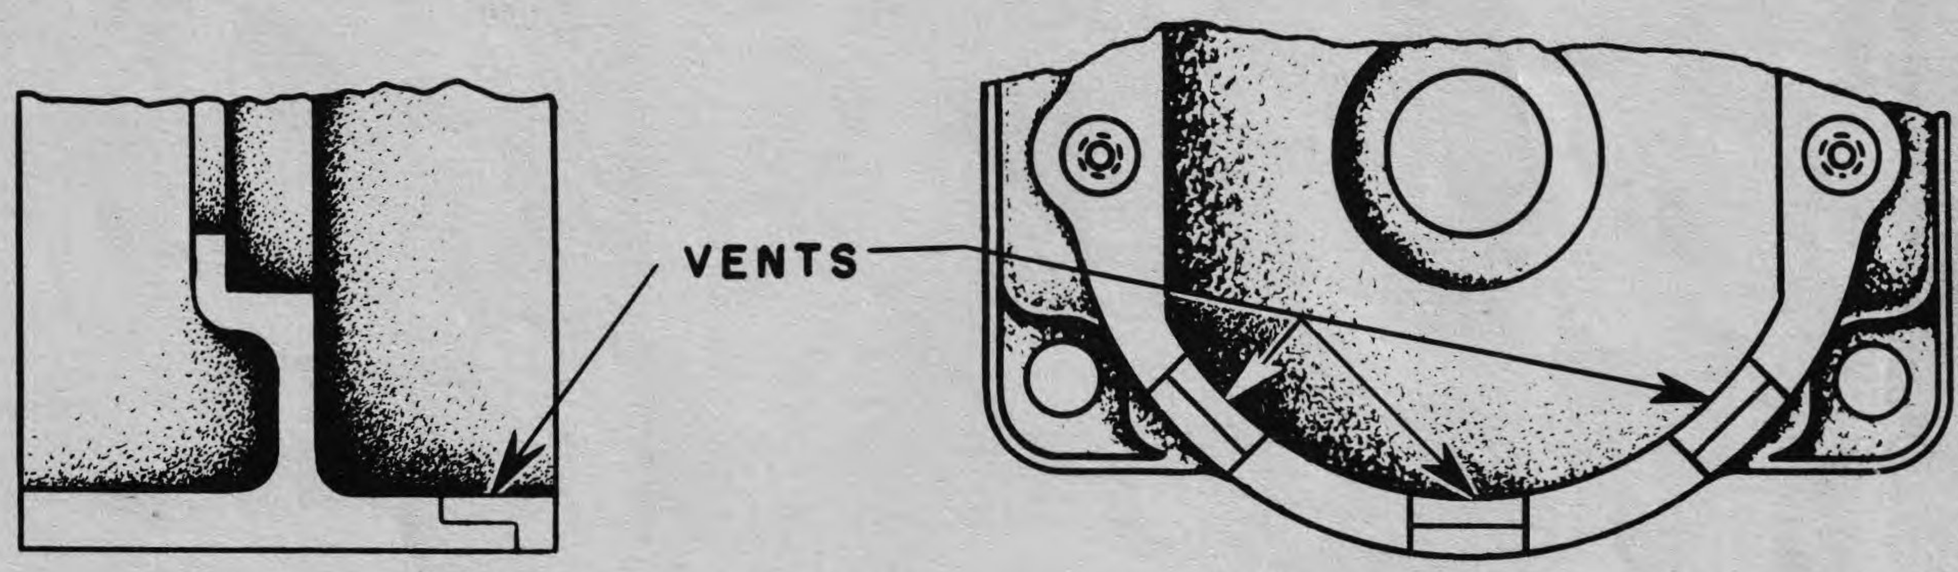

GX2430 End Cap

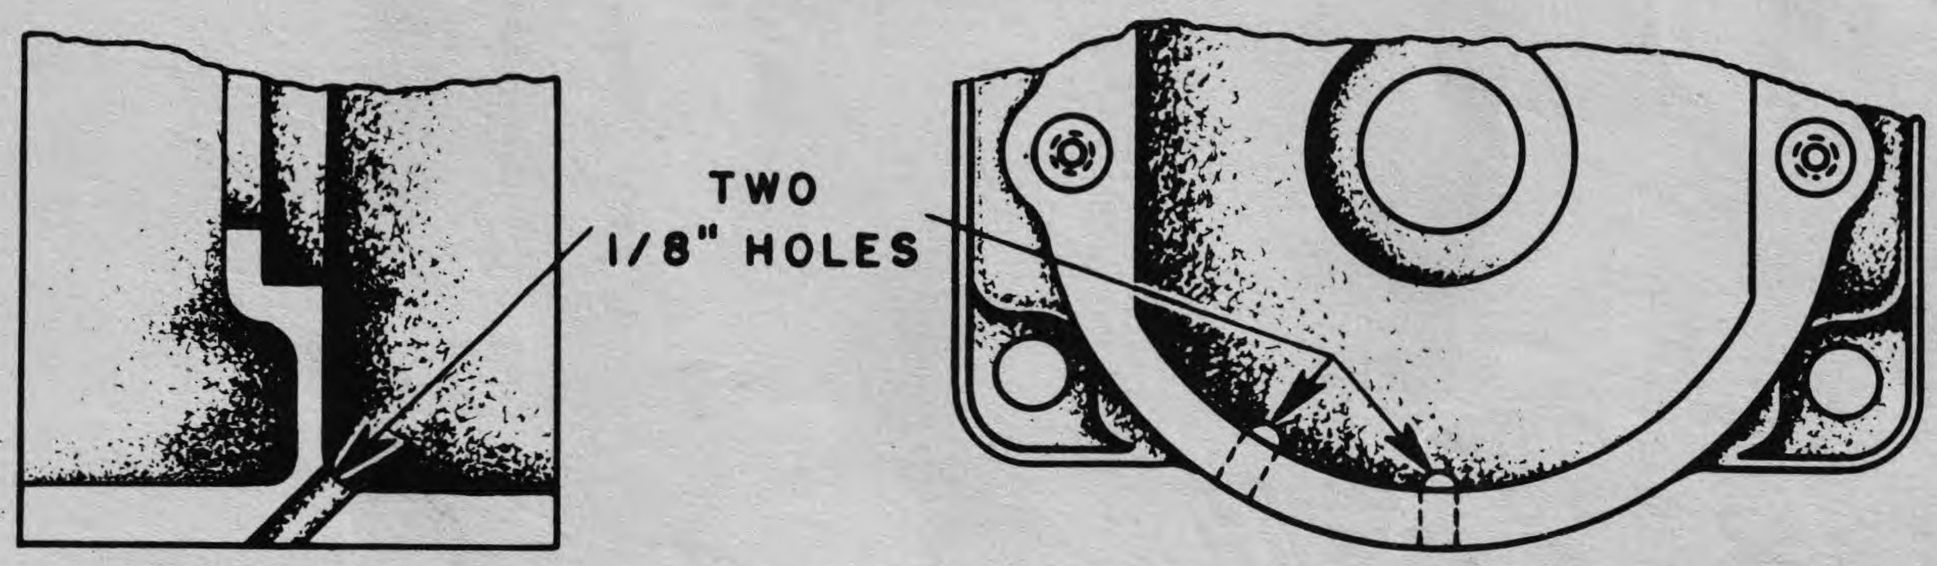

New LY2430 End Cap

Bulletin FM194
August 15, 1952

396990-075206M-BDN

File Section - *TYPE FM-X*