



TECH TIPS


Dixie Part Numbers: A-8245 A-8302 A-8304
A-8321 A-8330

Applications: 1990 – 1994 Eagle Talon
1990 – 1994 Plymouth Laser

Condition: The technician may have problems trouble shooting the charging system.

Cause: A possible cause for this is the generator circuit sub-fusible link (80A) located in the generator circuit.

Correction: Check the generator circuit sub-fusible link located on the right hand side of the engine compartment. See the sketch below for the location of the alternator circuit sub-fusible link.

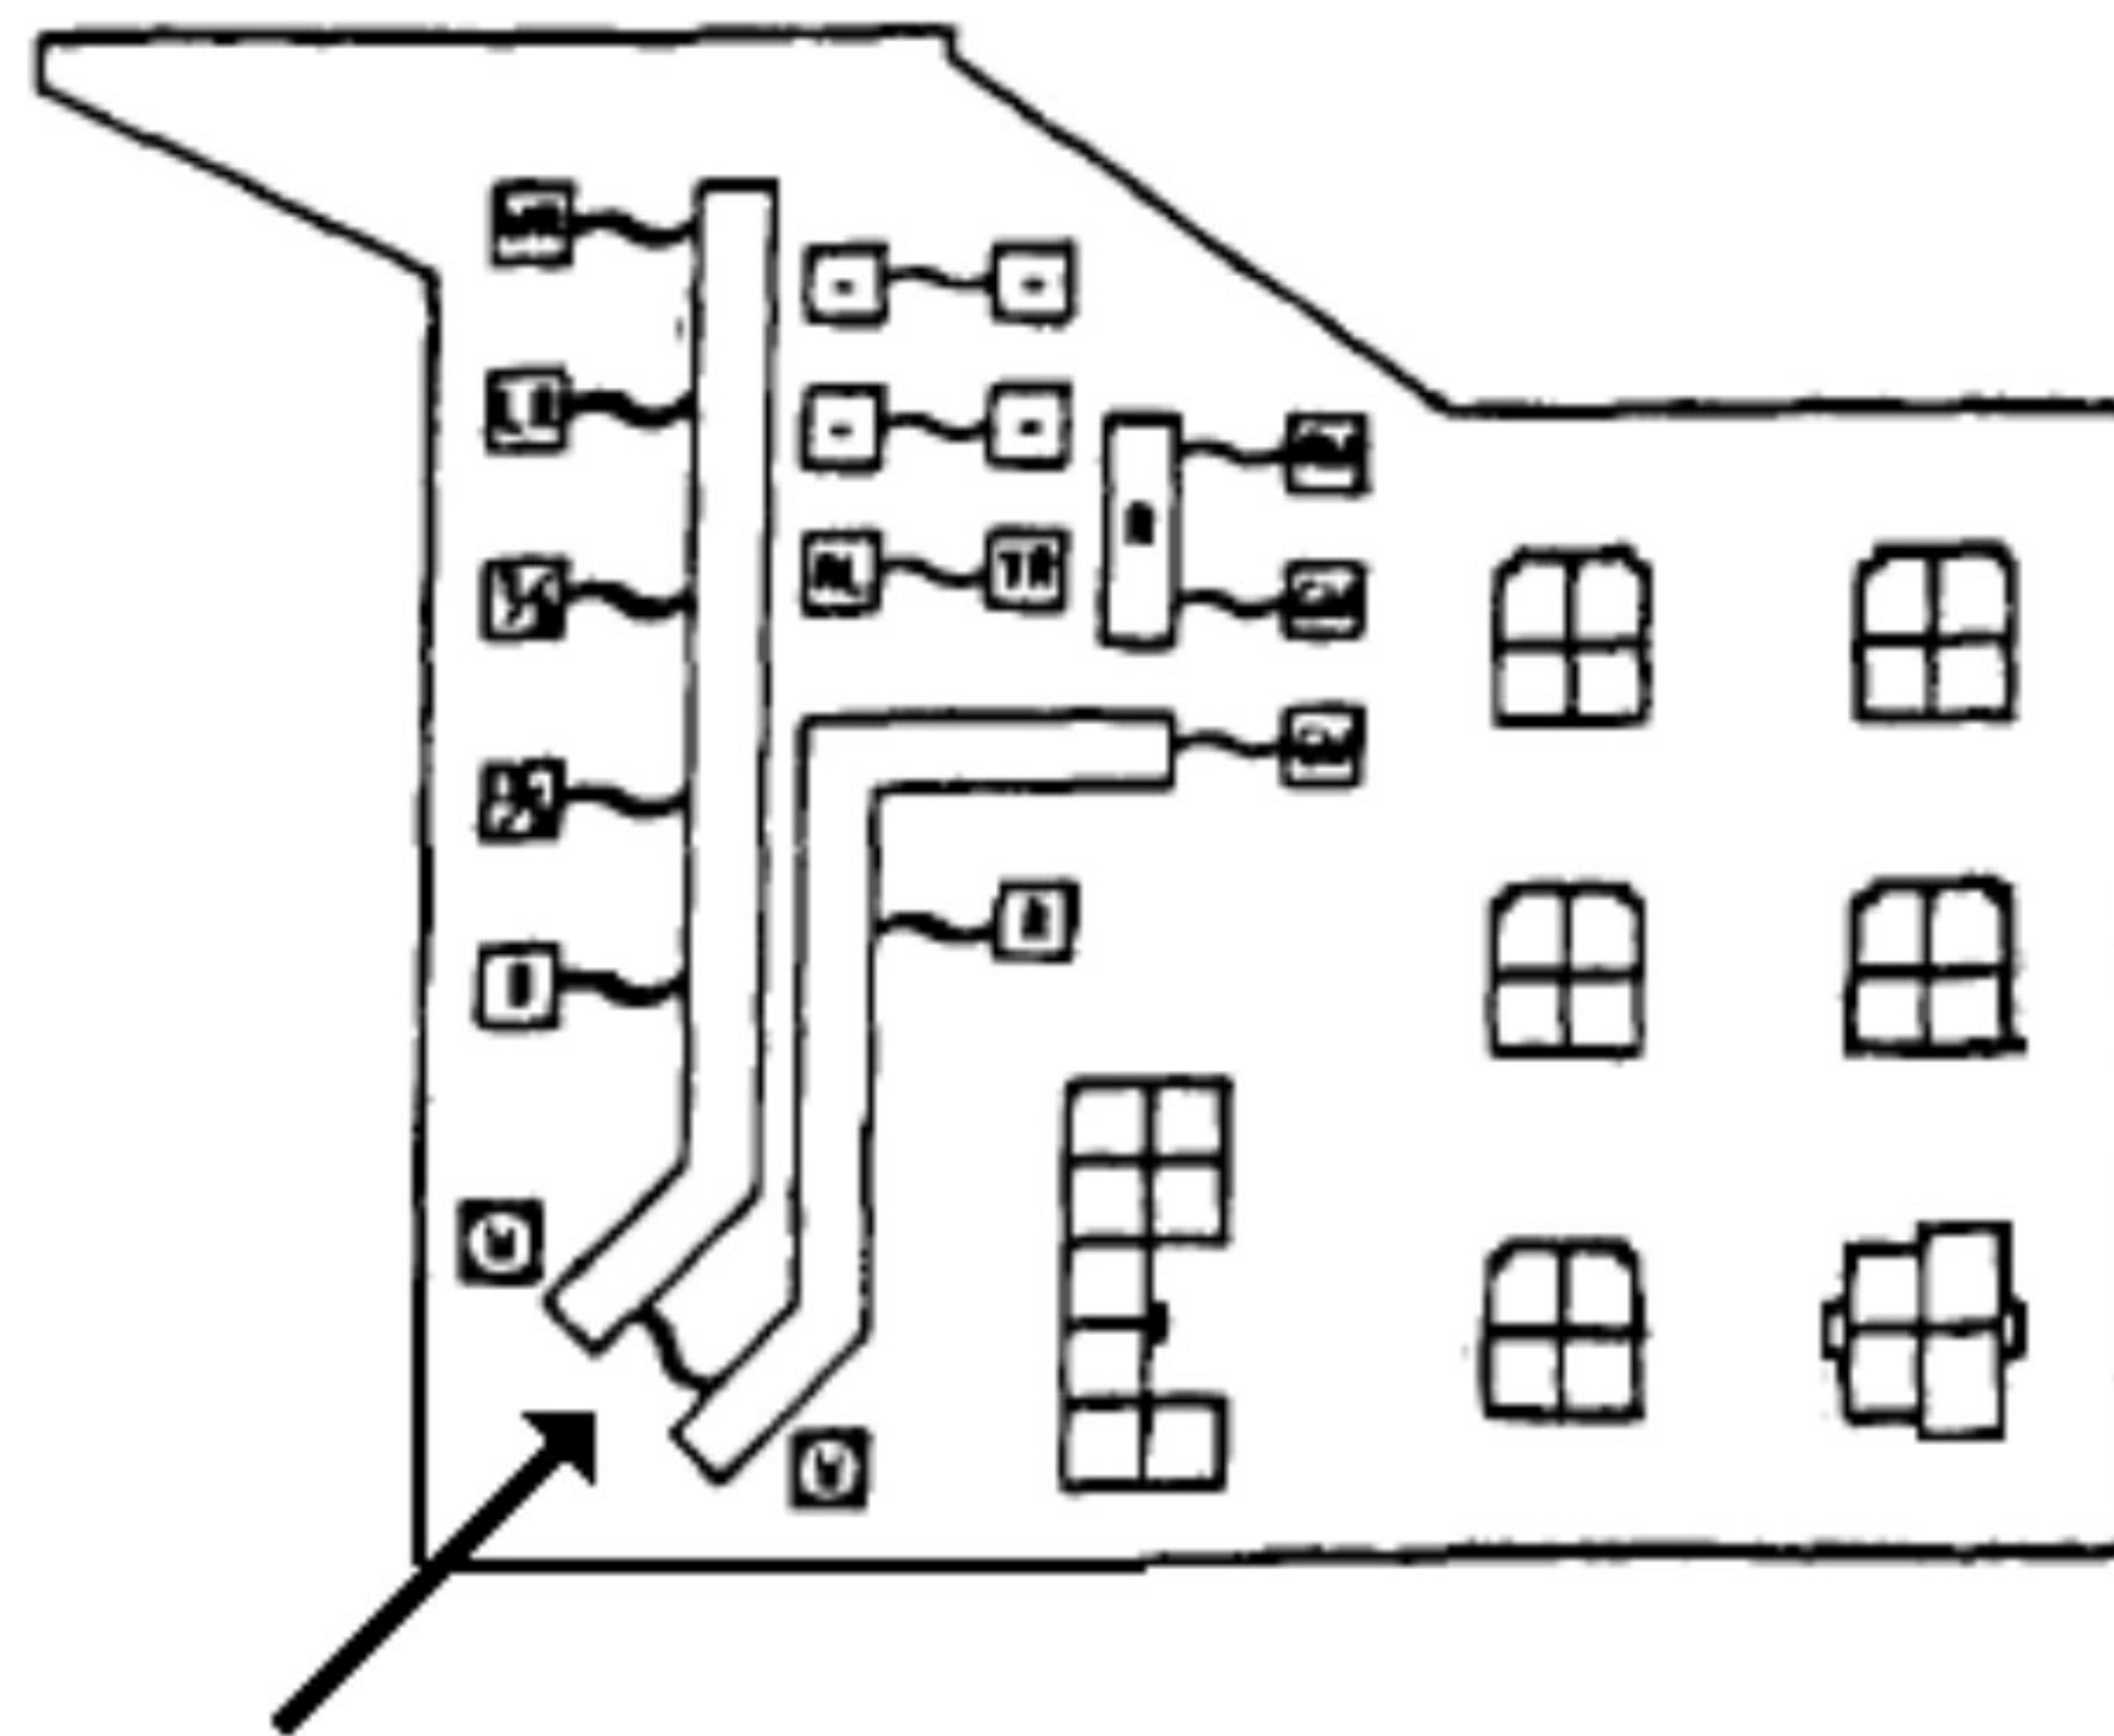

Alternator Circuit
Sub-fusible link

Revisions: 20090923 Updated wording, added sub-fusible link rating